

Certified, Filed and or Recorded on  
Mar. 23, 2010 AT 11:49AM


Signed: Ju  
MARILYN J NOVAK G V I  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 29, Township 37, Range 30  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:


- On \_\_\_\_\_ found a \_\_\_\_\_  
DATE
- left monument as found     lowered monument     removed monument (explain)
- On 8-1-06 placed an 1/2" I.P. # 1955Z  
DATE

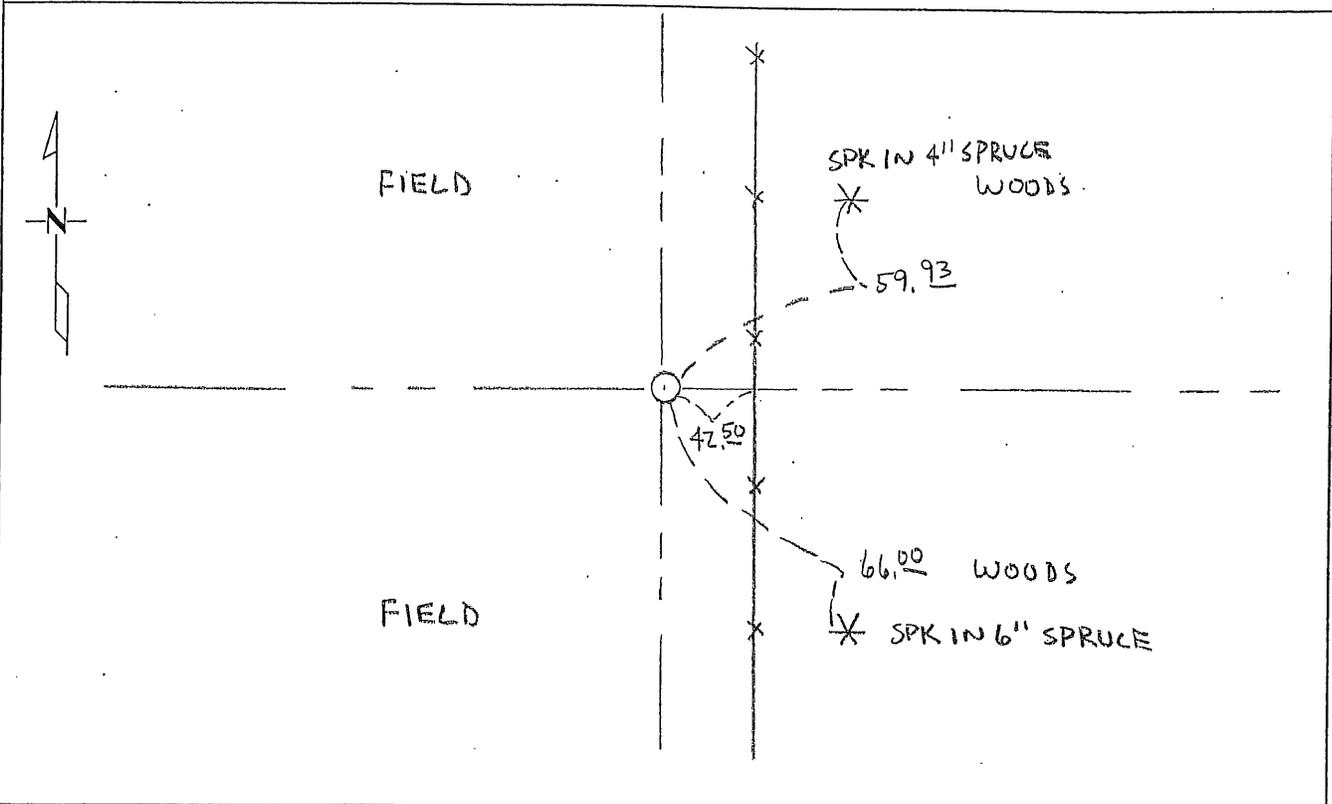

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wittstock Date 3-22-2010 License No. 19552  
 Title:     Land Surveyor     Professional Engineer     County Surveyor     County Engineer

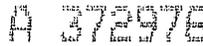

**Statement of Evidence:**

**G291**

North Quarter Corner of Section 29, Township 37 North, Range 30 West, Mayhew Lake Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1852 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

5" Blk. Oak	N 30 ½ W	45 links
4" Blk. Oak	S 55 W	23 links

2001 Westwood Professional Services, Inc. set a ½" iron pipe with cap No. 23002 at the lost position between theoretical computed positions of the section corners. Distances to section corners was 2673.69 feet. Corner position falls 32 feet west of a north-south fence line on the west edge of a dirt trail and in line with a field line to the north. No ties available.

County Coordinates determined from traverse information:  
 NAD 83 (1996 Adjustment)  
 N- 142820.31  
 E- 486793.29

*(NOTE: Questionable method was used to establish the section corners, which makes this corner position questionable.)*

2002 No record evidence of this corner has been found in the Benton County records.

2006 The Benton County Surveyor's Office found the iron set in 2001 in poor condition and the north-south fence line. The lost position was computed from established section corners falling 42.5 feet west of the north-south fence and 10 west and 13 feet south of the 2001 position. The distance to section corners is 2662.74. A ½" iron pipe capped 19552 was set at the lost position and reference ties established.

NAD 83 (1996 Adjustment)  
 N- 142807.152  
 E- 486782.231