

Certified, Filed and or Recorded on
July 27, 2010 AT 11:42AM


Signed: BW
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 25, Township 38, Range 29
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 07/14/10 found a CAST IRON MONUMENT DOWN 21.6 FT ON N/S
CENTERLINE AND 1 FT SOUTH OF FENCELINE WEST
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

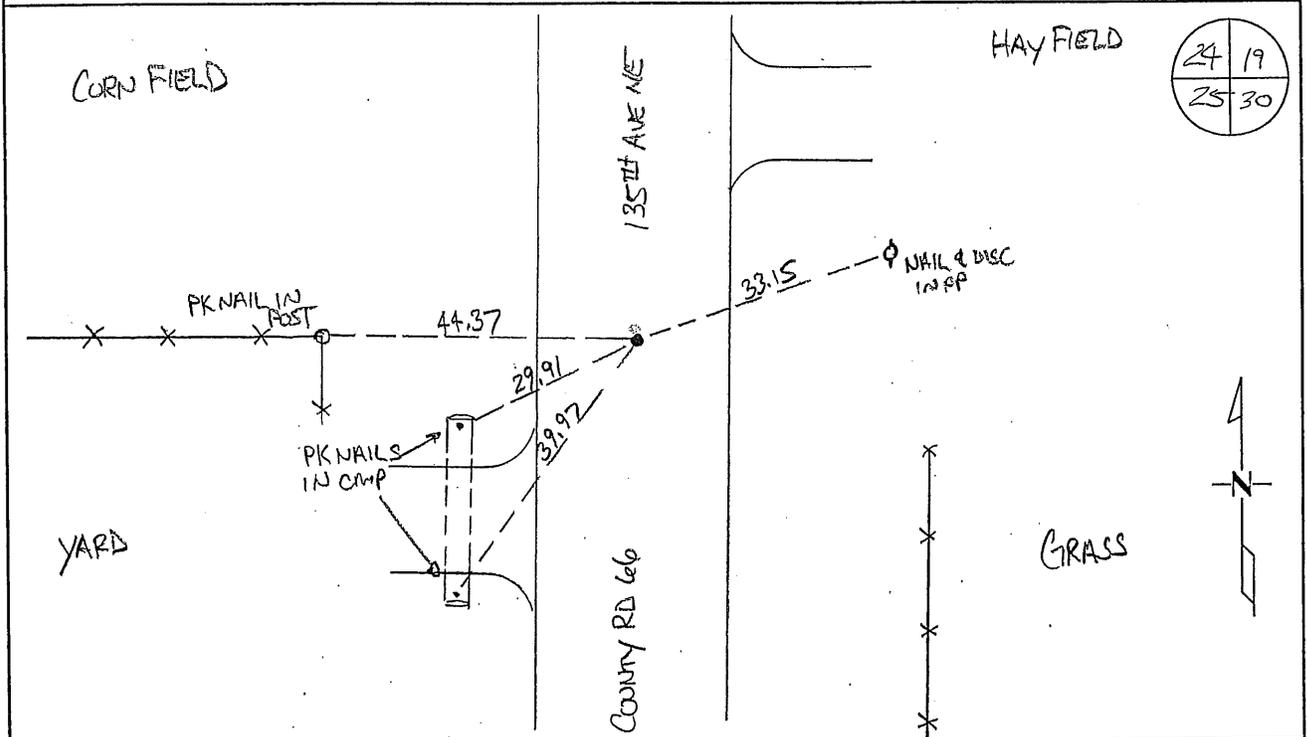

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wittstock
Benton County Surveyor
License No. 19552

Date: 7/26/2010

Benton County Surveyor's Office
 Jerome C. Wittstock, County Surveyor
 Minnesota License No. 19552

Statement of Evidence:

B252

Northeast Corner of Section 25, Township 38 North, Range 29 West, Alberta Township,
 4th Principal Meridian, Benton County, Minnesota.

1849 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

| | | | |
|-----------|--------|----------|----------|
| 8" B. Oak | N 11 E | 8 links | |
| 8" B. Oak | S 31 E | | 22 links |
| 6" W Ash | S 20 W | 8 links | |
| 10" Sugar | N 70 W | 28 links | |

1912 County Surveyor's Record Book 2, page 306, lists new ties to a post:

| | | |
|------|-----------|---------|
| Elm | N 28-30 E | 44 feet |
| T.P. | N 28-00 W | 32 feet |

County Engineer's Notebook No. 2, pages 49 and 50, contains a road survey for SR No. 14 by M. J. Cleveland. Survey runs from south on section line and terminates at this corner. Notes show post at the corner. Ties same as above.

1924 County Surveyor's Record Book 2, page 284, and Record Book A, Map No. 46, shows a survey subdividing Section 24. Corner is shown as a post.

1936 County Engineer's Notebook No. 101 shows survey for road running south to north. Notes show corner marked by an iron with fence lines east and west. Ties:

| | | |
|---------|----|--------|
| 10" Oak | SE | 65.5' |
| 24" Elm | SW | 107.4' |

1973 County Surveyor's Record Book 2, Page 284 gives ties to a found iron:

| | | |
|------------|------|------|
| 15" Elm | East | 35.7 |
| 20" R. Oak | SE | 67.7 |
| 5" Elm | West | 52.4 |

(Also noted in Notebook No. 101)

2001 Westwood Professional Services, Inc. found a RR Spike at the intersection of the centerlines of County Road 66 (running north and south) and fence lines (running east and west). RR spike fit with ties to the oaks to the SE. Westwood Professional Services, Inc. set a cast iron monument at the location of the RR Spike and established new reference ties.

| | | | |
|-----------|------------|----|----------------|
| Old ties: | 28" W. Oak | SE | 65.32 to spike |
| | 32" W. Oak | SE | 67.7 |

2004 County Coordinates Obtained by GPS to CIM
 NAD 83 (1996 Adjustment)
 N- 174992.489
 E- 542301.162

2010 The Benton County Surveyor's Office found the CIM set in 2001 in place of the railroad spike fitting the ties from 1936 and 1973, as well as, the fence line west. The 2004 coordinates were verified and new reference ties were established as shown.