

271525

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

JAN 30 4 03 PM '01

ALICE O. ENGELMEYER
COUNTY RECORDER

BY Mn DEPUTY ym

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 32, Township 38 N, Range 31 W
4th Principal Meridian, State of Minnesota, County of BENTON

At the corner location shown on the sketch:

On 11/10/2000 found a 1/2" x 24" IRON PIPE (FLUSH) AND A 1/4" IRON PIPE, DOWN 1.6'
DATE

left monument as found lowered monument removed monument (explain)

On 11/24/2000 placed a BENTON COUNTY CAST IRON MONUMENT (DOWN 0.3')
DATE
OVER THE 1/4" IRON PIPE'. THE 1/2" IRON PIPE WAS REMOVED.

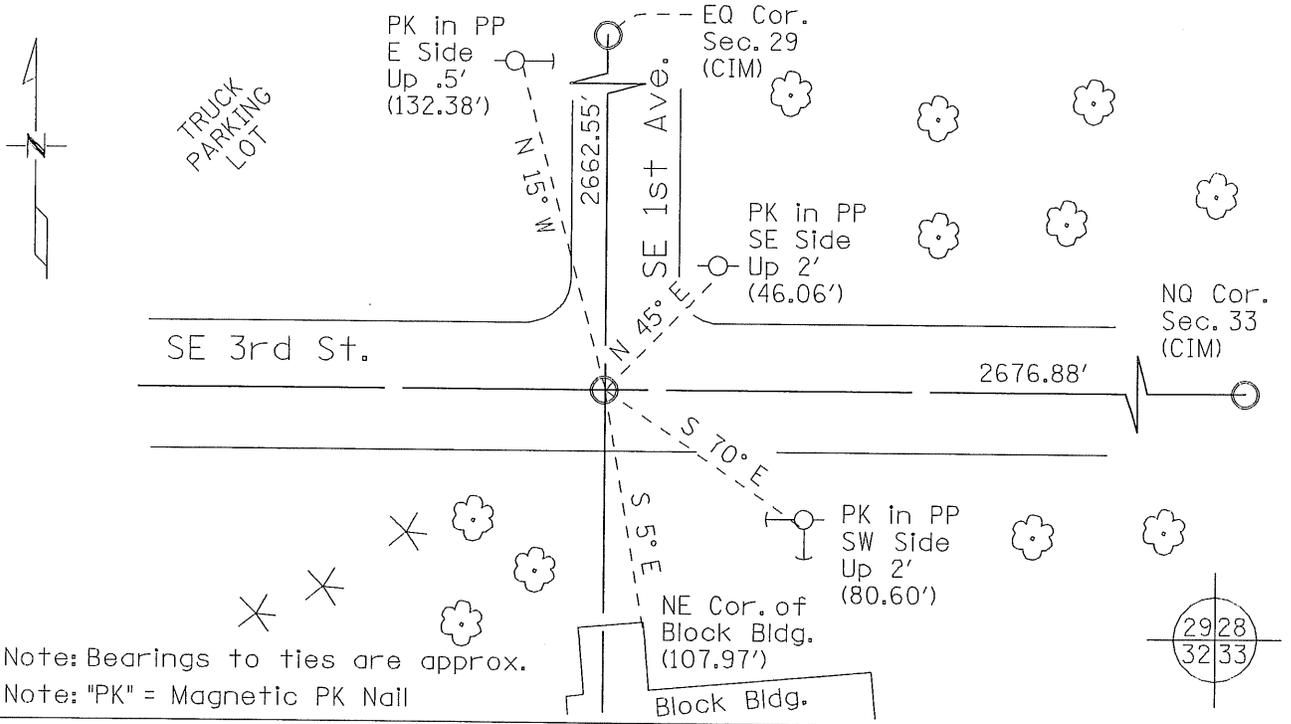

Note: Bearings to ties are approx.
Note: "PK" = Magnetic PK Nail

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision.

Signature Samuel J. Deleo Date 1-15-2001 License No. 40341
Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence

Northeast Corner of Section 32, Twp. 38 N, Rng. 31 W
4th P.M., Benton County, Minnesota

Copies of notes from the original GLO survey, located in the office of the Benton County Highway Department, state that a wood post was set to mark the corner 80.98 chains West, from the NE Cor. of Sec. 33. No ties to the post are listed.

1942; Minnesota Department of Highways R/W map (Index #33-100) for S. P. 0502 (TH 10) lists the corner as " Sec. Cor. at Int. of Rds. E. W. N. ". There are no dimensions, ties, or monuments listed. A Minnesota Department of Highways R/W map labeled "Belt Line In Rice", date unknown, also lists the corner as " Sec. Cor. at Int. of Rds. E. W. N. ". It also refers to a ½" I. Pipe as being inplace. It shows distances cumulative to 2681.5feet from the NE Corner of Section 32 to the North Quarter Corner of Section 33. It doesn't specify a monument type for the North Quarter Corner of Section 33. Both of these maps are on file at the Minnesota Department of Transportation in Baxter and in St. Cloud.

March 1957; A survey by M.B. Lang CE labeled "Survey of Tract Frac. Sections 32 & 33 T 38 N, R 31 W" specifies this corner as being marked by an "I. M.". Copy of said survey was obtained at the office of David Regan Land Surveying, St. Cloud.

August 1972; William Lunser, RLS #9394 found a ½" iron pipe inplace. He recorded reference ties and filed a Certificate of Location of Government Corner. Refer to Document No. 133451 in the office of the Benton County Recorder.


November 2000; Sam DeLeo, RLS #40341, found a ½" iron pipe flush in the bituminous surface of the intersecting roads. The ½" by 24" iron pipe was removed and a 1 ¼" iron pipe was found under the ½" iron pipe at a depth of 1.6' below the bituminous surface. The ½" by 24" iron pipe was replaced with a Benton County cast iron monument which was set over the 1 ¼" iron pipe. New ties were recorded and a new Certificate of Location of Government Corner was made.

Langola

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

I hereby certify that on the 25 day of August, 1972
I did find _____ the northeast corner of Section 32,
Twp. 38, Rg. 31, Benton County, Minnesota, which
was evidenced by 1/2" iron pipe found in place

I further certify that in order to perpetuate said corner I did
at the exact location thereof place a permanent marker consisting
of _____ left as it was _____ and that
I did establish witness or reference monuments as shown below:

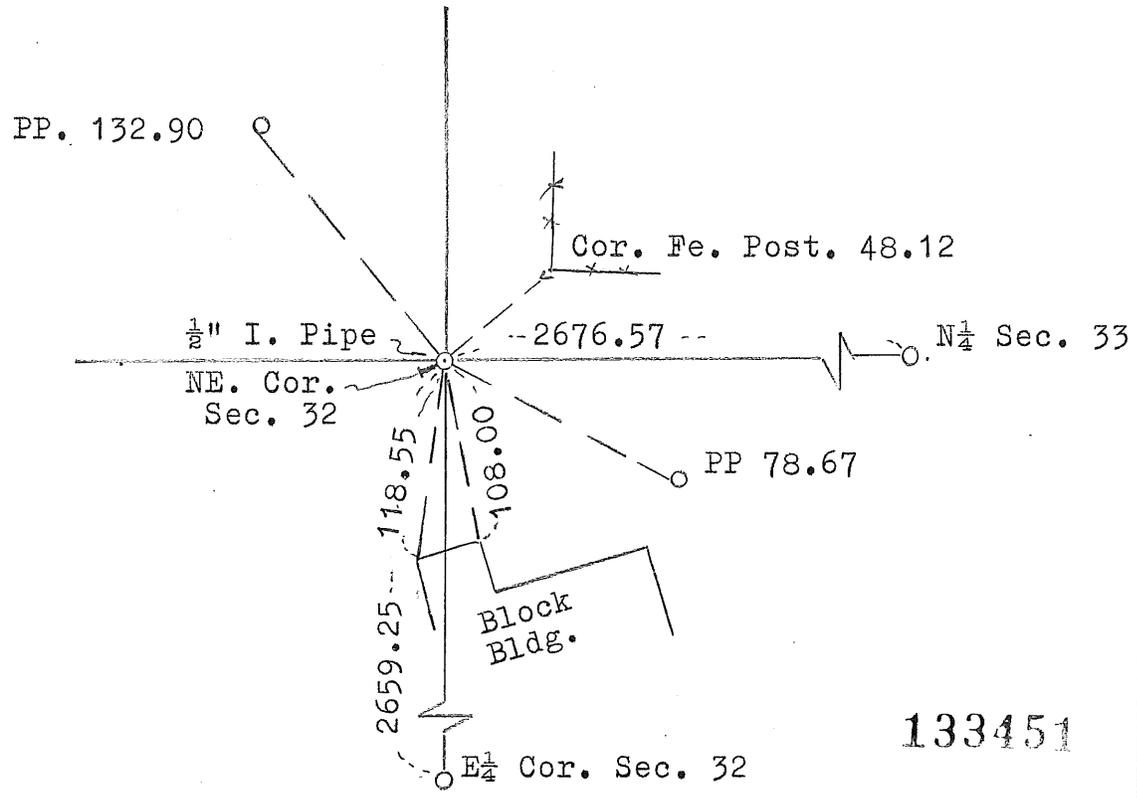

I hereby certify that the above is true and correct and that I am a registered Land Surveyor under the laws of the State of Minnesota.

William F. Johnson

Minn. Registration No. 9394

Office of the Register of Deeds,
Benton County, Minn.

I hereby certify that the within instrument was filed for record in this office on the 9th day of February, 1973.

J. O. Johnson
Register of Deeds

By *Marilyn Novak* Deputy.

133451