

Certified, Filed and or Recorded on
MAR. 30, 2007 AT 01:44PM

Signed: BW
MARILYN J NOVAK SVI
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NE Corner of Section 2, Township 37, Range 29
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On _____ found a _____
DATE

left monument as found lowered monument removed monument (explain)

On 6-21-06 placed an 1 1/2" PIPE CAPPED 1955Z
DATE

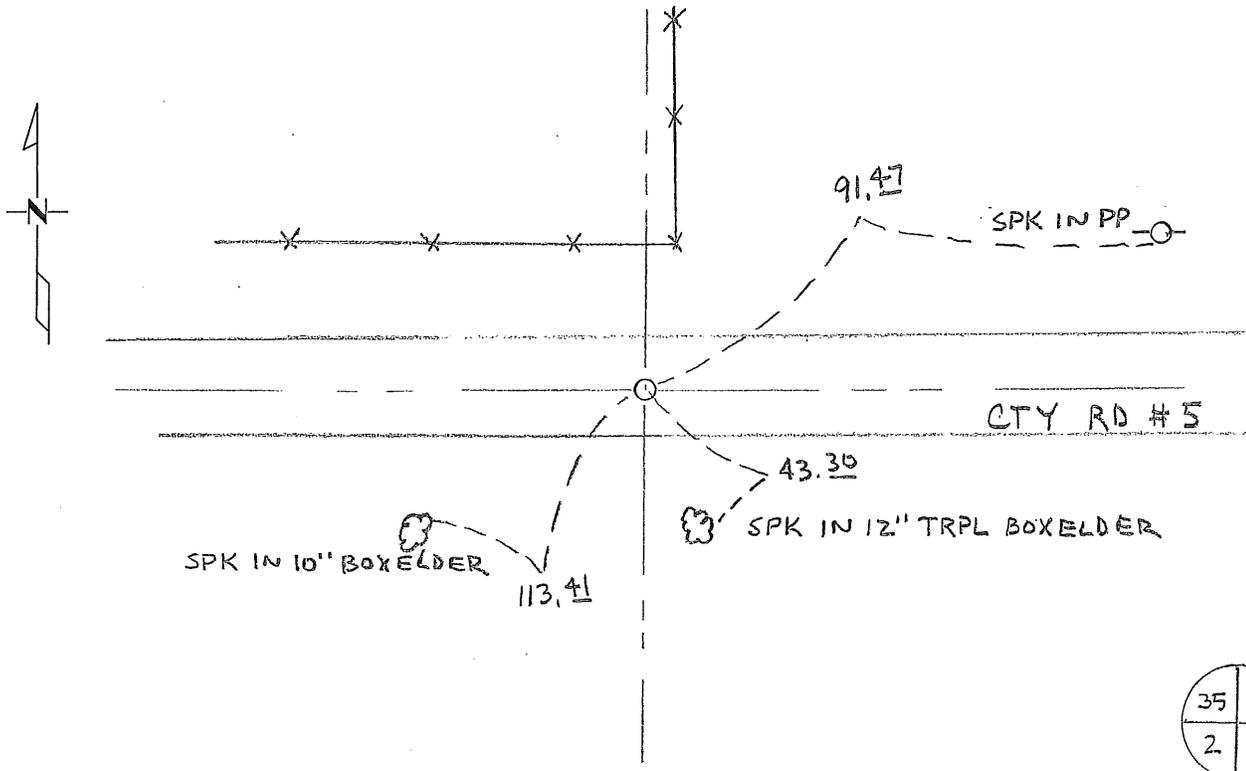

35	36
2	1

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature: Jerome C. Wittstock Date: 28 MARCH 2007 License No. 19552

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

H022

The Northeast Corner of Section 2, Township 37 North, Range 29 West, Gilmanton Township, 4th Principal Meridian, Benton County, Minnesota.

- 1849 Original US General Land Office survey established corner marked with a wood post with bearing trees noted as:
- | | | |
|------------|----------|-----------|
| 8'W Oak | N 30 E | 79 links |
| 6'Maple | S 52 ½ W | 80 links |
| 8'Basswood | S 35 E | 162 links |
- 1905 Affidavit by Felix Parent, County Surveyor, states corner located in 1892 from Gov't BT and is same position determined by him in 1904 survey.
- 1914 County Engineers' Notebook No. 7, page 11, contains a road survey by M.J. Cleveland where survey ran east-west along town line. Notes show corner with fence corner North 31 feet.
- 1921 County Engineers' Notebook No. 39 shows survey of road on town line with corner marked by a granite monument. 1922 notes in Notebook No. 28 gives ties to granite monument in center of road:
- | | | | | | |
|----|---|------|----|---|------|
| FP | N | 32.0 | FP | S | 32.0 |
|----|---|------|----|---|------|
- Same ties listed in County Surveyor's Record Book 1, page 296, to a granite monument.
- 1955 County Engineer's Notebook No. 202 shows a survey of SAR 5 running west to east on town line. Corner is shown marked by a granite monument in center of road with fences north and south. 1961 ties are noted as below to be placed iron over. Same ties as listed below in 1955 and 1961.
- 1955 County Surveyor's Record Book 1, page 463 notes iron over a granite monument with the following reference ties:
- | | | |
|--------------------|----|-------|
| PP | NW | 25.65 |
| 3 rd FP | N | 62.0 |
| 12'W Oak | NW | 207.4 |
- NOTE: Older record (Prior to 1900) shows ties by D. B. Carmon:
- | | | |
|------------|--------|----------|
| 14'W.Oak | N 42 E | 81 feet |
| Beaver Dam | East | 137 feet |
- 1961 County Surveyor's Record Book 1, page 463 notes the following reference ties
- | | | |
|-------|----|-------|
| PP | NE | 91.4 |
| TP | SE | 161.0 |
| 6'Elm | S | 116.7 |
- 2006 Excavated 12-foot by 8-foot by 4-foot deep hole. Neither the original government corner post nor bearing trees were found. Down 3 feet, a 8-inch by 8-inch cut granite stone inscribed "SC" with a hole marked in the center was found. A large field stone was found on the north side of the found granite. The granite was found in the east/west centerline of CSAH 5. The granite fits well with resurvey distances to the east and west. Believing the granite stone to be the one set by Mr. Parent in 1892 from the original government bearing tree to be the best available evidence of the corner, a ½ inch by 15 inch iron pipe with cap marked 19552 was set.

Coordinates Obtained by GPS
NAD 83 (1996 Adjustment)
N-164365.135
E- 537121.623