

Certified, Filed and or Recorded on
OCT. 26, 2005 AT 03:40:00PM


Signed: BW
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 8, Township 36 North, Range 28 West,
4th Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 9/8/2005 found a 1/2' Iron Pipe with Cap No. 9394
DATE
- left monument as found lowered monument removed monument (explain)
- On _____ placed a _____
DATE

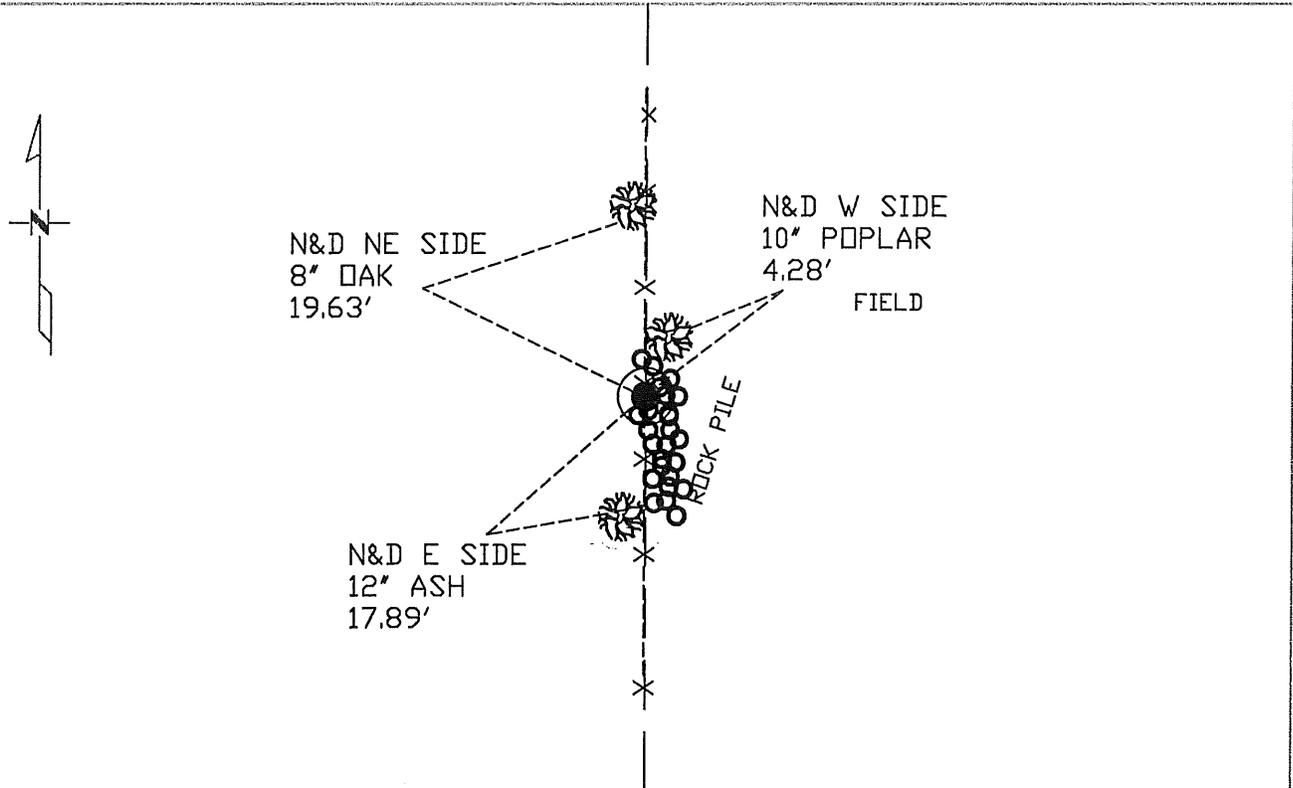

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Signature] Date 10/19/2005 License No. 12684
 Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

J083

East Quarter Corner of Section 8, Township 36 North, Range 28 West, Glendorado Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

- | | | |
|-------------|------------|----------|
| 14" Elm | S 59 W | 50 links |
| 12" Blk Ash | N 11 1/2 E | 59 links |

1914 County Surveyor's Record Book 1, pages 23 and 24, and Record Book A, Map No. 1 shows a survey for the subdivision of Section 8 by J.P. Soderstrum. He found no evidence of the corner and placed corner on true line and equal distant (lost) and notes a stake set for the corner with a distance of 39.88 chains (2632.08 feet) to the NE corner and a distance of 39.87 chains (2631.42 feet) to the SE corner. Ties:

- | | | |
|---------|-----------|----------|
| 20" Oak | S 33-30 W | 18 links |
| 6" Oak | NW | 2 links |

2005 WSN measured 5270.76 feet between section corners. Compares well with Soderstrum's distance of 79.75 chains (5263.5 feet). Located north-south fence line near corner that fit straight line between approximate section corners. Found no evidence of a corner marker or the 1914 BT's. The area falls in rock pile that has been created from area fields. William Lunser, LS 9394, reported setting the corner. On 9/8/05 we found a 1/2" iron pipe with cap No. 9394 at the lost position, midway and on line between section corners.

County Coordinates to lost position:
NAD 83 (1996 Adjustment)
N- 124279.442
E- 552962.611