

Certified, Filed and or Recorded on
OCT. 26, 2005 AT 03:35:00PM


Signed: BW
MARILYN J NOVAK 6 V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 18, Township 36 North, Range 28 West,
4th Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found lowered monument removed monument (explain)
- On 9/8/2005 placed a Cast Iron Monument
DATE

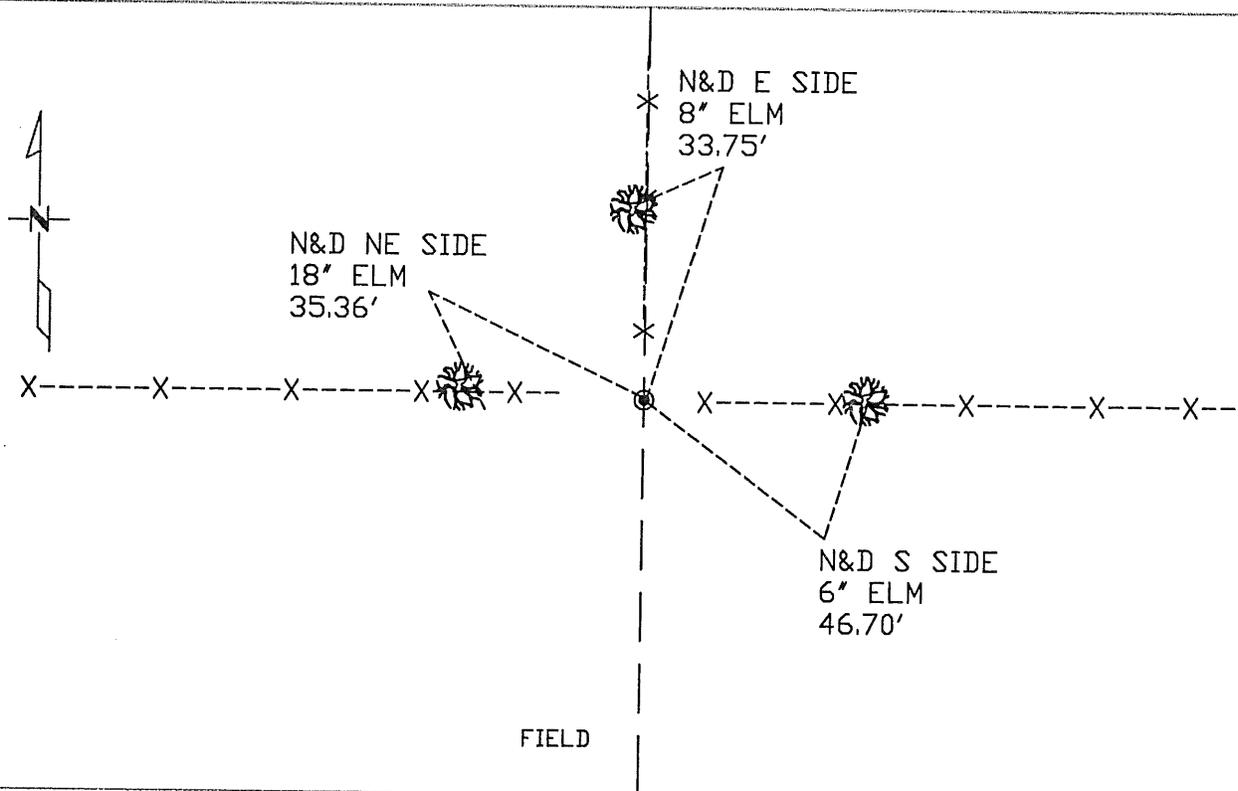

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a Licensed Land Surveyor under the laws of the State of Minnesota,

Signature [Signature] Date 10/19/2005 License No. 12684

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

J183

East Quarter Corner of Section 18, Township 36 North, Range 28 West, Glendorado Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

9" Poplar	N 57 E	7 links
9" Poplar	N 20 W	10 links

1914 County Surveyor's Record Book 1, page 41 & 42, and Record Book A, Map No. 2 contains a survey of Section 17 by J.P. Soderstrum. He notes that he found no stake or BT's, but used old fence line west for the corner. Ignored fence line east that was 0.20 chains farther south. He gives distances of 40.56 chains (2676.96 feet) to the NE corner and 40.48 chains (2671.68 feet) to the SE corner. Ties:

16" Elm	SE	62 links
8" Poplar	NE	48 links

2005 WSN found no evidence of a corner marker or BT's and set a spike at intersection of fence lines east, west, and north. Measured 2679.15 feet to SE corner and 2679.41 feet to the NE corner. Spike is basically midway and 4.45 feet east of a straight line between section corners and within 3 feet of a proportion to Soderstrum's distance in 1914. Accepted fence intersection as the best evidence of the corner's obliterated position and replaced the spike with a cast iron monument.

County Coordinates obtained by side-tie:

NAD 83 (1996 Adjustment)

N- 119021.901

E- 547893.544