

MARILYN J. NOVAK
COUNTY RECORDER
BY CL DEPUTY

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

293734


2002 DEC 31 P 3:56

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter Corner of Section 7, Township 36, Range 28
4TH Principal Meridian, State of Minnesota, County of BENTON

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found lowered monument removed monument (explain)
- On 11/5/2002 placed a cast iron monument at the obliterated position
DATE of the section corner

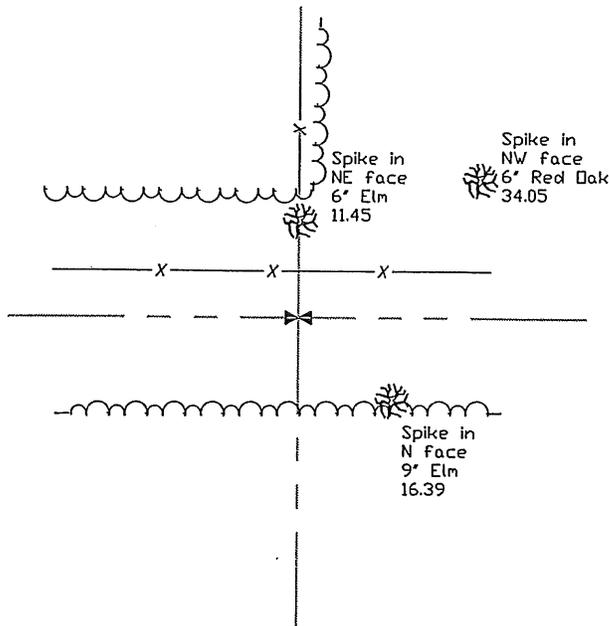

New ties are to the head of a nail with a disk marked "Corner Tie".

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Amy A. Alan Date 11/8/02 License No. 12684
Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

J071

The North Quarter Corner of Section 7, Township 36 North, Range 28 West, Glendorado Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Corner established by GLO and marked by a wood post with bearing trees noted as.

12" Blk Oak	S 61 E	25 links
6" Ironwood	N 12 E	26 links

2002 Westwood Professional Services, Inc. searched for evidence of this corner and found old fence lines running north, west, and east. No evidence of a corner marker or bearing trees were found. From the fence corner, we measured 2630.44 feet west to the NW corner of Sec. 7 and 2596.76 feet east to the NE corner of Sec. 7. The distance of 5226.96 feet between section corners is 157.50 feet longer than the GLO distance. The fence corner was found to 21 feet south of a straight line between section corners and 125 feet east of the lost position. We tied into occupation lines in the interior of Section 6, but these did not support either position. We accepted the fence corner as marking the obliterated position of the corner.

On November 5, Westwood Professional Services, Inc. set a cast iron monument at the obliterated position of the section corner and established reference ties.

County Coordinates
NAD 83 (1996 Adjustment)
N-127209.439
E-545148.717