

Certified, Filed and or Recorded on
OCT. 26, 2005 AT 03:47:00PM


Signed: BW
MARILYN J NOVAK B V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter Corner of Section 17, Township 36 North, Range 28 West,
4th Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found lowered monument removed monument (explain)
- On 8/4/2005 placed a 1/2' iron pipe with cap no. 12684
DATE

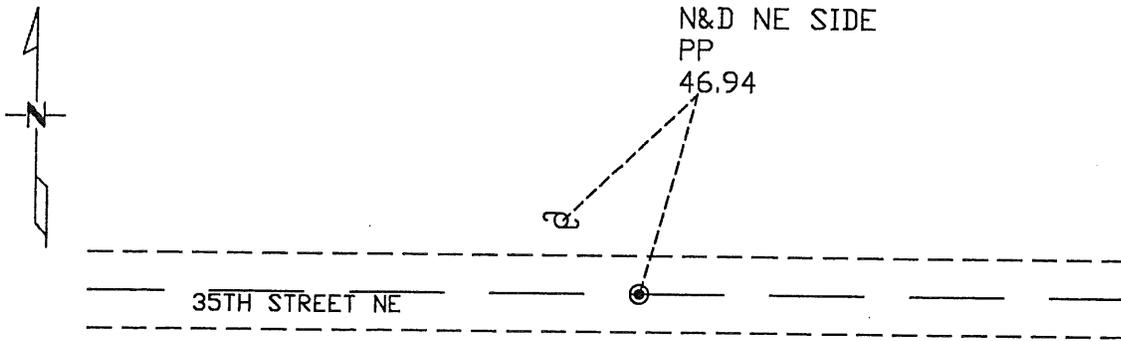

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Signature] Date 10/14/2005 License No. 12684

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

J171

North Quarter Corner of Section 17, Township 36 North, Range 28 West, Glendorado Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

16" Bur Oak	S 67 W	133 links
16" Bur Oak	N 80 W	153 links

1914 County Surveyor's Record Book 1, pages 23 and 24, and Record Book A, Map No. 1, shows a survey for the subdivision of Section 8 by J.P. Soderstrum. He found no evidence of the corner.

1914 County Surveyor's Record Book 1, page 41 & 42, and Record Book A, Map No. 2 contains a survey of Section 17 by J.P. Soderstrum. He did not find any corner and set a stake for this corner on true line and equidistance.

2005 WSN searched corner area and found no evidence of a corner marker. Corner falls in east-west gravel road with no physical evidence of occupation lines north or south. We measured 5135.64 feet between section corners. Since Soderstrum did not find the corner and reestablished it by lost methods, we set a 1/2" iron pipe for the corner by lost method, midway and on line between section corners.
County Coordinates to lost position:
NAD 83 (1996 Adjustment)
N- 121672.908
E- 550445.767