

A 331693

Certified, Filed and or Recorded on
OCT. 18, 2005 AT 11:27:00AM


Signed: *MJ*
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter Corner of Section 18, Township 36 North, Range 28 West,
4th Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 1/25/2005 found a splke
DATE
- left monument as found lowered monument removed monument (explain)
- On 8/4/2005 placed a Cast Iron Monument
DATE

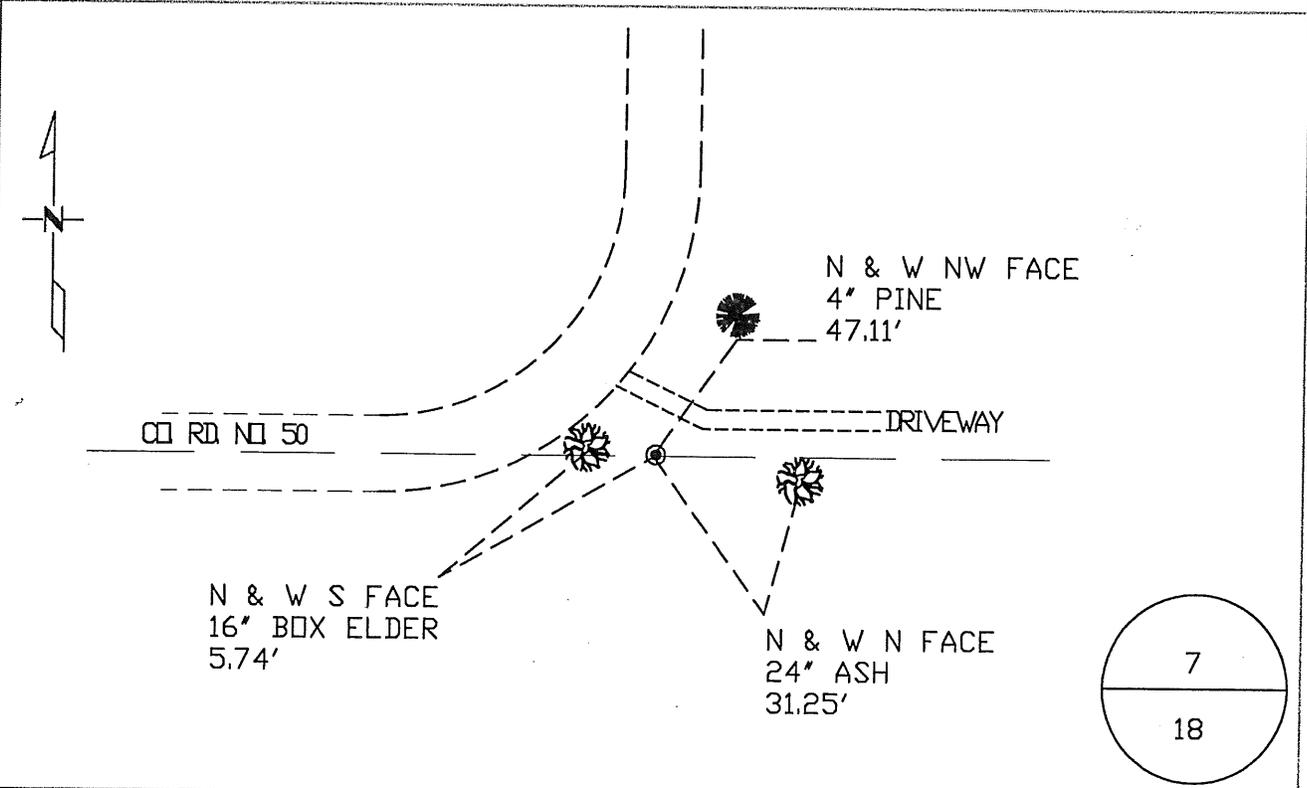

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature *Ann A. Allen* Date 10/13/2005 License No. 12684

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

J181

North Quarter Corner of Section 18, Township 36 North, Range 28 West, Glendorado Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

12" Ash	N 61 ½ E	36 links
6" Ash	S 30 E	15 links

2002 No resurvey information was found on this corner in the Benton County records.

2005 WSN found a spike at PI of roads running west and north. Spike appears to mark the obliterated corner position, with the road running north and west and a north-south fence line along the east line of the SE ¼ of the NW ¼, Section 18. We measured 2566.02 feet to the NE corner and 2658.69 feet to the NW corner with an overall distance of 5224.71 feet between section corners, which does not compare well with the GLO distance of 77.40 chains (5108.4 feet). The spike was found to be 1.7 feet south of a straight line between section corners and 134 feet east of the lost position. This same large discrepancy with the GLO distances and the lost position was also found for the ¼ corners along the north lines of Sections 7 and 19. Accepted the found spike as the best available evidence of the obliterated corner position and replaced the spike with a cast iron monument.

County Coordinates obtained by GPS to spike:

NAD 83 (1996 Adjustment)

N- 121865.524

E- 545317.349