

MARILYN J. NOVAK  
COUNTY RECORDER  
BY Marilyn J. Novak DEPUTY

OFFICE OF  
BENTON COUNTY RECORDER  
BENTON COUNTY, MN.  
CERTIFIED TO BE FILED  
AND/OR RECORDED ON

291176

2002 OCT 30 P 3: 21

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 6, Township 36, Range 28  
4TH Principal Meridian, State of Minnesota, County of BENTON

At the corner location shown on the sketch:

On \_\_\_\_\_ found a \_\_\_\_\_  
DATE

left monument as found     lowered monument     removed monument (explain)

On 8/30/02 placed a 1/2" IRON PIPE WITH CAP NO. 12684  
DATE

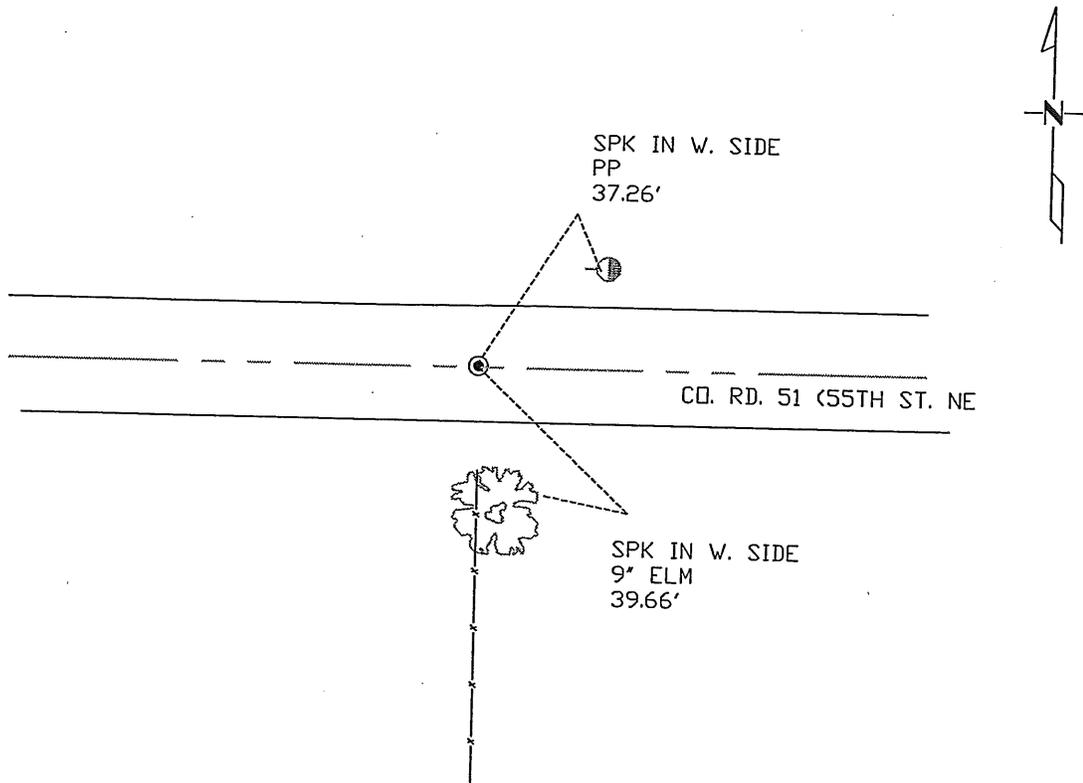

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Signature] Date 10/22/02 License No. 12684

Title:  Land Surveyor     Professional Engineer     County Surveyor     County Engineer

**Statement of Evidence:**

**J062**

The Northeast Corner of Section 6, Township 36 North, Range 28 West, Glendorado Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1849 Corner established by GLO and marked by a wood post with bearing trees noted as.

14" W. Oak	S 88 E	545 links (GONE)
18" Bur Oak	N 32 E	510 links (GONE)
6" W. Ash	N 65 W	212 links (GONE)
6" Elm	S 68 W	22 links (GONE)
Line Tree		
16" Elm	West	8.00 chains (GONE)

1915 In June 12, 1915, the County Surveyors records in Book 1, page 17 & 18 note J.P. Soderstrum set a W. Oak stake in the centerline of a road a FL north/south with the following reference ties (in links?). Also found no evidence of Gov't BT's, but found stump of Elm NE that checked with Whilt's BT.

TP	S 71 1/2 E	111
TP	N 77 E	157
TP	S 78 W	285
TP	N 68 1/4	96 1/2
Fen Cor	N	41 1/2
Fen Cor	S	52

This corner is 40.20 chains (2653.2') from the N ¼ Cor Sec 5 and 22.37 chains (1476.42') from the 1/16 corner on the west line of the NW Quarter of Sec 5.

2002 Westwood Professional Services, Inc. found no evidence of a corner marker at the centerline of County Road 51 (running east and west) and an occupation line to the south. We found no evidence of the original bearing trees or of the 1915 ties. We measured from this assumed corner position 2645.57 feet to the approximate N ¼ corner of Section 5 and measured 1475 feet south to a fence corner marking the occupied 1/16<sup>th</sup> line. These distances support the centerline of road and fence south as marking the same obliterated corner position as determined in 1915. We set a ½ " iron pipe and took ties.

**Coordinates**

NAD 83 (1996 Adjustment)

N-132572.950

E-547476.058