

Certified, Filed and or Recorded on
Sep. 23, 2008 AT 01:24PM


Signed: Bw
MARILYN J NOVAK B V
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

SOUTHEAST Corner of Section 31, Township 36N, Range 28W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 9/16/08 found a CIM AS SET BY SHELBURNE CO. SURVEYOR
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

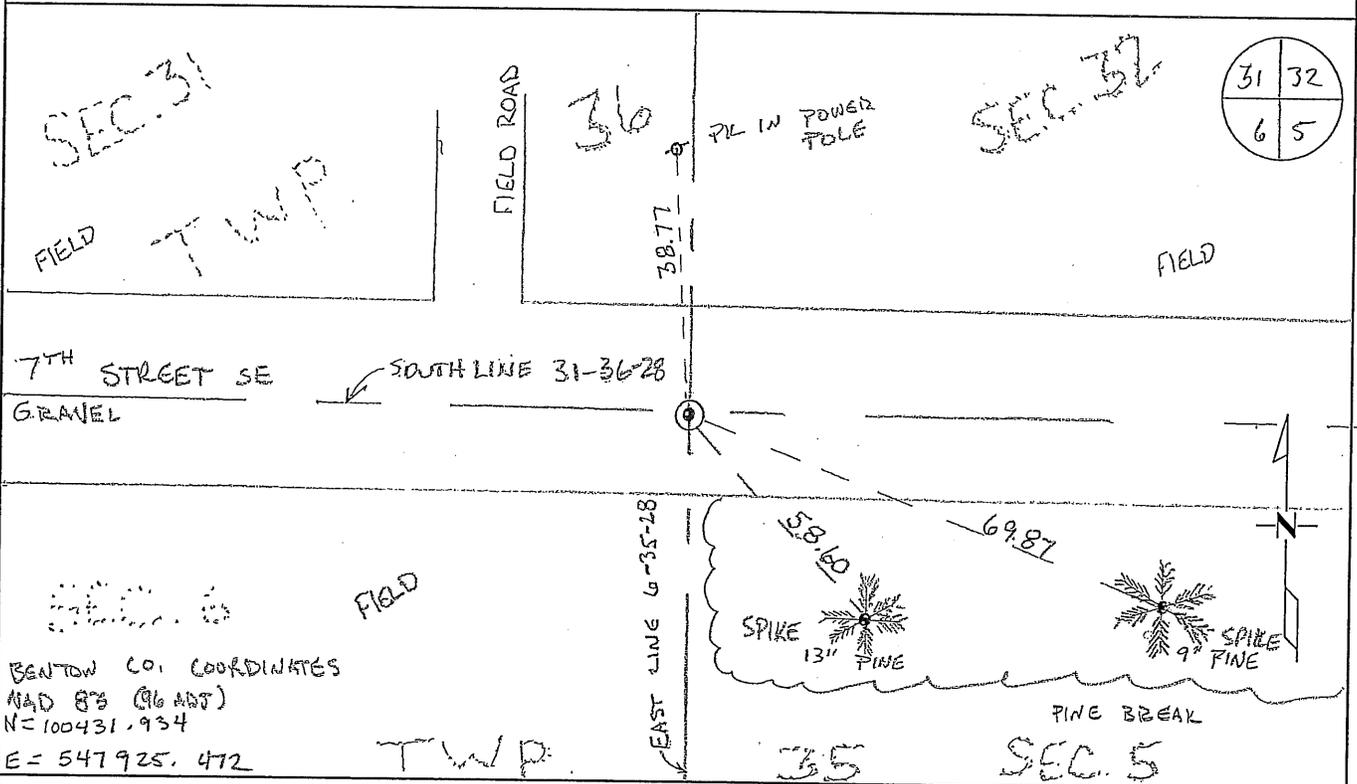

BENTON CO. COORDINATES
NAD 83 (96 ADT)
N = 100431.934
E = 547925.472

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jason W. Oley
Deputy Benton County Surveyor
License No. 45872

Date: 9/22/08

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:

J314

The Southeast Corner of Section 31, Township 36 North, Range 28 West, Glendorado Township, 4th Principal Meridian, Benton County, Minnesota.

- 1849 Original US General Land Office survey set a post for this corner and bearing trees were recorded.
- | | | |
|-------------|------------|-----------|
| 10" Bur Oak | N 12 ½ E | 494 links |
| 10" Bur Oak | S 62 2/3 E | 274 links |
| 8" Bur Oak | S 29 ¼ E | 528 links |
- 1916 County Surveyor's Record Book 1, page 69, and Record Book A, map No. 29, contains a survey of Section 31 by J. P. Soderstrum. Survey shows stake found at the corner on north side of road. Testimony of resident to effect that stake was in original location.
- 1922 Bradley Engineering Service shows survey in Section 31 to establish north-south ¼ line. Shows fence corner being the corner.
- 1976 John Oliver, LS 8194, set a cast iron monument in center of east-west road and occupation fence lines north and south. Certificate of location filed in Sherburne County as Doc. No. 139077.
- 2001 Sherburne County Surveyor found broken CIM and placed a new CIM and updated Certificate.
 County Coordinates converted from Sherburne County Coordinates:
 NAD 83 (1986 Adjustment)
 N- 100431.657
 E- 547925.989
2008. The Benton County Surveyor's Office found the CIM as set in 2001 by the Sherburne Co. Surveyor. This position gives an overall distance to the SE corner of Sec. 32 of 5297.62 ft., which agrees with N. Drolson's 1917 distance of 5292 ft. Position also agrees with Soderstrum's 1916 distance to the S1/4 Cor. of Section 31 of 40.32 ch. (2661.12 ft.), whereas the Benton County Surveyor measured 2662.99 ft. (40.34 ch.). Ties found check with Sherburne County's 2001 ties. The Surveyor accepts the CIM as marking the obliterated position from Drolson's and Soderstroms' earlier surveys.

Benton County Coordinates obtained by GPS
 NAD 83 (1996 Adjustment)
 N-100431.934
 E-547925.472