

Certified, Filed and or Recorded on
Nov. 04, 2008 AT 01:16PM


Signed: BW
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 17, Township 38, Range 30
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 10-14-08 found a 3/4" REBAR BENT
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

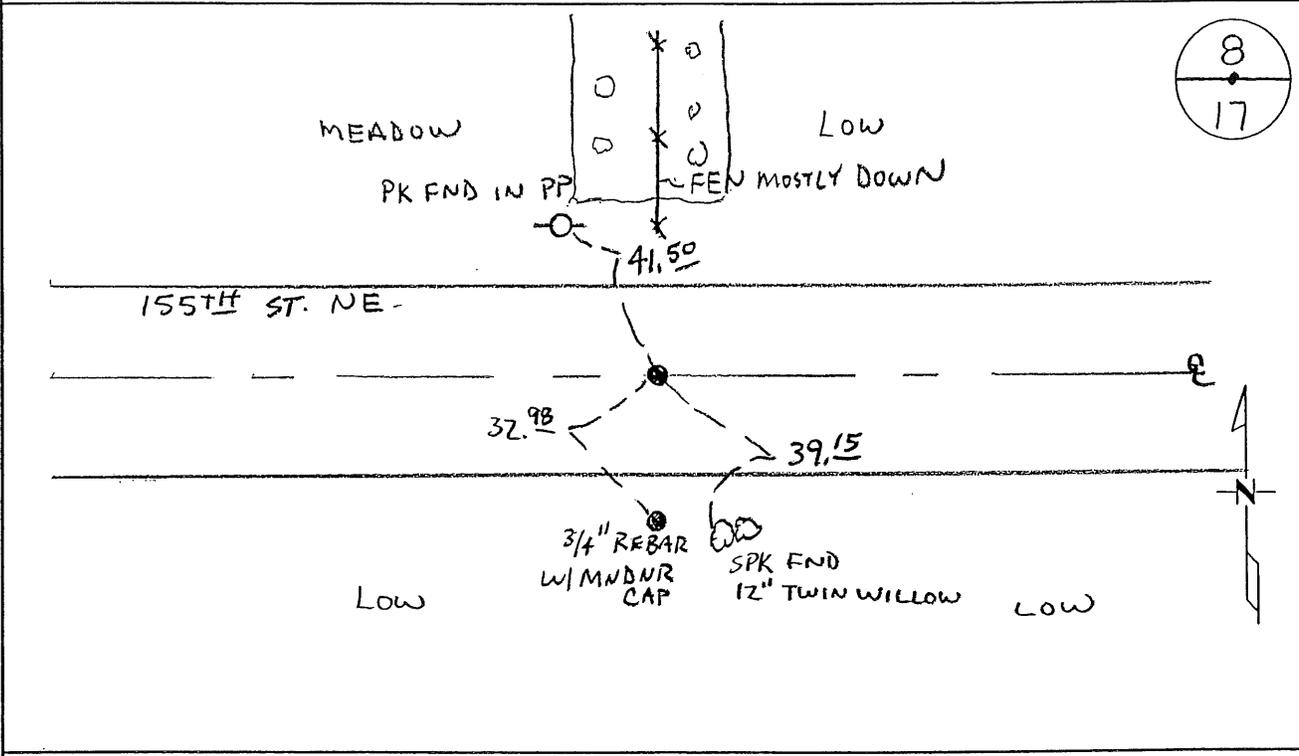

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Handwritten Signature]
Deputy County Surveyor
License No. 43932

Date: 11/3/08

Statement of Evidence:

C171

North Quarter Corner of Section 17, Township 38 North, Range 30 West, Graham Township, 4th Principal Meridian, Benton County, Minnesota.

- 1852 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.
 10" Aspen N 70 E 964 links
- 1925 County Engineer's Notebook 44, page 10, notes a distance of 2666.5 feet from the NE corner of Sec. 17 to fence running south and a distance of 2666.5 feet to the NW corner of Sec. 17. (Also in Notebook 48 in 1926)
- 1944 County Engineer's Notebook No. 164 contains a road survey for CAR 25 running east to west on section line. Corner is shown marked by a hub set in center of road with fence lines north and south. Stationing gives distances of 2666.7 feet to the NE corner and 2665.0 feet to the NW corner with a delta angle of 0-09' left.
- 1951 MN/DOT alignment map and notes for TH 218 (25) notes the corner is assumed at the intersection of the centerline of a road east/west and a fence line north/south. A distance of 2667.1 feet is noted to the NE corner Sec 17.
- 1992 Bruce Shepperd, LS 17003, with MN/DNR, excavated corner area with a backhoe and no evidence of a corner marker was found. He established obliterated corner and set a 3/4" X 24" Rebar with an aluminum cap stamped "DNR Survey Marker" at the centerline of a road east/west and a fence line north. He filed Certificate of Location (#212981). He notes a distance of 2663.50 feet to the NW corner Sec 17 and a distance of 2668.30 feet to the NE corner Sec 17.
 County Coordinates listed on Certificate:
 NAD 83 (1986 Adjustment)
 N- 185839.467
 E- 486373.361
- 2008 Westwood Professional Services found a 3/4" bent rebar at the centerline of a road east/west and a fence line north. Monument fits DNR ties and measures 2663.57 feet to the NW corner and 2668.52 feet to the NE corner of section 17. CIM is accepted as marking the obliterated position for this corner.
 County Coordinates obtained by GPS
 NAD 83 (1996 Adjustment)
 N- 185839.570
 E- 486372.748

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTH QUARTER Corner of Section 17, Township 38 N, Range 30 W, 4th P.M.

STATE OF MINNESOTA, County of BENTON

At the corner location shown on the sketch:

- On _____ found a _____
DATE _____
- left monument as found, lowered monument, removed monument (explain)
- On 11-9-92 Placed a 3/4" x 24" REBAR WITH ALUMINUM CAP STAMPED
DATE "DNR SURVEY MARKER", DOWN 0.5'

SKETCH OF REFERENCE TIES

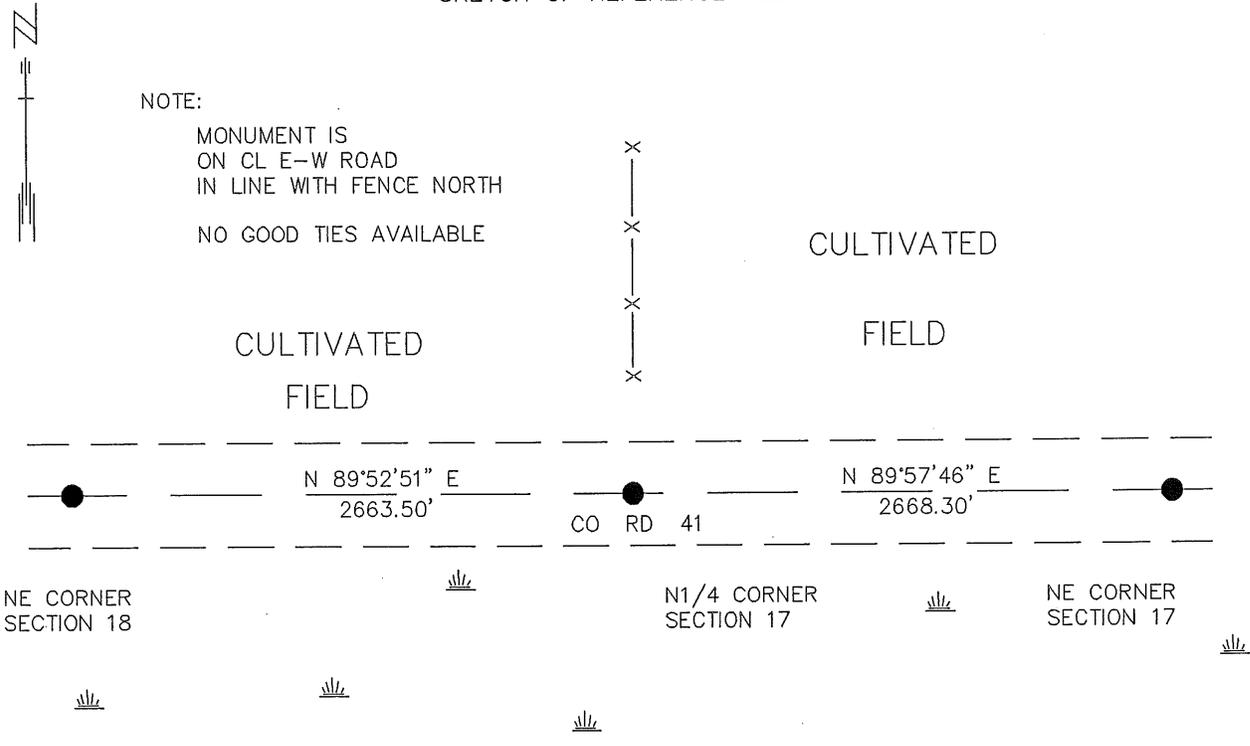

1983 BENTON COUNTY COORDINATE SYSTEM
N = 185839.467
E = 486373.361

BEARINGS ARE IN COUNTY ORIENTATION

Statement of evidence relative to this corner location is on back of page.

J.B.M. JAN. 1993
WMA01555.00.00.01

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Bruce W. Shippel 2-3-93
SIGNATURE DATE

Registration No. 17003

Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER **212981**
County of Benton

I hereby certify that this document was filed in the Co. recorders office at 8:15 A.M. on the 8 day of February A.D., 1993
County Recorder Alice C. Engelmeier
By JW, Deputy
DOCUMENT NO. 212981

North Quarter Corner Section 17, Township 38 North, Range 30 West

The DNR Bureau of Engineering contacted the following for survey information:

Minnesota Secretary of State's Office
MN/DOT Office in St. Paul
MN/DOT Office in Brainerd
Benton County Recorder's Office
Benton County Highway Engineer's Office
Paul E. Wellen and Associates of St. Cloud
David Regan, RLS #12236, of St. Cloud
Rieke Carroll Muller and Associates of St. Cloud
William F. Lunser, RLS #9394, of St. Cloud
Comstock and Davis Inc., of Little Falls

1852 U. S. General Land Office notes obtained from the Secretary of State's Office show the corner marked with a wood post with the following bearing tree marked:
10" Aspen, North 70° East, 964 links (636.24 feet)

1951 A page in a field notebook obtained from the MN/DOT Office in Brainerd shows that the location of the corner was assumed at the intersection of an east-west road and fence lines north and south. A description of what was set to mark corner is not given. The corner is shown:
2667.1 feet from the northeast corner of Section 17

No Date A right-of-way map for State Highway 25 obtained from the MN/DOT Office in St. Paul shows that the location of the corner was assumed at the intersection of an east-west road and fence lines north and south. A description of what was set to mark corner is not given. The corner is shown:
2667.1 feet from the northeast corner of Section 17

1992 November 9, DNR Bureau of Engineering hired a backhoe operated by Rick Burski of Sauk Rapids to dig for evidence of this corner. Dug a 6 foot north-south by 11 foot east-west by 3 foot deep hole the center being on the center line of an east-west road and in line with a fence north. No evidence of a monument was found. Set a DNR Survey Marker on the center line of the road and in line with the fence north and found it to be:
2668.31 feet from the northeast corner of Section 17
2663.50 feet from the northeast corner of Section 18
1.91 feet north and 2.40 feet west of the computed lost position for corner

Analysis of the above information led the DNR Bureau of Engineering to conclude that the DNR Survey Marker set on the center line of an east-west road and in line with a fence line north marks the obliterated location of the corner.