

381317

Certified, Filed and or Recorded on  
April 26, 2011 3:28 PM

BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

By: BW

G - V - I


# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 34, Township 38, Range 30  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 04/21/2011 found a 1/2" IRON PIPE CAP # 10918
- left monument as found       lowered monument       removed monument (explain)
- On \_\_\_\_\_ placed an \_\_\_\_\_

27  
34

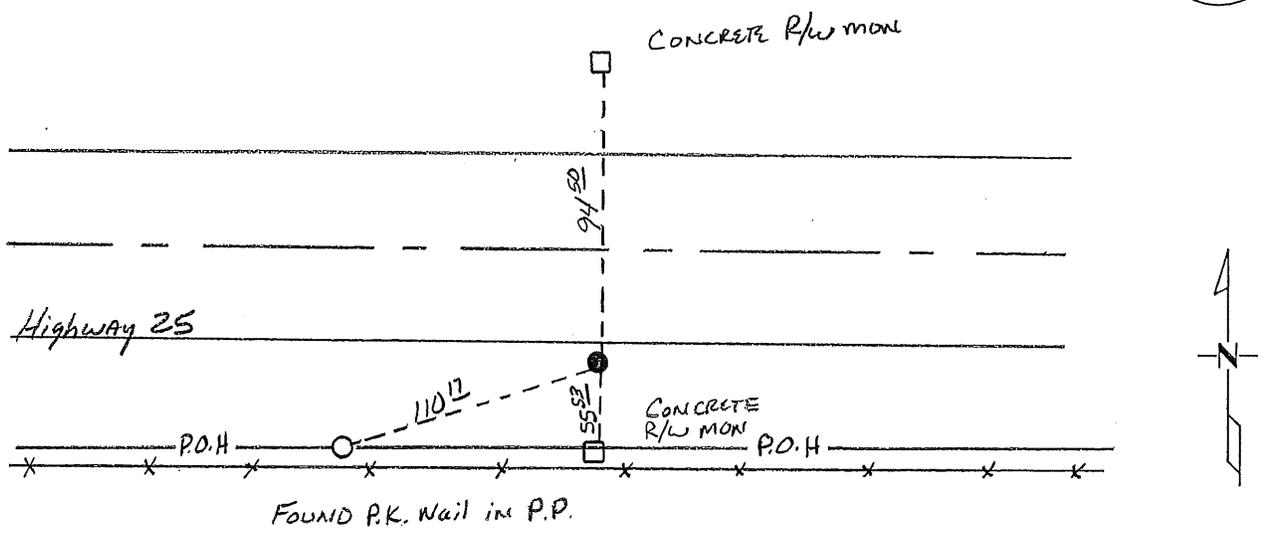

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wittstock  
Benton County Surveyor  
License No. 19552

Date: 4/22/2011

Benton County Surveyor's Office  
 Jerome C. Wittstock, County Surveyor  
 Minnesota License No. 19552

**Statement of Evidence:****C341**

North Quarter Corner of Section 34, Township 38 North, Range 30 West, Graham Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

- 1852 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.  
           15" Aspen                      S 33 E                      374 links
- 1927 County Engineer's Notebook No. 80 contains a road survey for State Road No. 218 by H. G. Elletson. Survey ran from west to east. Notes show no corner found, but stationing gives distances to fence line north of 2690.7 feet to the NW corner and 2705.8 feet to the NE corner.
- 1952 MN/DOT alignment map for TH 25 shows corner assumed at intersection of center of east-west road and fence line north. Corner position is 19.8 feet south of new centerline. Stationing gives distances of 2697.1 feet to the NW corner and 2706.9 feet to the NE corner.
- 1983 David Regan, LS 12236, found a 1/2" iron pipe on a fence line north and +/- 20 feet south of east/west centerline. He filed a Certificate of Location (#167997) and notes a distance of 94.8 feet north to concrete R/W post.
- 2011 The Benton County Surveyor's Office found the 1/2" iron pipe 20 feet south of centerline with concrete right of way monuments 55.53 feet south and 94.50 feet north. The found iron fits the MnDOT computed position from alignment monuments within 0.25 feet and fits MnDOT distances east and west within a foot. The iron also fits the 1927 distance east within a foot and west within 6 feet. The 1/2" iron is accepted as marking the obliterated corner position, coordinates were obtained and reference ties established.

Coordinates Obtained by GPS  
 NAD 83 (1996 Adjustment)  
 N-169779.493  
 E-497728.762

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


North Quarter Corner of Section 34, Township 38, Range 30, 4th P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On 11/16/83 found a 1/2 inch iron pipe on fence line north and 20'± south of center line of State Trunk Highway Number 25
  - left monument as found,  lowered monument,  removed monument (explain)
- On \_\_\_\_\_ placed a \_\_\_\_\_

## SKETCH OF REFERENCE TIES

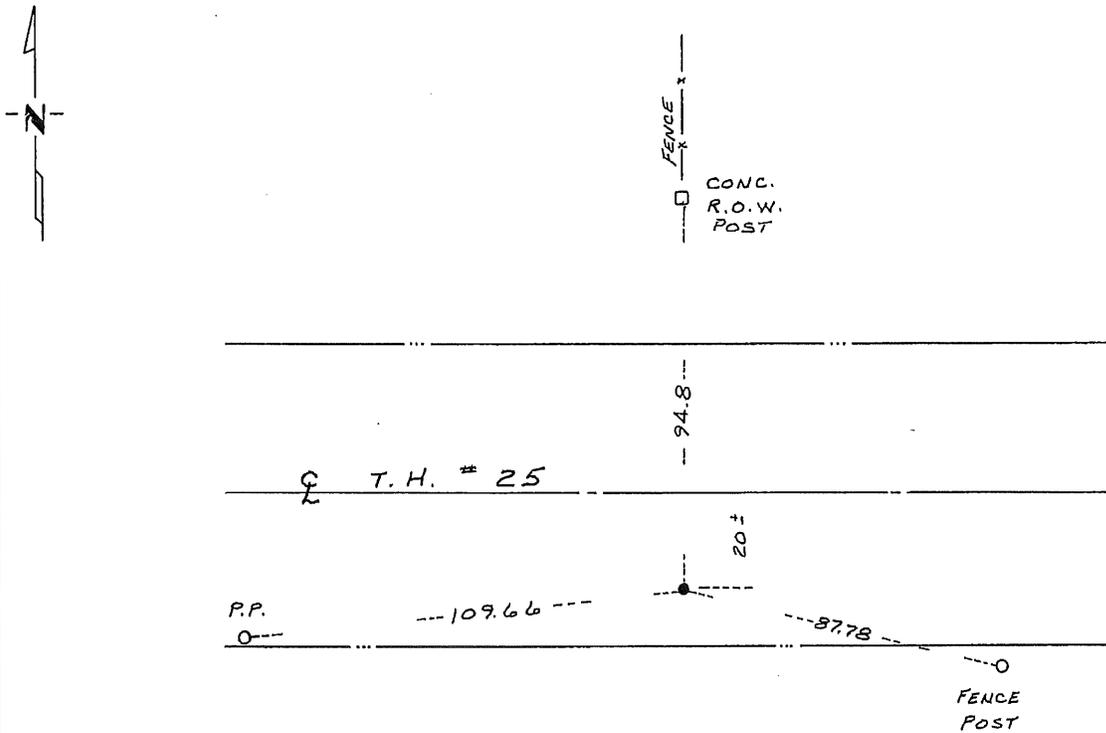

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

David G. Ryan 1/3/84  
SIGNATURE DATE

Registration No. 12256

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

County Recorder  
OFFICE OF THE REGISTER OF DEEDS  
County of Benton

I hereby certify that this document was filed in the Reg. of Deeds office at 4 P.M. on the 11th day of January A.D., 1984

Register of Deeds F.A. Johnson

By \_\_\_\_\_, Deputy

DOCUMENT NO. 167997