

1-6

A 362866

Certified, Filed and or Recorded on  
JAN. 06, 2009 AT 02:58PM


Signed: OK  
MARILYN J NOVAK B V  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 32, Township 38 N, Range 30 W  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 8-14-2008 found a 1/2" Iron Pipe flush, 14.6 feet north of C/L.  
DATE
- left monument as found     lowered monument     removed monument (explain)
- On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

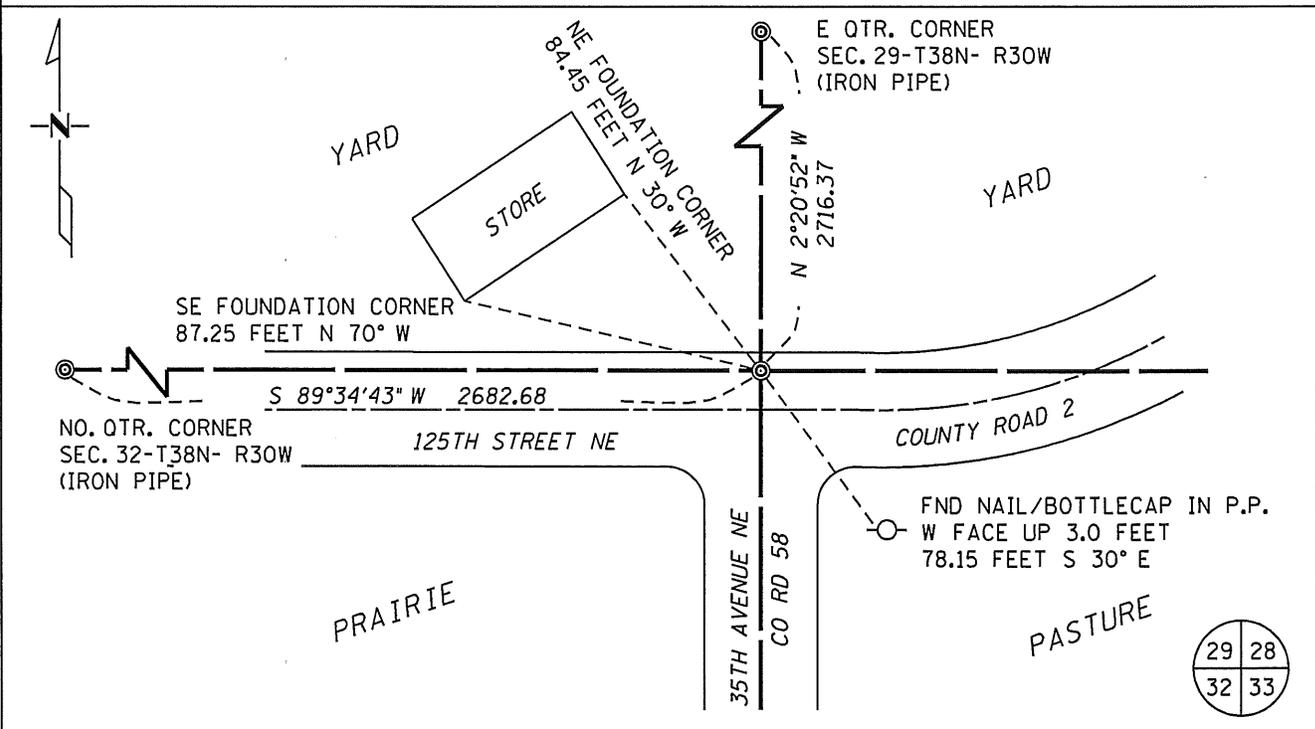

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision.

Signature Sam J. DeLeo Date 10-3-2008 License No. 40341  
 Title:  Land Surveyor     Professional Engineer     County Surveyor     County Engineer

**Statement of Evidence:**

C322

Northeast Corner of Section 32, Township 38 North, Range 30 West, Graham Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1852 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

4" Blk Oak	N 68 W	69 links
4" Blk Oak	N 55 1/2 E	95 links

1921 County records (Notebook No. 21 road run to corner from west, end of project, town road north-south): Paul Zeese shows an iron at the corner with the following reference ties.

TP	SE	37.9	12" Rock	NW	50.4
----	----	------	----------	----	------

1923 County Engineer's Notebook No. 40 contains a survey for CAR No. 1 running north from this corner. Notes show corner marked by a stone monument with ties:

TP	SE	40.0'	Rock	NW	48.4'
----	----	-------	------	----	-------

(Notebook No. 27 has same ties.)

1927 County Engineer's Notebook No. 80 contains a road survey for State Road No. 218 by H. G. Elletson. Notes show spike in hub for the corner in road intersection with town road south and SAR No.1 north. Survey ran east from this corner. Ties:

TP	SE	40.3	Cor FP	SW	55.4
----	----	------	--------	----	------

1935 County Engineer's Notebook No. 94 contains survey for SAR No. 2 running south to north. Notes corner as a spike in 4-way road intersection. Ties:

Cor FP	SE	44.2	Snow Fence	P NE	60.85
--------	----	------	------------	------	-------

1952 MN/DOT alignment map for TH 25 (Roll F-02), notes an iron pin at the corner 0.3 feet below grade. Map shows corner is 2.9 feet southeast of semi-tangent with the following reference ties.

PP	SE	55.9
Snow FE Marker	NE	60.6
TP	NW	92.1

1962 County Surveyor's Record Book 2, page 220, shows an iron at the corner with the following reference ties.

PP	SE	53.4
SE Cor Store Foundation	NW	87.35
NE Cor Store Foundation	NW	84.55

Notebook No. 94 shows found iron pin down 0.3' below grade.

Continued....

- 1963 The Minnesota Dept. of Natural Resources (fka MN Conservation Dept.) performed a surveys in Sections 29 and 30 for the Wisneski WMA (File No. G892-X). They surveyed the south and east lines of Sec. 29. They note a found iron pin at the NE of Sec. 32. Distances were recorded as double chained: 5386.3 feet to the assumed position of the NE of Sec. 29 (PI in TH 25) and 5365.36 feet to a set spike at the assumed position for the NE of Sec. 31.
- 2001 In July 2001, Westwood Professional Services, Inc. found no evidence of a monument. Homeowner at the intersection states that around 1929 there was a large stone in the yard (probably the 1921 tie) and that the stone and road was moved. The present building is the same old store as referred to in 1962 ties.
- 2002 Westwood located CSAH 2 PI and corners of old store foundation. Alignment of the curve on CSAH 2 at TH 25 intersection has been changed from what is shown on MN/DOT's plans in 1952. New County plans show corner was assumed using the ties to the old store and the corner is now 15 feet north of center line. Using the ties to the store, we established a coordinate position for the corner. This position is 5,387.04 south of the NE corner of Section 29, which compares well with MN/DOT's distance of 5389.0 from their 1952 plans.

County Coordinates (Computed)  
NAD 83 (1996 Adjustment)  
N-169730.189  
E-489702.758

- 2008 Sam DeLeo, LS 40341, found a ½" dia. iron pipe, flush in the roadway. The 1962 reference ties to the store foundation and 2002 coordinate values were verified. The distance to a found CIM at the NE of Sec. 29 was measured to be 5387.04'. The distance to a found iron pipe at the NE of Sec. 31 was measured to be 5365.36'. These match well with the DNR's 1963 measurements. Reference ties were recorded and coordinate values to the pipe were verified.

Coordinates Obtained by GPS  
NAD 83 (1996 Adjustment)  
N-169730.189  
E-489702.758