

Certified, Filed and or Recorded on
MAR. 30, 2007 AT 01:35PM


Signed: BW
MARILYN J NOVAK
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

E 1/4 Corner of Section 32, Township 38, Range 28
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found lowered monument removed monument (explain)
- On 6-29-06 placed an 1/2" PIPE CAPPED 19552
DATE

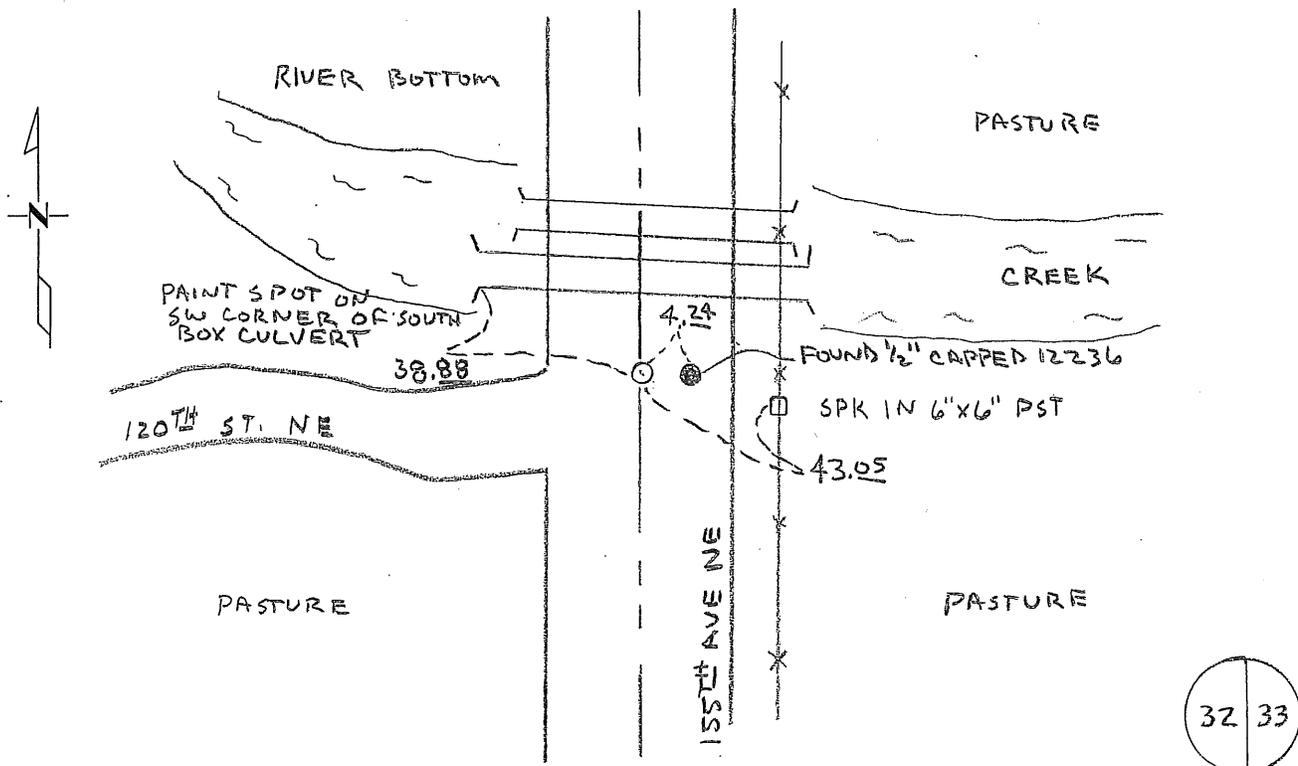

32 | 33

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature: Jerome C. Wittstock Date: 28 MARCH 2007 License No. 19552
Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

A323

East Quarter Corner of Section 32, Township 38 North, Range 28 West, Granite Ledge Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

6" Elm	S 5 W	192 links
5" Willow	N 29 W	56 links

1930 County Engineer's notebook No. 56 contains a road survey by H. G. Elletson for CAR No. 27. Notes show road survey run south to north along section line. Corner is shown as a spike at south end of bridge. Stationing gives distances of 2596.6 feet to the SE corner and 2620.7 feet to the NE corner of Section 32 with a deflection angle of 0-15 right.

1958 County Surveyor's Record Book 2, page 372, notes corner exactly at Bridge.

2004 Measured 5219.78 feet between section corners. Searched area of bridge, but found no evidence of a corner marker. Corner should be reset using 1930 information.

2006 At this location neither the original government corner post nor bearing trees were found. After excavation at the northeast corner of Section 5, Township 37 North, Range 28 West, this corner was positioned using the 1930 information between said northeast corner and the northeast corner of Section 32, Township 38 North, Range 28 West from the 1930 information.

A ½ inch by 15 inch iron pipe with a cap marked "19552" was set at this position. At the time of setting the iron pipe, a ½ inch iron with a cap marked "12236" was found. Surveyor Regan set the iron at prorated distance north-south on line with the box culvert east-west. Information obtained from the Benton County Highway Department did not indicate that the center of the existing box culvert is located at the center of the old bridge/culvert, which was replaced. Without the chronology of the bridge/culvert location being in the same location, I feel that the deflection angle and distances from 1930 are the best available evidence of the corner position. Both irons are left in place with the iron marked "19552" marking the corner position.

County Coordinates
NAD 83 (1996 Adjustment)
N- 167023.961
E- 552502.246

2007 The plat of RATKA ACRES is tied to this corner.