

1-13

A 375359

Certified, Filed and or Recorded on  
July 13, 2010 AT 04:14PM


Signed: ck  
MARILYN J NOVAK G V I  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 18, Township 38, Range 28  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 07/09/10 found a 1/2" IRON PIPE RLS# 42300 AT FENCE LINES  
NORTH/EAST/WEST
- left monument as found       lowered monument       removed monument (explain)
- On \_\_\_\_\_ placed on \_\_\_\_\_

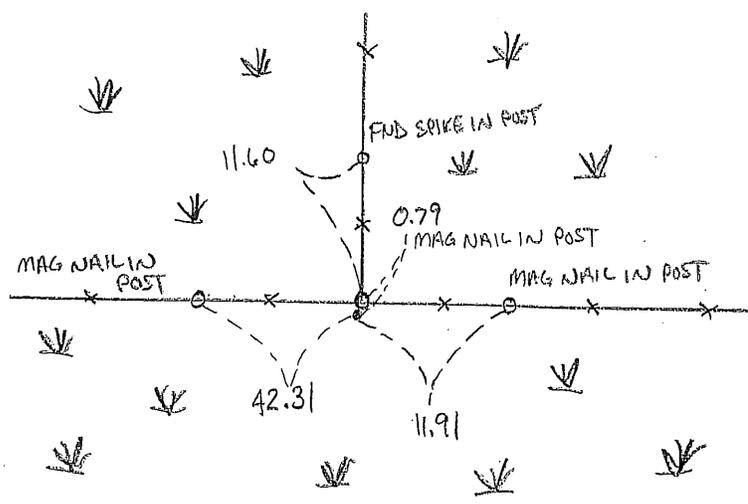

7  
18

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wittstock  
Benton County Surveyor  
License No. 19552

Date: 7/12/2010

How Sept

Benton County Surveyor's Office  
 Jerome C. Wittstock, County Surveyor  
 Minnesota License No. 19552

**Statement of Evidence:****A181**

North Quarter Corner of Section 18, Township 38 North, Range 28 West, Granite Ledge Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

10" Tamarack	N 28 E	13 links
14" Tamarack	S 49 1/2 E	29 links

1880 County Surveyor's Record Book 2, page 309, shows a road survey by Frank Sanders. Ran road survey from South ¼ corner of Section 18 north to ¼ post at North ¼ corner of Section 18 with a distance of 80.40 chains.

2008 Ben O'Malley performed a survey in Section 7 of Township 38 North, Range 28 West and set an iron pipe capped RLS 42300 at a 3-way fence corner to mark the corner position.

2010 The Benton County Surveyor's Office found the 1/2" iron pipe capped RLS 42300 from 2008 on an east-west fence and fence to the north. The position falls approximately 9 feet north of a straight line between section corners. The iron pipe measures 2623.03 feet to the northeast corner and 2326.76 to the northwest corner of Section 18 and fits a split of the distances at the east sixteenth to a fence south within a foot. The distance south measures approximately 40 feet long of the 1880 distance, though a measurement index to Mr. Sanders is unknown and the iron pipe falls on the extension of the north-south centerline. No additional information was found at the 1880 resurvey distance. Since the found iron pipe fits line between section corners within 9 feet, the long-standing fences east-west and north, the GLO distance to the east within 17 feet, a split of the fences at the east sixteenth and the extension of the fence to the south, it is accepted as marking the obliterated corner position.

County Coordinates  
 NAD 83 (1996 Adjustment)  
 N-185495.306  
 E-544461.912