

Certified, Filed and/or Recorded on
Mar. 10, 2009 AT 01:03PM


Signed: CK
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 1, Township 36, Range 31
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 11-24-08 found a CAST IRON MONUMENT
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

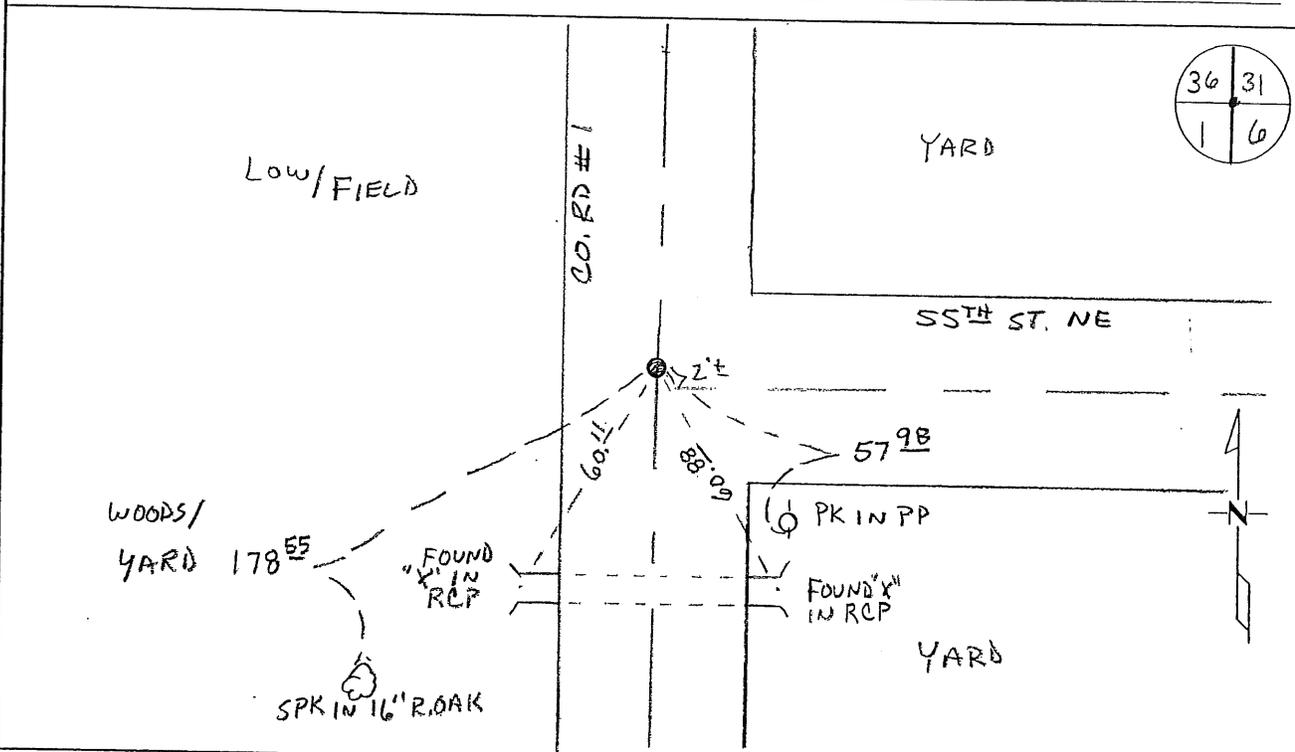

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Ch. Hoyle
Deputy County Surveyor
License No. 43932

Date: 3/6/09

Benton County Surveyor's Office
 Chris Hoglund, Deputy County Surveyor
 Minnesota License No. 43932

Statement of Evidence:**M012**

Northeast Quarter Corner of Section 1, Township 36 North, Range 31 West, Sauk Rapids Township, 4th Principal Meridian, Benton County, Minnesota.

- 1849 Original US General Land Office survey established this corner and set a wood post at this location and bearing trees were recorded.
 6" Black Oak S 33 W 681 links
 A line tree was noted as a 12" Poplar West 28.90 chains.
- 1876 County Surveyor's Record Book 1, page, 233, shows a road survey by R. Cronk along the east line of Section 1 with a distance of 83.50 chains (5511.0 feet).
- 1917 County Records contain a survey subdividing Section 6, 36-30 by R.H. West, which notes a stake at this corner.
- 1938 County Engineers' Notebook No. 116 shows survey of SAR 1 running from south to north. Notes show corner being a spike in center of road and fence west and town road east. Ties:
- | | | |
|---------|----|-------|
| Cor. FP | NE | 40.6' |
| TP | NW | 31.6' |
- 1961-1968 reference ties:
- | | | |
|----|----|-------|
| PP | SE | 44.67 |
| GP | SW | 54.45 |
| TP | NW | 44.58 |
- 1977 County Surveyor's Record Book 1, page 239, notes the following reference ties.
- | | | |
|---------------|----|--------|
| Cor FP | NE | 41.5 |
| Cor FP | W | 33.0 |
| 24" Oak | SW | 186.55 |
| E end Culvert | SE | 65.90 |
| W end culvert | SW | 60.12 |
| 12" Oak | SW | 178.98 |
| 1-S.F.H. | NE | 234.0 |
- 1977 County Highway notes a 1/2" iron pipe was set at the centerline of County Road 1 and a township road east for the alignment of SAP 05-601-04 with same ties as above.
- 1994 Kevin Festler, LS 22702, found a 1/2" iron pipe at the intersection of centerlines and he set a cast iron monument at the intersection of centerlines and filed a Certificate of Location (#226908).
- 1995 Comstock and Davis performed GPS work under contract with Benton County and Coordinates Obtained by GPS NAD 83 (1986 Adjustment) to a CIM:
 N- 132147.588
 E- 478510.214
- 2008 Westwood Professional Services, Inc. found a cast iron monument in the centerline of CR 1 and ~2 feet north of the centerline of township road to the east. CIM fits 1994 Festler ties and five of the remaining 1977 County Surveyor ties. CIM is accepted as marking the obliterated position for this corner.
 County Coordinates obtained by GPS to CIM:
 NAD 83 (1996 Adjustment)
 N- 132147.850
 E- 478509.703

A 364246

Benton County Surveyor's Office
Chris Hogle, Deputy County Surveyor
Minnesota License No. 43932

Township Landmarks: Minnesota Statutes 381.13 required every county to have placed by a surveyor at the northeast corner of each congressional township a durable magnetic monument having a head not less than 3-1/2 inches in diameter and a length of 20 inches. We have not been able to find evidence that this was done in Benton County, but it was done in most counties in the late 1800's and is a possibility that it was also done in Benton County. Many of the counties used stone monuments instead of iron.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 1, Township 36, Range 31, 4th P.M.
STATE OF MINNESOTA, County of Benton


At the corner location shown on the sketch:

On 8-1-94 found a 1/2" iron pipe
DATE

left monument as found, lowered monument, removed monument (explain)

On 9-23-94 placed a Cast Iron Monument over found pipe
DATE

SKETCH OF REFERENCE TIES

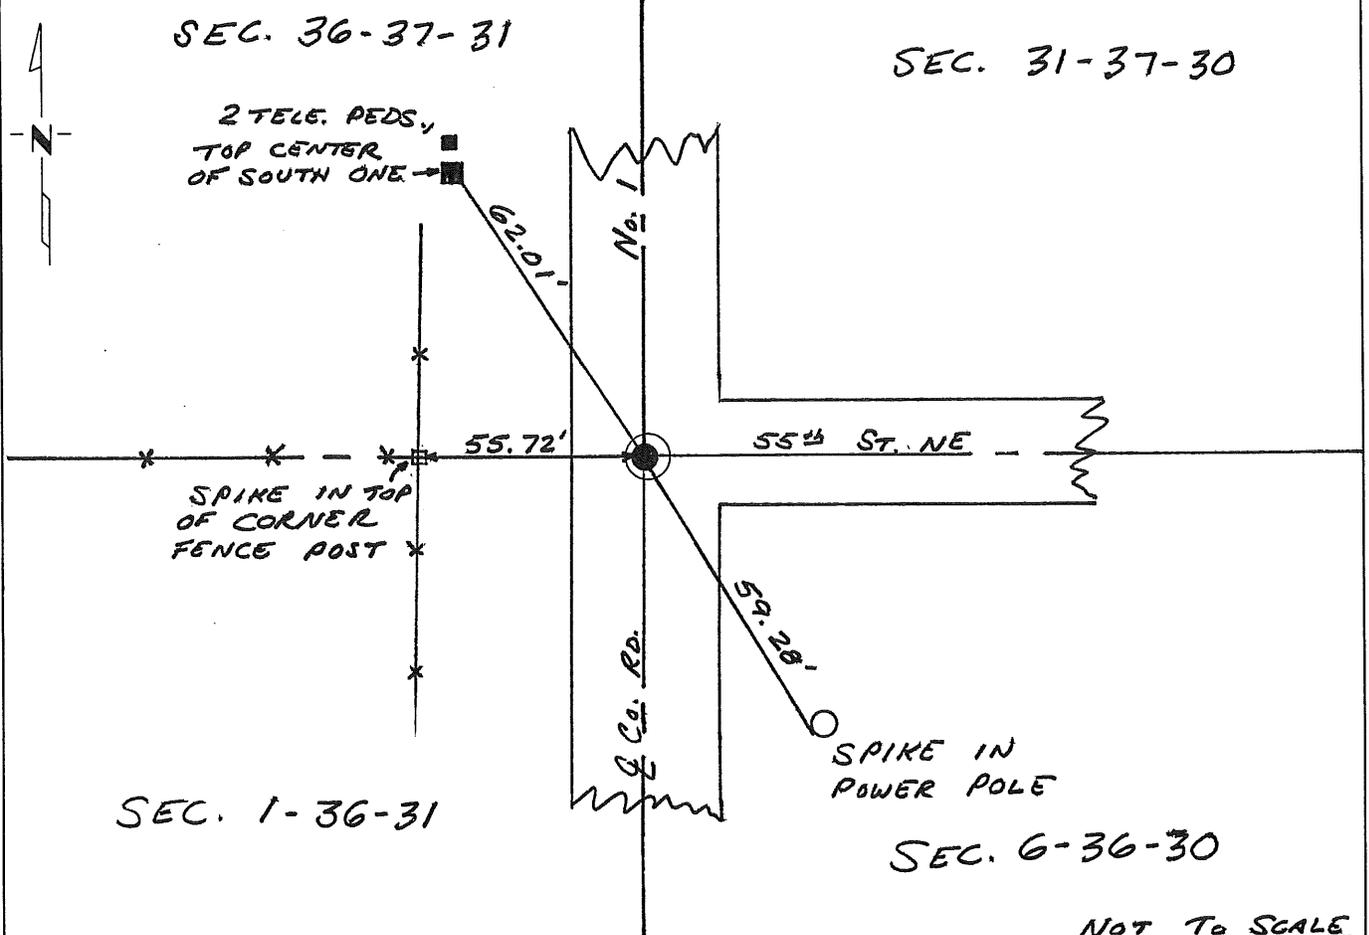

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[Signature] Nov 14, 1994
SIGNATURE DATE

Registration No. 22702

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 _____

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence:

The northeast corner of Section 1, Township 36, Range 31, 4th Principal Meridian, Benton County, Minnesota, was set under the Public Land Survey as a post with 4 bearing trees. No trace of post or bearing trees now exists.

A search by Benton County Highway personnel of available county survey records revealed no additional information on this corner.

On Aug. 1, 1994, Comstock & Davis, Inc., while remonumenting section corners for the purpose of G.P.S. work for Benton County found a 1/2 inch iron pipe at the northeast corner position of Section 1, Twp. 36, Rng. 31. Comstock & Davis, Inc., compared the location of the found 1/2 inch iron pipe to the original US Government Survey and found the position to be within reason of the Public Land Survey records. Comstock & Davis, Inc., placed a cast iron monument at the position for the northeast corner of Sec. 1. Refer to Job No. 945017.

2 2 6 9 0 8

CLERK OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

JAN 19 3 06 PM '95

ALICE G. EDAL BEYER
COUNTY RECORDER

BY mn DEPUTY mc