

A 368982

Certified, Filed and or Recorded on
Sep. 22, 2009 AT 12:19PM

Signed: BW
MARILYN J NOVAK G V
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER
Fee Amount: \$46.00

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


East Quarter Corner of Section 6, Township 36, Range 29
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 09-09-09 found a Cast Iron Monument down 0.4'
DATE on the centerline of 85th Ave. NE.

left monument as found lowered monument removed monument (explain)

On _____ placed a _____
DATE

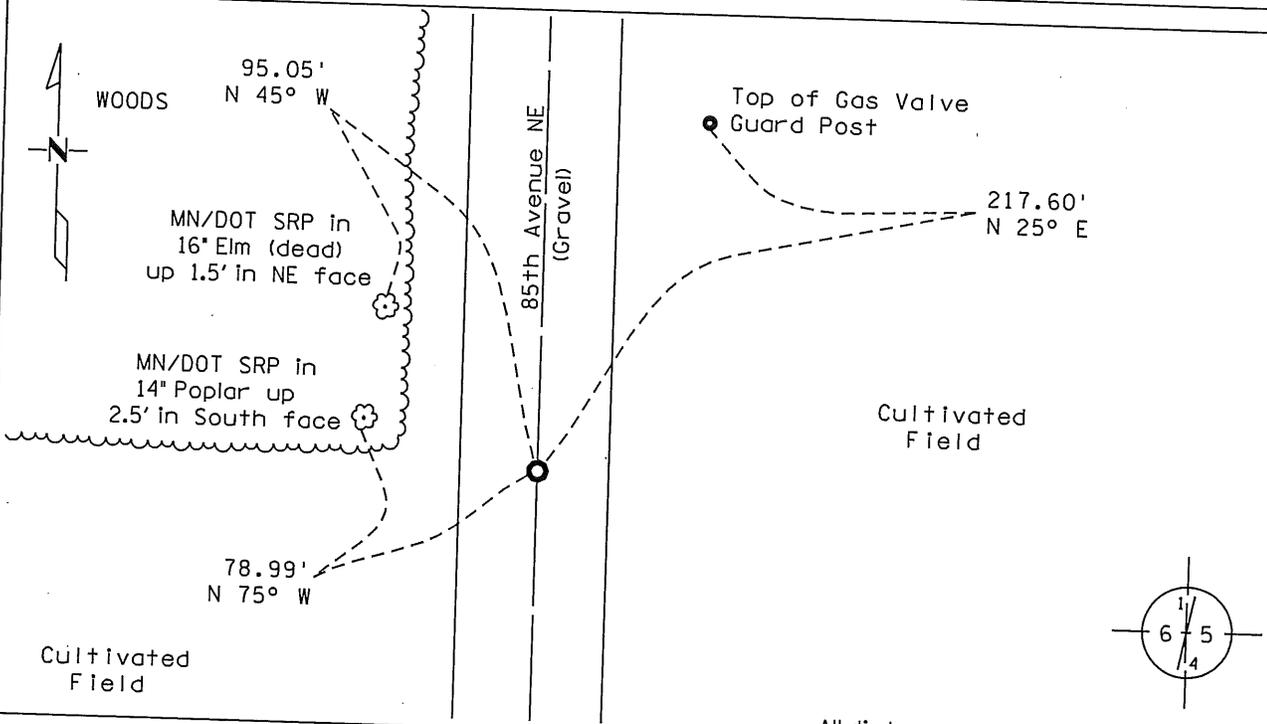

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision.

Signature Kevin J. Metz Date 9-10-2009 License No. 40343
Title: Land Surveyor Professional Engineer County Surveyor County Engineer
MNDOT

Statement of Evidence:**The East Quarter Corner of Section 6, Township 36 North, Range 29 West, St. George Township, 4th Principal Meridian, Benton County, Minnesota.**

- 1855 Oscar F. Davis ran the original public survey and set a wood post at this location and bearing trees were recorded.
- | | | |
|---------------|--------|----------|
| 5" Ironwood | S 43 E | 14 links |
| 13" Black Ash | S 80 W | 33 links |
- 1913 County Surveyor's Records, on pages 34 & 35, contains a survey of the west line of Section 5 by County Surveyor, J. A. Stanton, which notes this corner set lost with the following distances:
- 2602.50 feet to the Northeast Corner of Section 6.
 - 2611.50 feet to the Southeast Corner of Section 6.
- 2003 Barry Dorniden, LS23044, with Duffy Engineering, set corner in north-south road and occupation west. Measured 2556.87 feet to the Northeast Corner of Section 6 and 2672.41 feet to the Southeast Corner of Section 6 with an interior angle of 176 degrees 44 minutes 38 seconds.
- County Coordinates furnished by Duffy:
 NAD 83 (1996 Adjustment)
 N- 129632.663
 E- 516119.179
- 2005 On September 27th, 2005, The Minnesota Department of Transportation's analysis of the corner set in 2003 shows that it is 74.25 feet east of a straight line between section corners. The lost position on a straight line is 61.98 feet south and 68.66 feet west of the corner set in 2003. The lost position distances would be 2616.2 feet to the Southeast Corner of Section 6 and 2610.97 feet to the Northeast Corner of Section 6. The Minnesota Department of Transportation searched for the 1/16th corners and also excavated at the corner location that was set in 2003. Nothing was found. After analyzing all available information and field data with the Benton County Surveyor, it was determined to accept the position as established in 2003 by Mr. Dorniden. The ½ inch iron pipe was removed and a MN/DOT cast iron monument was set with the top down 0.4 feet. Reference ties were established.
- 2009 On September 9th, 2009, The Minnesota Department of Transportation found a Mn/DOT Cast Iron Monument. Reference Ties were verified as shown on the front of this document. The Minnesota Department of Transportation accepts the cast iron monument as the correct location of the East Quarter Corner of Section 6.

For details and survey analysis, contact the Minnesota Department of Transportation District Surveys Office in Baxter, Minnesota.