

Certified, Filed and or Recorded on
Oct. 31, 2008 AT 08:33AM


Signed: JU
MARILYN J NOVAK G V ✓
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 22, Township 38, Range 31
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 8-26-08 found a 1/2" OPEN I.P.
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

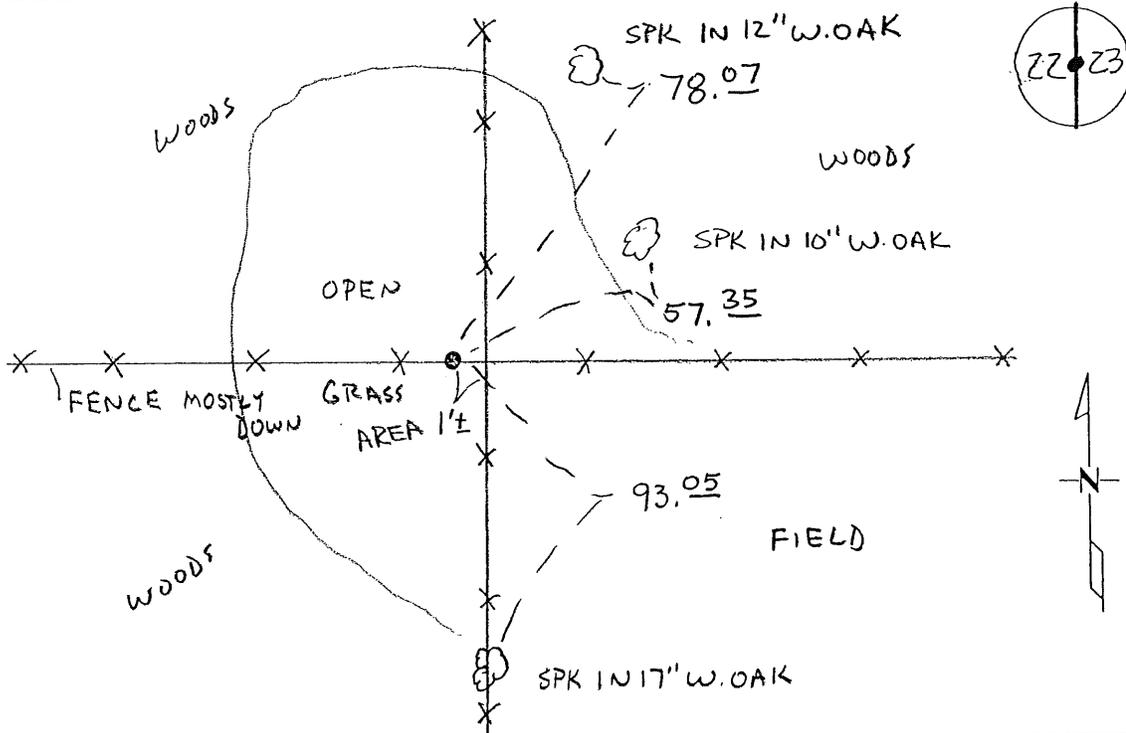

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Ch. [Signature]
Deputy County Surveyor
License No. 43932

Date: 10/14/08

Benton County Surveyor's Office
 Chris Hogle, Deputy County Surveyor
 Minnesota License No. 43932

Statement of Evidence:

D223

East Quarter of Section 22, Township 38 North, Range 31 West, East Langola Township,
 4th Principal Meridian, Benton County, Minnesota.

- 1852 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.
- | | | |
|-------------|------------|-----------|
| 8" Bur Oak | S 14 W | 178 links |
| 10" Blk Oak | S 74 1/4 E | 220 links |
- 1961 MN/DNR survey crew shows I. P. set at fence corner, with fence lines running north-south and east-west. Measured 2659.8 feet north to the NE corner of Section 22.
- 2002 No resurvey information was found on this corner in the Benton County records.
- 2008 Westwood Professional Services, Inc. found a 1/2" iron pipe at the corner location. Corner fits longstanding fence line occupation north/south/east/west. Position falls 1.8' east of a straight line from the NE corner to the SE corner of Section 22 and 7.1' north of a split. Measured 2662.29 to the stone monument accepted as the NE corner of section 22 and 2661.24 to the removed CIM 3.72 feet southeast of the NE corner of section 22. This location is accepted as marking the obliterated corner location.
- County Coordinates Obtained by GPS (1/2" iron pipe)
 NAD 83 (1996 Adjustment)
 N- 177655.044
 E- 468020.954