

MARILYN J. NOVAK  
COUNTY RECORDER  
BY Marilyn J. Novak DEPUTY

OFFICE OF  
BENTON COUNTY RECORDER  
BENTON COUNTY, MN  
CERTIFIED TO BE FILED  
AND/OR RECORDED ON

291175


2002 OCT 30 P 3: 21

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER \_\_\_\_\_ Corner of Section 6 , Township 36 , Range 28  
4TH Principal Meridian, State of Minnesota, County of BENTON

At the corner location shown on the sketch:

- On 8/1/02 found a STEEL "T" POST  
DATE
- left monument as found     lowered monument     removed monument (explain)
- On 8/30/02 placed a CAST IRON MONUMENT  
DATE

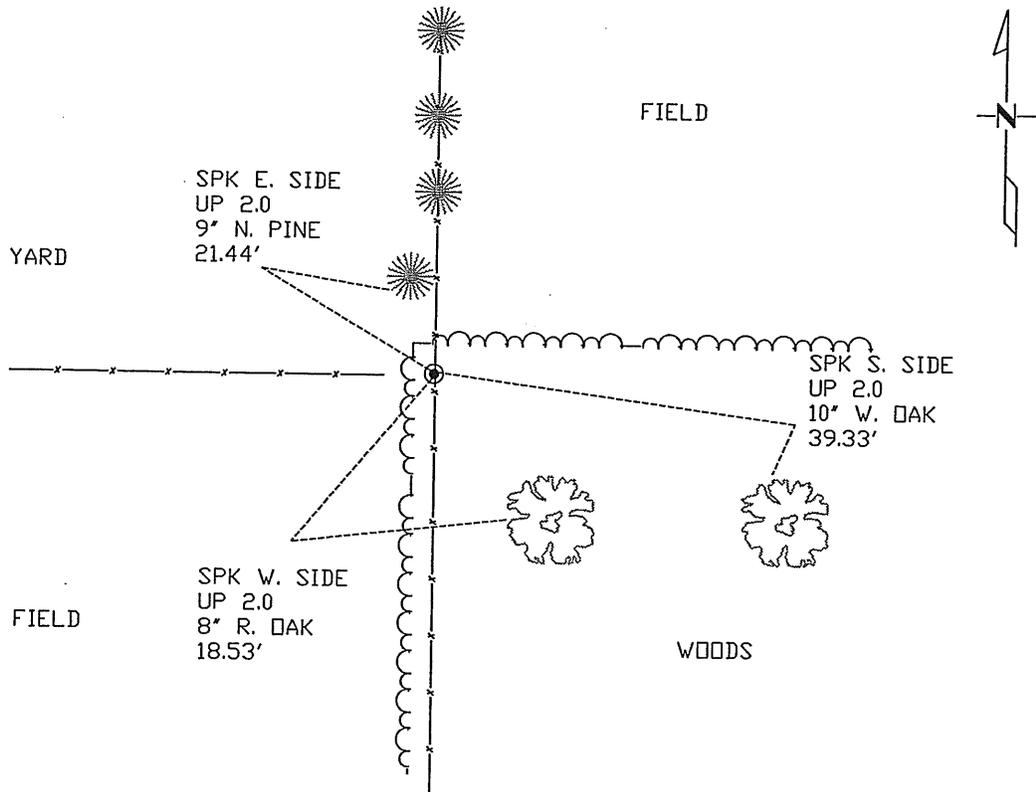

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Signature] Date 10/22/02 License No. 12684  
Title:  Land Surveyor     Professional Engineer     County Surveyor     County Engineer

**Statement of Evidence:**

**J063**

The East Quarter Corner of Section 6, Township 36 North, Range 28 West, Glendorado Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1855 Corner established by GLO and marked by a wood post with bearing trees noted as.

|            |        |          |
|------------|--------|----------|
| 5" Ash     | S 74 E | 23 links |
| 20" Poplar | S 81 W | 36 links |

Undated The County Surveyors records in Book 2, page 19 notes a stake at the corner location.

1915 In June 1915 JP Soderstrum did a survey in Section 5 and he notes he found an old oak stake located from testimony to be the same as Gov't stake at fence corner. (It checks OK to a Poplar stump, the stump to the SE is a Basswood, not an Ash, but it checks OK). The old oak stake was replaced with a new stake. In Book 1, pages 17 and 18 he notes the following distances:

39.16 chains (2584.56') to SW Cor Sec 5

45.30 chains (2989.8') to NW Cor Sec 5

He set the 1/16<sup>th</sup> corners north and south.

2002 On August 1, Westwood Professional Services, Inc. searched corner area and found a steel T post at the intersection of old mostly down fence lines running west, south, and north. We measured north 2996.77 feet to the NE corner of Sec. 6 and south 2567.22 feet to the SE corner of Sec. 6. The occupation 1/16<sup>th</sup> corner to the north fit the proportion of Soderstrum reasonably well. We found no evidence of the 1/16<sup>th</sup> corner markers set by Soderstrum. Accepted the steel T post as marking the obliterated corner position as determined by Soderstrum. On 8/30/02 we replaced the steel T post with a cast iron monument.

County Coordinates

NAD 83 (1996 Adjustment)

N-129581.349

E-547652.030