

Certified, Filed and or Recorded on
Dec. 24, 2008 AT 08:55AM

Signed: BW
MARILYN J NOVAK J E V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 34, Township 38, Range 30
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 10-15-08 found a CAST IRON MONUMENT

left monument as found lowered monument removed monument (explain)

On _____ placed an _____

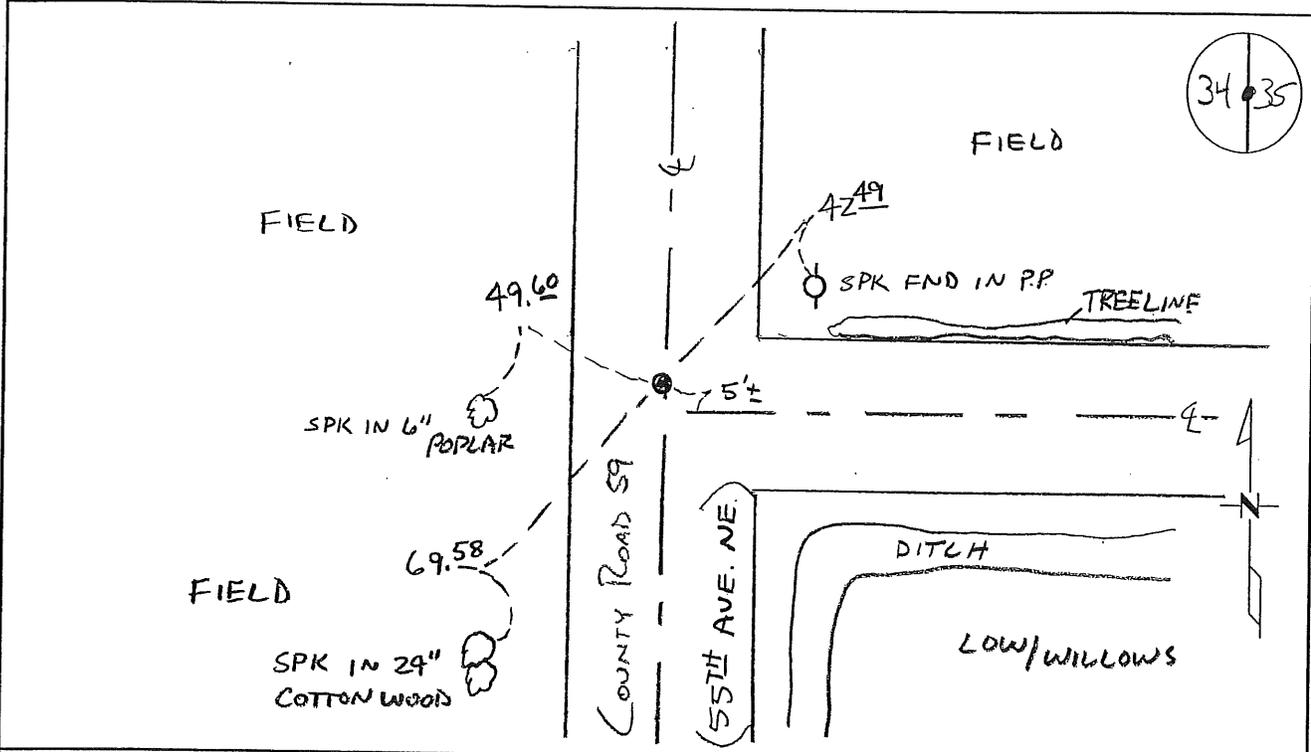

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Handwritten Signature]
Deputy County Surveyor
License No. 43932

Date: 12/17/08

Statement of Evidence:

C343

East Quarter Corner of Section 34, Township 38 North, Range 30 West, Graham Township, 4th Principal Meridian, Benton County, Minnesota.

1852 Original US General land Office survey established corner with a wood post set at this location and bearing trees were recorded.

12" Aspen N 50 1/2 W 504 links

Undated County notes call for the following reference ties to a cast iron monument:

FP	NW	45.97
TP	NE	113.08
Ash	NE	131.87

1938 County Engineer's Notebook No. 122 contains a road survey for CAR 24 running north to south. Notes show no corner, but stationing notes center of cartway east on 1/4 line measuring 2662.0 feet to the NE corner and 2713.4 feet to the SE corner. (A PI is located 431.8 feet south of the cartway, indicating that the 1/4 corner would not be in the center of the road.)

1952 MN/DOT alignment map for TH 25 shows corner assumed in center of north-south road and in line with cart way east. Gives distance of 2665.5 feet to the NE corner of Section 34.

1977 Paul Wellen, LS 10461, set a 1/2" pipe at the centerline of County Road 59 (running north and south) and a cart way east. He notes a distance of 2662.27 feet to the NE corner Sec 34 and a distance of 2715.27 feet to the SE corner Sec 34.

2008 Westwood Professional Services, Inc. found a CIM in the centerline of County Road 59 and ~5 feet north of the centerline of a cartway east. Field crew notes they found a fence post leaning badly NW ~46 feet and a boxelder NE 131.9 feet which may correspond with undated county ties. Measured 2715.11 feet to the southeast corner of Section 34 which also corresponds with 1938 and 1977 measurements. CIM is accepted as marking the obliterated position for this corner.

Coordinates Obtained by GPS

NAD 83 (1996 Adjustment)

N-167121.260

E-500448.721

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East 1/4 Corner of Section 34, Township 38, Range 30, 4th P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

On _____ found ~~at~~ ^{Set 1/2 inch iron pipe in the center line of Benton} County Road 59 and center of cartway east.
This location is verified by 1/16 line fence to the North.

left monument as found, lowered monument, removed monument (explain)

On 6-16-77 placed a Iron Monument (1/2" Pipe)
DATE

SKETCH OF REFERENCE TIES


Refer to next page

Statement of evidence relative to this corner location is on back of page. #147253

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Paul E. Wellen 1/3/78
SIGNATURE DATE

Registration No. 10461

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

OFFICE OF THE REGISTER OF DEEDS *County Recorder*
County of Benton

I hereby certify that this document was filed in the Reg. of Deeds office at 4 P.M. on the 10th day of January A.D., 19 78

~~Register of Deeds~~ F. A. Johnson
By A. E. *County Recorder*, Deputy

DOCUMENT NO. _____

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East 1/4 Corner of Section 34, Township 38, Range 30, 4th P.M.

STATE OF MINNESOTA, County of Benton


At the corner location shown on the sketch:

On _____ found a _____
DATE

left monument as found, lowered monument, removed monument (explain)

On 6-16-77 placed a Iron Monument (1/2" Pipe)
DATE

SKETCH OF REFERENCE TIES

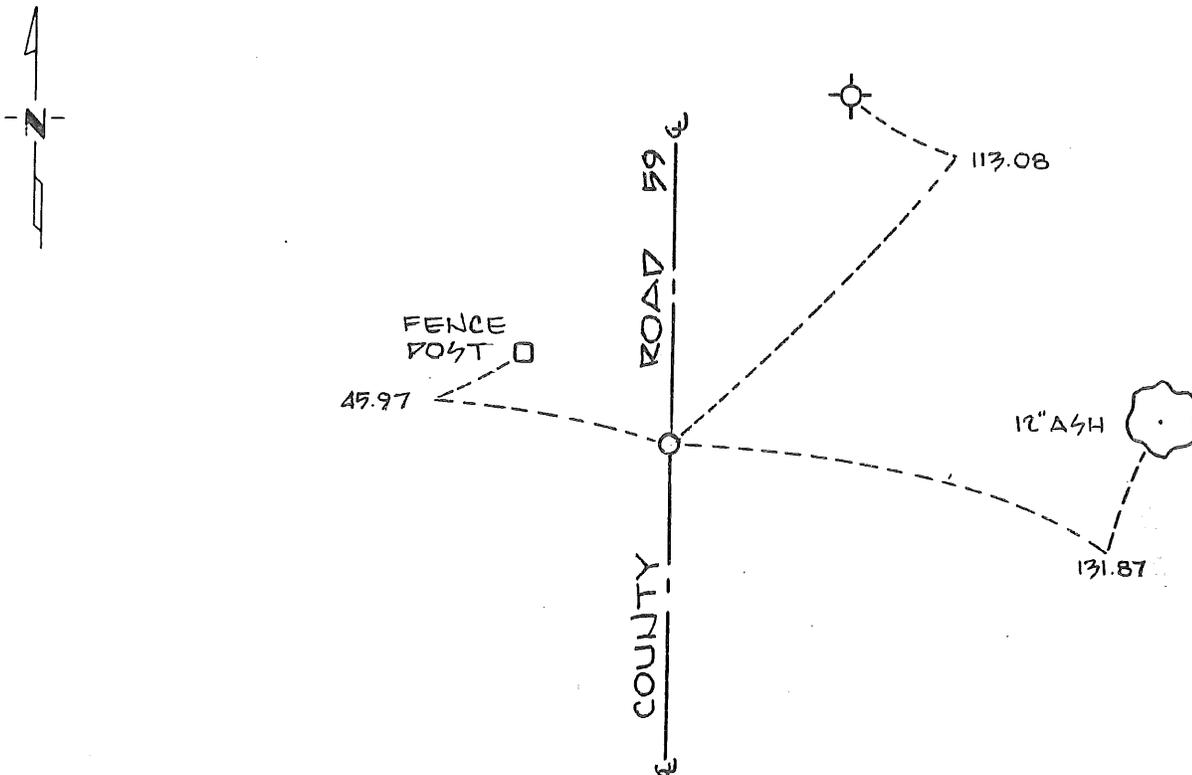

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Dan J. Allen
SIGNATURE DATE 1/3/78

Registration No. 10461

Land Surveyor, Professional Engineer

County Surveyor, County Engineer

OFFICE OF THE REGISTER OF DEEDS
County of Benton 147253

I hereby certify that this document was filed in the Reg. of Deeds office at 4 P. .M. on the 10th day of January A.D., 19 78

Register of Deeds A. D. Johnson
By A. E. H., Deputy

DOCUMENT NO. _____

Set $\frac{1}{2}$ inch iron pipe in the center line of Benton County Road 59 and center of cartway east. This location is varified by 1/16 line fence to the north.