

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTH QUARTER Corner of Section 20, Township 38 N, Range 30 W, 4th P.M.

STATE OF MINNESOTA, County of BENTON

At the corner location shown on the sketch:

- On _____ found a _____
- left monument as found, lowered monument, removed monument (explain)
- On 11-9-92 Placed a 3/4" x 24" REBAR WITH ALUMINUM CAP STAMPED
- "DNR SURVEY MARKER", DOWN 0.02'

SKETCH OF REFERENCE TIES

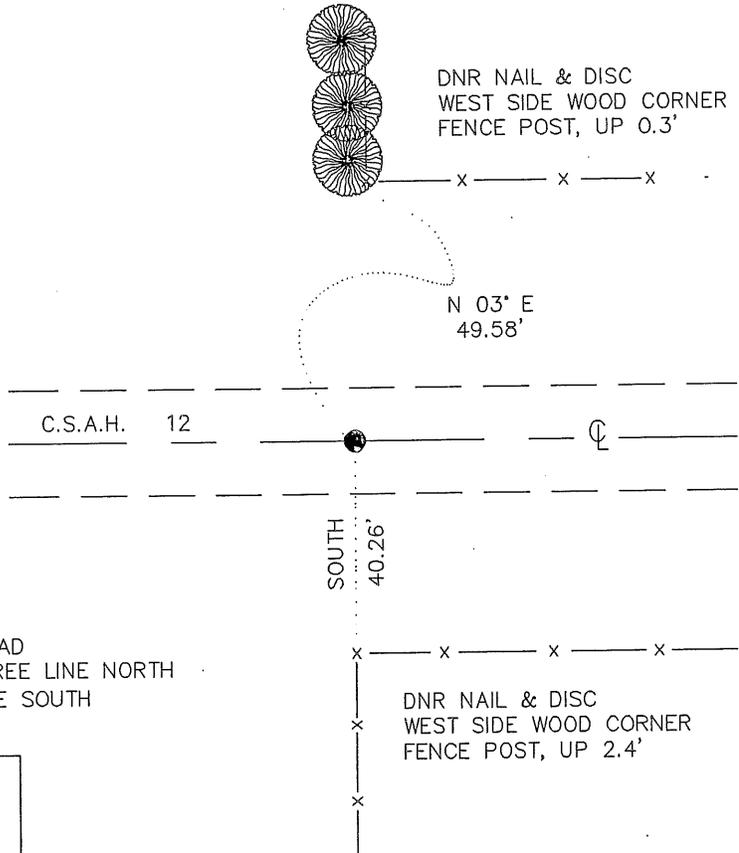

NOTE:
 MONUMENT IS
 ON CL E-W ROAD
 IN LINE WITH TREE LINE NORTH
 AND FENCE LINE SOUTH

1983 BENTON COUNTY
 COORDINATE SYSTEM
 N = 180407.945
 E = 486622.270

BEARINGS OBSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page.

J.B.M. JAN. 1993
WMA01555.00.00.01

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Russ W. Sheppard 2-3-93
 SIGNATURE DATE

- Registration No. 17003
- Land Surveyor, Professional Engineer
 - County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER **212982**
 County of Benton

I hereby certify that this document was filed in the Co. recorders office at 8:15 A.M. on the 8 day of February A.D., 1993
 County Recorder Alice C. Engelmeier
 By JW, Deputy
 DOCUMENT NO. 212982

North Quarter Corner Section 20, Township 38 North, Range 30 West

The DNR Bureau of Engineering contacted the following for survey information:

Minnesota Secretary of State's Office
MN/DOT Office in St. Paul
MN/DOT Office in Brainerd
Benton County Recorder's Office
Benton County Highway Engineer's Office
Paul E. Wellen and Associates of St. Cloud
David Regan, RLS #12236, of St. Cloud
Rieke Carroll Muller and Associates of St. Cloud
William F. Lunser, RLS #9394, of St. Cloud
Comstock and Davis Inc., of Little Falls

1852 U. S. General Land Office notes obtained from the Secretary of State's Office show the corner marked with a wood post with the following bearing trees marked:

5" Aspen, South 43° West, 68 links (44.88 feet)
5" Aspen, North 64° West, 107 links (70.62 feet)

1951 A page in a field notebook obtained from the MN/DOT Office in Brainerd shows that the location of the corner was assumed at the intersection of an east-west road and fence lines north and south. A description of what was set to mark corner is not given. The corner is shown:

2654.0 feet from the northeast corner of Section 20

No Date A right-of-way map for State Highway 25 obtained from the MN/DOT Office in St. Paul shows that the location of the corner was assumed at the intersection of an east-west road and fence lines north and south. A description of what was set to mark corner is not given. The corner is shown:

2654.0 feet from the northeast corner of Section 20

1992 November 9, DNR Bureau of Engineering scanned the area of the corner with an electronic metal locator but no metal attraction was obtained. Searched for but found no evidence of the record ties. Did not excavate for a monument because area is in a 3 foot fill section of a road where natural ground was disturbed for construction.
Set a DNR Survey Marker for corner on the center line of an east-west road, in line with a tree line north and in line with a fence line south and found it to be:

2655.43 feet from the northeast corner of Section 20
2678.72 feet from the northeast corner of Section 19
1.40 feet south and 11.64 feet east of the computed lost position for corner

Analysis of the above information led the DNR Bureau of Engineering to conclude that the DNR Survey Marker set on the center line of an east-west road, in line with a tree line north and in line with a fence line south marks the obliterated location of the corner.