

1-10

A 362868

Certified, Filed and or Recorded on
JAN. 06, 2009 AT 02:59PM


Signed: CK
MARILYN J NOVAK G V J
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

Northeast Corner of Section 29, Township 38 N, Range 30 W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 8-14-2008 found a Cast Iron Monument 18+/- west of TH25 C/L, down 0.6 feet.
DATE
- left monument as found lowered monument removed monument (explain)
- On _____ placed a _____
DATE

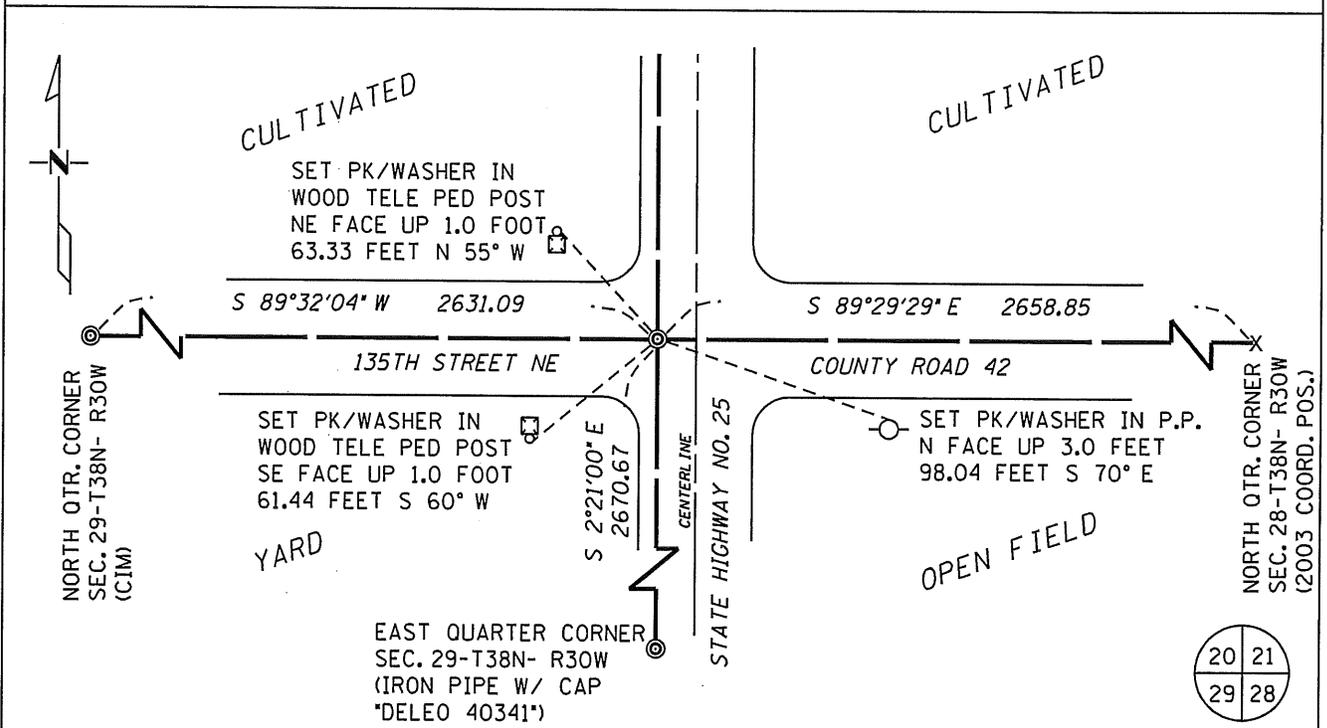

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision.

Signature Sam J. DeLo Date 10-3-2008 License No. 40341
 Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

C292

Northeast Corner of Section 29, Township 38 North, Range 30 West, Graham Township, 4th Principal Meridian, Benton County, Minnesota.

1852 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

6" Aspen	N 78 W	34 links
8" Aspen	N 79 E	36 links

1923 County Engineer's Notebook No. 40 contains a survey for CAR No. 1 running south to north. Notes corner with ties:

TP	NW	39.0'
Cor. FP	NE	37.2'

County Surveyor's Record Book 2, page 214, notes the same ties.

Undated County Highway notes show the following reference ties:

TP	NW	40.4
Cor FP	NE	37.2
Rock	SW	45.3

1952 MN/DOT alignment map (Roll F-02) for TH 218 (25) notes a 4" square stone that is 4" thick at the corner with the following reference ties

Cor FP	SE	49.3
Cor FP	NE	39.55

The corner is at the centerline of a road east/west. Corner is 18.1 feet west of new C/L of TH 25 and a distance of 2631.0 feet to the assumed North ¼ corner Sec 29 and a distance of 2655.0 feet to the assumed North ¼ Corner Sec 28 is shown.

1963 The Minnesota Dept. of Natural Resources (fka MN Conservation Dept.) performed a survey in Sections 29 and 30 for the Wisneski WMA (File No. G892-X). They surveyed the north and east line of Sec. 29, referencing the corner as being a spike set as the assumed position of the PI of Hwy. 25 and Co. Rd. They measured to the NE corner of Sec. 30 (Spike set at assumed pos. of PI) 5289 feet (dbl. chained) and measured to the NE corner of Sec. 32 (found iron pipe) 5386.3 feet.

1990 Survey by Paul Wellen, LS 10461, shows a County monument in place 18.1 feet west of centerline of TH 25.

2002 Westwood Professional Services, Inc. located monuments around Section 21. At this corner we found a cast iron monument +/-17.5 feet west of a PK found at the intersection of the centerlines. Who or when the CIM was set is unknown.

Continued....

County Coordinates Obtained by GPS (CIM)
NAD 83 (1996 Adjustment)
N-175112.701
E-489481.997

For Information – Not Corner
County Coordinates Obtained by GPS (PK at centerline)
NAD 83 (1996 Adjustment)
N-175112.700
E-489499.521

- 2008 Sam DeLeo, LS 40341, found a CIM +/- 18 feet west of TH 25 CL. Westwood's 2002 coordinate values were verified. The measured distance of 2631.09 feet to the NQ of Sec. 29 and the computed distance of 2658.85 feet to the 2003 published coordinate position for the NQ of Sec. 28, compare well with the 1952 distances. The distance of 5269.63 feet to the CIM at the NE of Sec. 28 does not compare well with the 1963 distance. The distance of 5387.04 feet to the iron pipe at the NE of Sec. 32 does compare well with the 1963 distance. New reference ties were set and recorded. Westwood's 2002 coordinate values were verified.