

A 361586

Certified, Filed and or Recorded on
Nov. 06, 2008 AT 08:44AM


Signed: CK
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 23, Township 37N, Range 28W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On _____ found a _____
- left monument as found lowered monument removed monument (explain)
- On 10/28/08 placed an PK NAIL WITH BENTON COUNTY SURVEYOR DISK

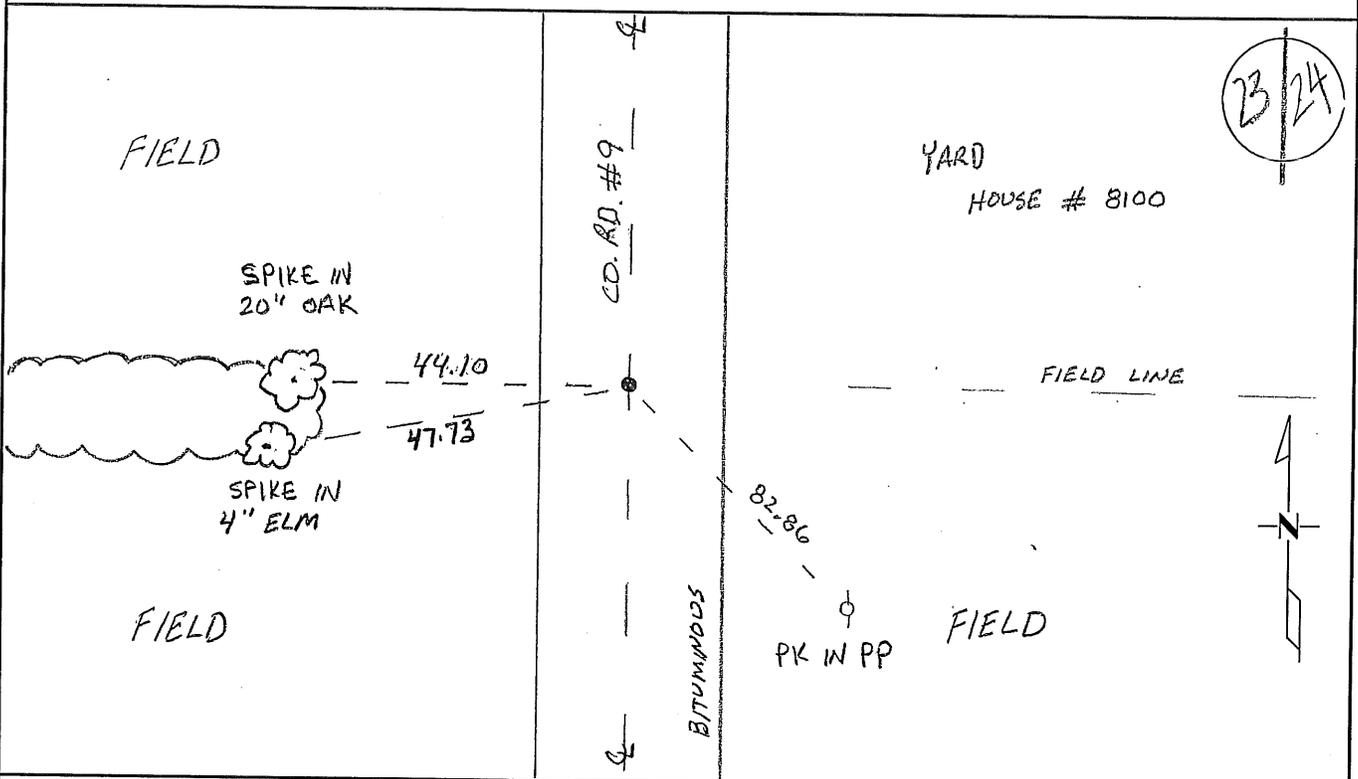

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jan W. Ols
Deputy Benton County Surveyor
License No. 45872

Date: 11/04/2008

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:**I233**

East Quarter Corner of Section 23, Township 37 North, Range 28 West, Maywood Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

17" Tamarack	N 65 E	17 links
12" Blk Ash	N 42 W	32 links

1914 County Surveyor's Record Book 2, pages 430 and 431, and Record Book A, Map No. 3, shows a survey of Section 23 by J. P. Soderstrum. Notes show he found a stake in centerline of road.

1932 County Engineer's Notebook No. 80 for survey of SAR 9 running south to north. Corner is shown as a hub in center of road with fence lines east and west. Stationing gives distances of 2681.9 feet to the SE corner and 2600.1 feet to the NE corner with a delta angle of 0-54' right. Ties:

F.P.	NE	33.2'
F.P.	W	21.0'

1960 County Surveyor's Record Book 2, page 430, shows County Highway notes where old post found and replaced with iron.

1963 Ties:

PP	SE	40.8
TP	SW	92.55
4" Box Elder	W	43.4

Shows tree line west and fence line east.

1961 County Engineer's Notebook No. 234 contains survey for CSAH 9 running south to north on section line. Notes show corner marked by an iron in center of road with fence running east. Same ties as 1963. Stationing gives distances of 2683.8 feet to the SE corner and 2600.1 feet to the NE corner with a delta angle of 0-54' right.

2008 The County Surveyor's Office searched and found no evidence of a monument. Measurements between the NE and SE Corners gives 5282.88 ft., which compares well with 1932 and 1961 measurements, 5282 ft. & 5283.9 ft., respectively. Using proportionate measure from 1961 measurements, places the corner 2599.76 ft. from the NE Cor. and 2683.27 ft. from the SE Cor. Proportionate measure places the corner on centerline of north-south County Road 9 and on line with field lines to the east and west, and gives a deflection angle (going south to north) of 0°51'06" right, which compares well with the deflection angle from 1932 of 0-54' right. The Surveyor accepts the position by proportionate measure and set a PK nail with a Benton County disk flush with the bituminous surface.

County Coordinates obtained by GPS

NAD 83 (1996 Adjustment)

N-145917.601

E-568548.381