

Certified, Filed and or Recorded on  
Nov. 06, 2008 AT 08:52AM

Signed: CK  
MARILYN J NOVAK G V J  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 28, Township 37N, Range 28W  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 10/20/08 found a 1/2" IRON PIPE CAP# 19552 DOWN 0.1'

left monument as found     lowered monument     removed monument (explain)

On \_\_\_\_\_ placed an \_\_\_\_\_

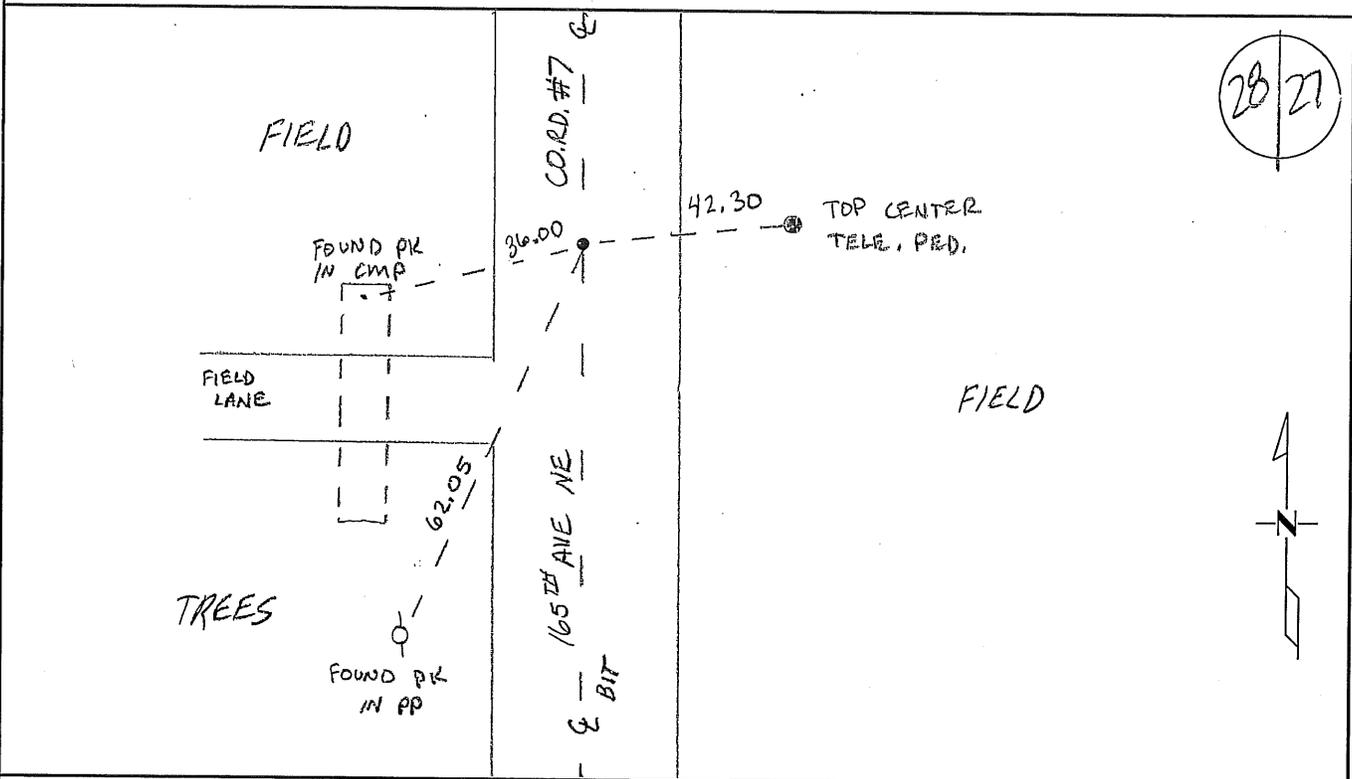

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jan W. O'Leary  
Deputy Benton County Surveyor  
License No. 43872

Date: 11/03/2008

Benton County Surveyor's Office  
 Jason W. Oberg, Deputy County Surveyor  
 Minnesota License No. 45872

**Statement of Evidence:**

I283

East Quarter Corner of Section 28, Township 37 North, Range 28 West, Maywood Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

9" Blk Ash	S 82 E	53 links
12" Blk Ash	N 77 W	22 links

1902 County Surveyor's Record Book A, Map No. 38, shows a survey of Section 27 by John Whilt. Corner is shown marked by a post with a distance of 39.38 chains to the NE corner and 39.60 chains to the SE corner.

2008 The County Surveyor's Office searched and found a 1/2" capped iron pipe (#19552) approximately 0.1' below the surface of the centerline of north-south bituminous road (County Road No. 7). Measured distances from this position to the NE corner and SE corner are 2609.60 feet and 2624.18 feet respectively, which are in reasonable agreement with the prorated 1902 distances of 2599.08 feet (39.38 ch.) and 2613.60 feet (39.6 ch.), respectively. The surveyor accepts the position and set ties to same.

County Coordinates to 1/2" iron pipe obtained by GPS.  
 NAD 83 (1996 Adjustment)  
 N-140417.681  
 E-558063.865