

Certified, Filed and or Recorded on  
Mar. 11, 2009 AT 10:11AM

Signed: Ju  
MARILYN J NOVAK G V I  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


SOUTHEAST Corner of Section 36, Township 36, Range 31  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 11-26-08 found a CAST IRON MONUMENT

left monument as found       lowered monument       removed monument (explain)

On \_\_\_\_\_ placed an \_\_\_\_\_

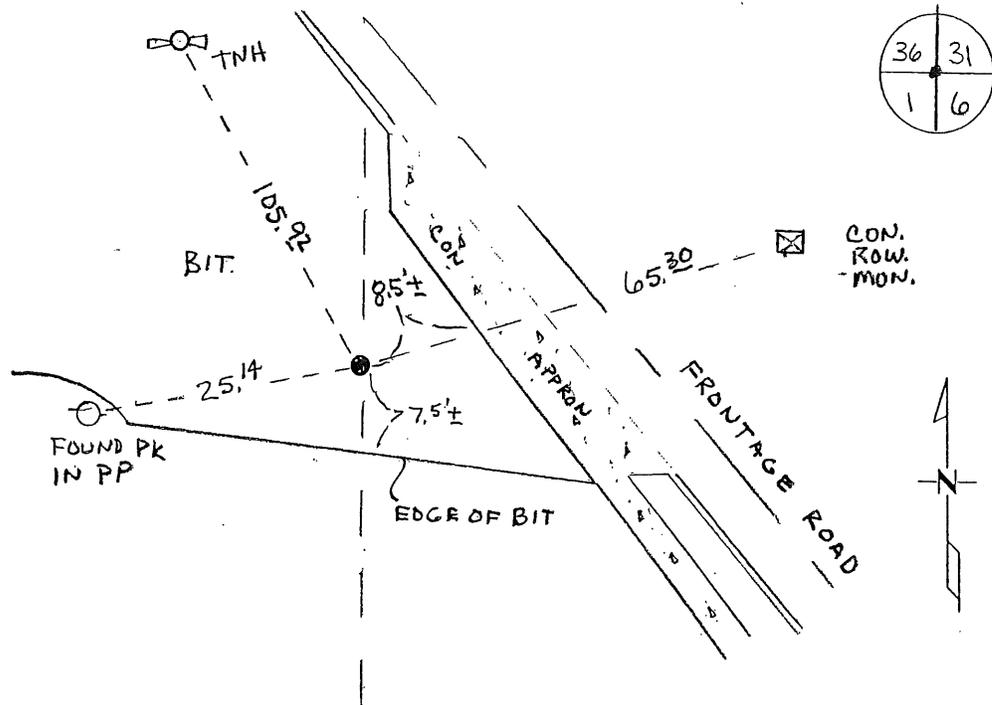

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Handwritten Signature]  
Deputy County Surveyor  
License No. 43932

Date: 3/6/09

Benton County Surveyor's Office  
Chris Hogle, Deputy County Surveyor  
Minnesota License No. 43932

**Statement of Evidence:**

M364

Southeast Corner of Section 36, Township 36 North, Range 31 West, Sauk Rapids Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

- 1849 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.  
16" Bur Oak N 2 ¾ E 481 links, 18" Bur Oak N 14 W 545 links, 14" Bur Oak S 79 W 200 links

This corner is noted on the following recorded plats:

<i>OAKWOOD HEIGHTS (CIM)</i>	3/4/1994	<i>Paul Wellen</i>
<i>OAKWOOD HIEGHTS PLAT 2 (CIM)</i>	9/22/1995	<i>Linda Brown</i>
<i>OAKWOOD HIEGHTS PLAT 3 (CIM)</i>	1/29/1996	<i>Linda Brown</i>
<i>OAKWOOD HIEGHTS PLAT 4</i>	3/5/1997	<i>Linda Brown</i>
<i>CENTER EAST (CIM)</i>	8/22/1992	<i>Sidney Williamson</i>
<i>IVES ACRES</i>	3/17/1986	<i>Paul Wellen</i>
<i>LINCOLN PLACE ADDITION (CIM)</i>	4/16/1985	<i>William Lunser</i>
<i>SOUTHEAST TEN</i>	9/30/1986	<i>Paul Wellen</i>
<i>WOODLAND OAKS ADDITION</i>	9/14/1982	<i>David Regan</i>
<i>AUDITORS 1916 SUBDIVISION</i>	4/18/1916	<i>J.P. Soderstrum</i>
<i>AMERICANA INN ADDITION</i>		<i>Meinrad B. Torborg</i>
<i>MN/DOT RIGHT OF WAY PLAT NO. 05-16</i>	3/7/2000	<i>David Kohanek</i>

- Undated MN/DOT road alignment plans for TH 10 note an iron pin at the corner and a distance of 167.5 feet to the southeast bound centerline and a distance of 270.1 feet to the northwest bound centerline.

Pre 1940 MN/DOT notes by C. H. West, LS, for TH 95 show square stone monument in place on fence lines east and west. Ties:

12" Oak NE	48.2	
12" Oak ENE	40.7	
5" Oak	SE	44.3

- 1969 Certificate of Location filed in Sherburne County by Delbert Rieke, LS 5094, shows 1" iron pipe found and replaced with a CIM.
- 1998 MN/DOT and Sherburne County Surveyor's Office found and used a cast iron monument at the corner.
- 2000 County Coordinates shown on MN/DOT Right of Way Plat No. 05-16 - CIM  
N - 100022.363  
E - 479059.363
- 2004 County Coordinates converted from Sherburne County Coordinates on Certificate of Location prepared by Michael Trunk, LS 18434, County Surveyor.  
NAD83 (1986 Adjustment)  
N - 100022.84  
E - 479059.50
- 2008 Westwood Professional Services, Inc. found a cast iron monument at the corner location. CIM fits one remaining tie to Trunk's certificate and agrees with 2000 MN/DOT and 2004 Trunk coordinates. CIM is accepted as marking the obliterated position for this corner.  
Coordinates Obtained by GPS to CIM  
NAD 83 (1996 Adjustment)  
N-100023.104  
E-479058.945