

Certified, Filed and or Recorded on  
July 27, 2010 AT 11:41AM


Signed: BW  
MARILYN J NOVAK . G V I  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 12, Township 38, Range 29  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 07/14/10 found a 1/2" OPEN IRON PIPE ON N/S CENTERLINE AND OF FENCE LINES EAST & WEST
- left monument as found       lowered monument       removed monument (explain)
- On \_\_\_\_\_ placed an \_\_\_\_\_

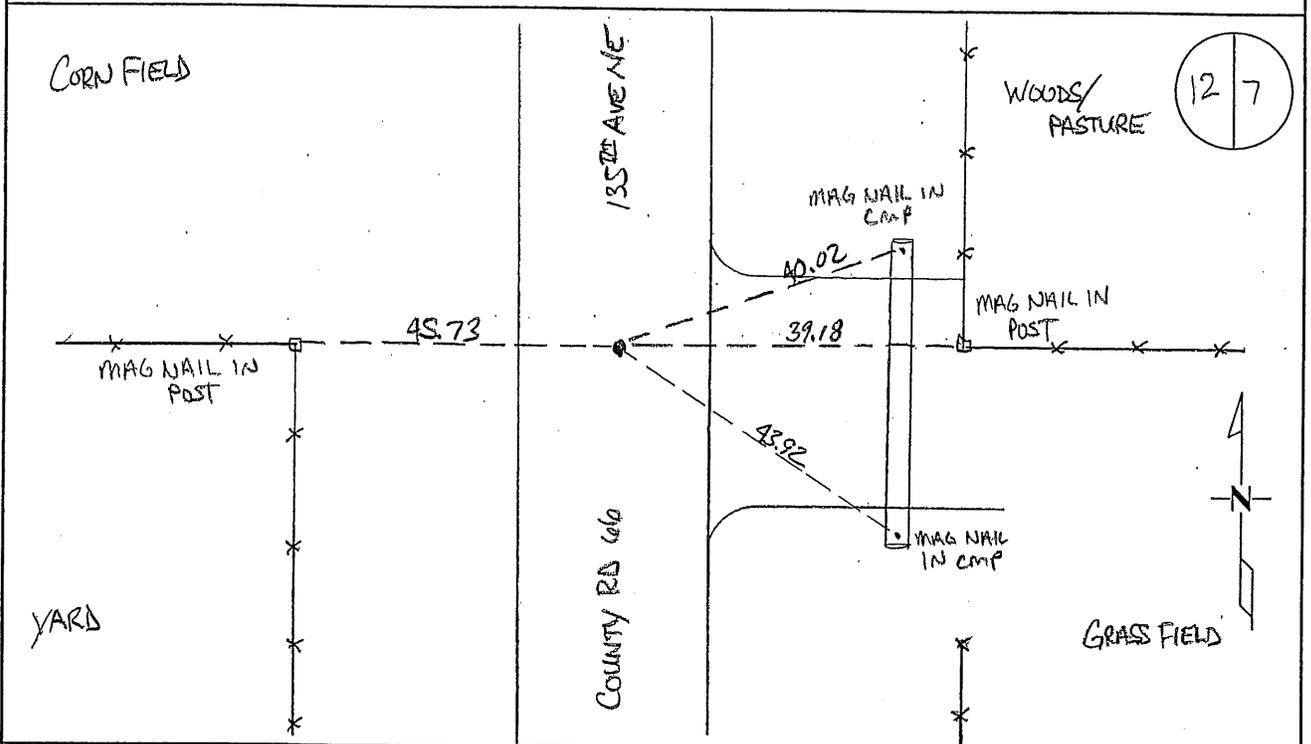

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wittstock  
Benton County Surveyor  
License No. 19552

Date: 7/26/2010

**Statement of Evidence:**

B123

East Quarter Corner of Section 12 Township 38 North, Range 29 West, Alberta Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1849 Original US General Land Office survey established corner marked with a wood post and bearing trees noted as:

|           |        |          |
|-----------|--------|----------|
| 8" Sugar  | N 88 E | 29 links |
| 12" Sugar | N 2 W  | 25 links |

Line trees were noted as a 14" Sugar South 16.91 chains and a 10" Poplar North 18.02 chains.

1936 County Engineer's Notebook No. 101 shows survey for road running south to north. Notes show corner marked by a hub with fence line west. Ties:

|           |    |      |
|-----------|----|------|
| 6" Oak    | NE | 41.8 |
| 6" Poplar | SE | 37.9 |

Stationing gives distances of 2653.6 feet to the SE corner and 2650.2 feet to the NE corner with a delta angle of 0-30' right.

1974 Note in Notebook No. 101 shows found iron rod with ties:

|            |    |       |
|------------|----|-------|
| PP         | NE | 49.0' |
| 15" W. Oak | E  | 96.4' |

2010 The Benton County Surveyor's Office found a 1/2" open iron pipe in the north-south centerline of County Road 66 and on fences east and west. The position fits a split of the distance between section corners within a few hundredths and fits the 1936 distance south within a foot and north within 4 feet. Believing this to be the best available information the 1/2" iron pipe is accepted as marking the obliterated corner position. GPS Coordinates were obtained and reference ties established.

Coordinates Obtained by GPS  
NAD 83 (1996 Adjustment)  
N-188228.619  
E-542091.757