

Certified, Filed and or Recorded on
July 27, 2010 AT 11:41AM


Signed: BW
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 24, Township 38, Range 29
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 07/14/10 found a 1/2" IRON PIPE WITH BUSTED OFF PLASTIC CAP
ON N/S CENTERLINE AND 19 FT NORTH OF CENTERLINE WEST
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

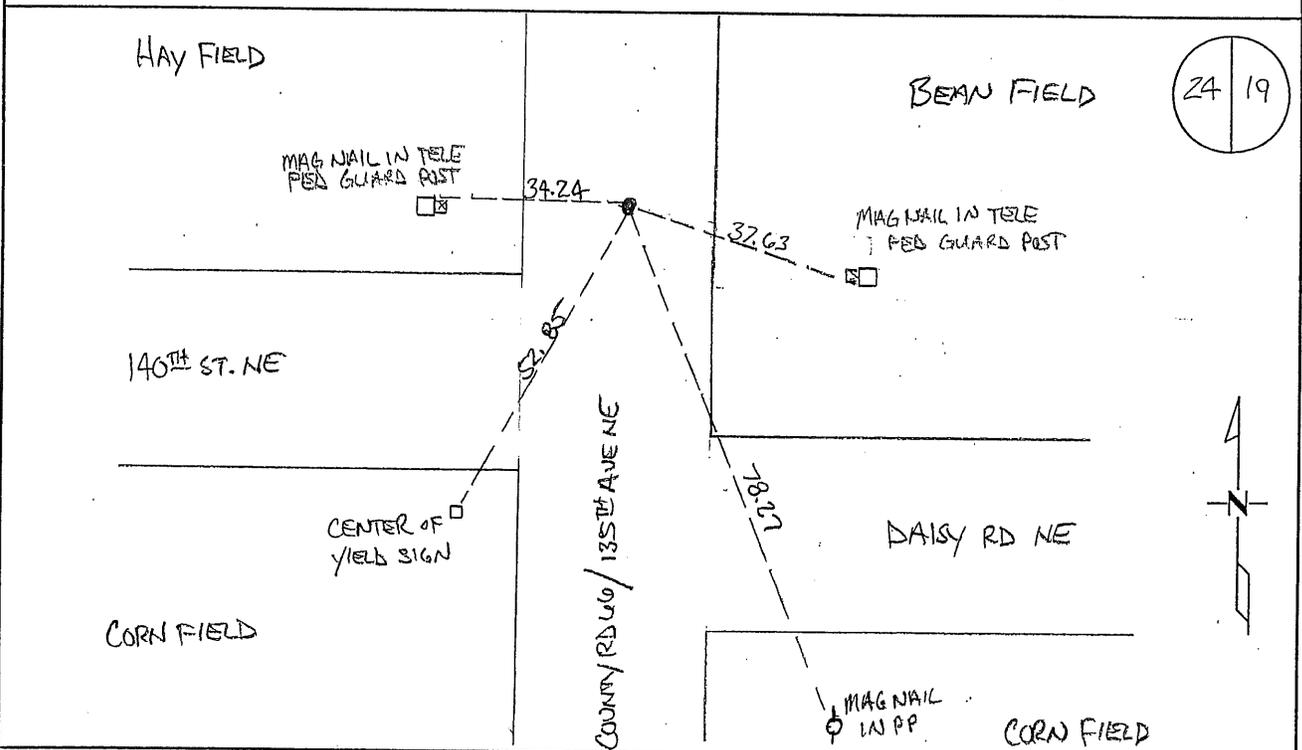

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wittstock
Benton County Surveyor
License No. 19552

Date: 7/26/2010

Benton County Surveyor's Office
 Jerome C. Wittstock, County Surveyor
 Minnesota License No. 19552

Statement of Evidence:**B243**

East Quarter Corner of Section 24, Township 38 North, Range 29 West, Alberta Township,
 4th Principal Meridian, Benton County, Minnesota.

1849 Original US General Land Office survey set a wood post and bearing trees noted as
 12" Sugar N 35 W 19 links
 8" Sugar S 19 E 5 links
 Line trees were noted as a 10" W Oak South 22.80 chains and a 10" W Oak North
 16.25 chains.

1924 County Surveyor's Record Book 2, page 284, and Record Book A, Map No. 46,
 shows a survey of Section 24. An iron monument is noted at the corner with an
 overall distance for the east line of 5266.0 feet.

1936 County Engineer's Notebook No. 101 shows survey for road running south to north.
 Notes show corner marked by an iron pin with fence lines east and west. Ties:
 Hub NW 31.5'
 Hub NE 38.5'
 Stationing gives distances of 2639.4 feet to the SE corner and 2634.5 feet to the NE
 corner. (5273.9 feet for the mile)

1973 County Surveyor's Record Book 2, page 284, notes ties to an iron:
 TP W 34.55
 PP E 31.45
 PP SE 81.2
 (Also noted in Notebook 101 as found corner.)

2004 Westwood Professional Services, Inc. search corner area, but found no evidence of a
 corner marker or old ties. Measured 5275.65 feet between section corners. Road east
 is 29 feet south of the split and road west is 19 feet south of the split.

2008 The Benton County Surveyor's Office found a 3/4" iron pin down 3 feet in the north-
 south centerline of County Road 66, 32 feet north of the centerline of Daisy Road NE
 to the east and 19 feet north of the centerline of 140TH Street NE to the west. The
 found pin falls on the northerly right of way fence of Daisy Road NE. The found pin
 fits proportionally with the 1936 distances. The iron pin is accepted as marking the
 obliterated corner position and a 1/2" by 14" iron pipe capped RLS 19552 was place
 at the road surface.

Coordinates Obtained by GPS
 NAD 83 (1996 Adjustment)
 N- 177632.320
 E- 542253.043

2010 The Benton County Surveyor's Office found the iron pipe set in 2008, verified
 coordinates and established reference ties.