

Certified, Filed and or Recorded on
Nov. 04, 2008 AT 12:32PM

Signed: BW
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 6, Township 38, Range 29
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 10-29-08 found a 1/2" SOLID IRON PIPE

left monument as found lowered monument removed monument (explain)

On _____ placed an _____

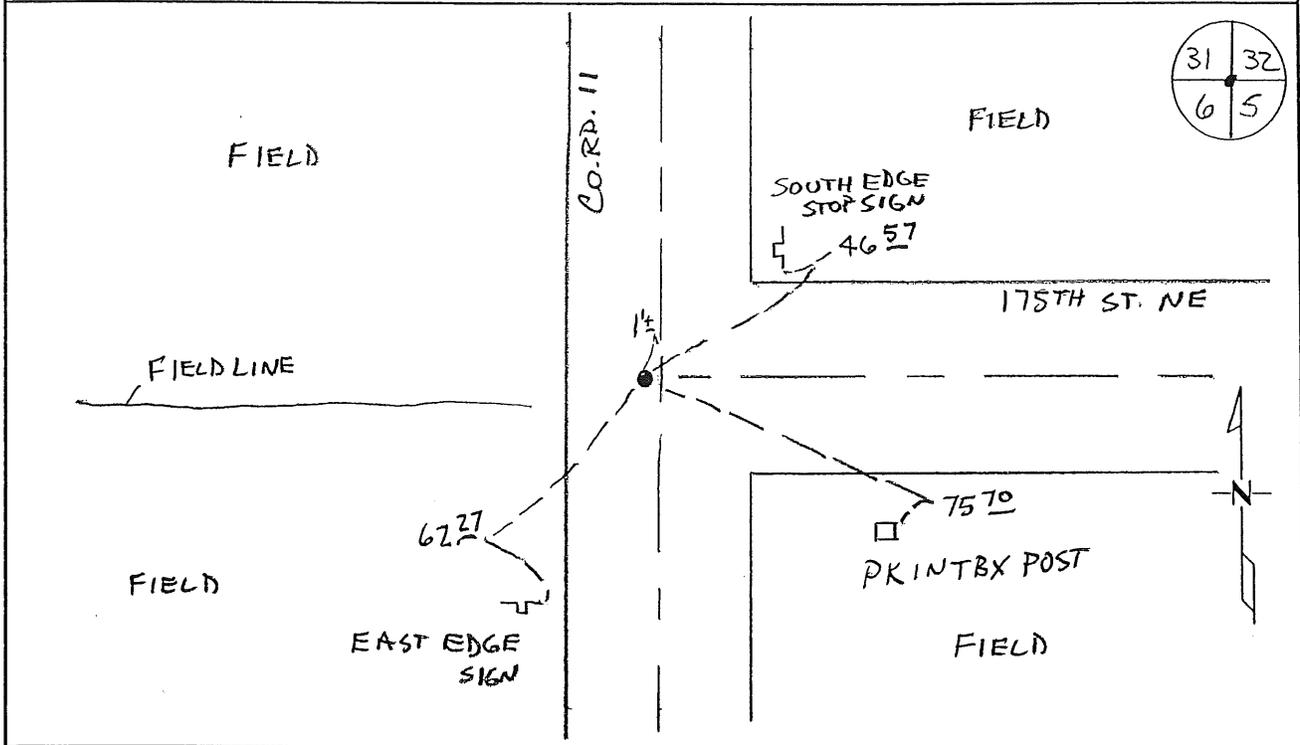

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Handwritten Signature]
Deputy County Surveyor
License No. 43932

Date: 11/3/08

Benton County Surveyor's Office
 Chris Hogleund, Deputy County Surveyor
 Minnesota License No. 43932

Statement of Evidence:

B062

Northeast Corner of Section 6, Township 38 North, Range 29 West, Alberta Township,
 4th Principal Meridian, Benton County, Minnesota.

1849 Original US General Land Office survey set a wood post and bearing trees noted as:

8" Blk Oak	N 33E	44 links
6" Blk Oak	N 64 W	63 links
6" Maple	S 45 E	56 links
8" Blk Oak	S 66 W	22 links

Line trees were noted as a 6" Poplar East 20.62 chains and
 a 4" Maple West 20.75 chains.

1914 Phil Randall, in the Morrison County Surveyor's Record Book A, page 171, notes a stake at the corner for town road survey along the south line of Section 32, 39-29.

1935 County Engineer's Notebook No. 93 contains survey for Road running from south to north and terminating at this corner. Notes corner as a hub with town road east and fence line west on County line. Ties:

Hub	W	34.0
Hub	SE	47.6
Iron Pipe SE 36.0 on fence line		

1963 County Surveyor's Record Book 2, page 248, (also Notebook 93) notes placed iron with ties:

PP	W	36.8
TP	NE	45.75

1964 County Engineer's Notebook No. 246 contains survey for CSAH 11 running south to north on section line. Notes show corner marked by an iron in center of road with town road east. Ties are same as listed in 1963.

2008 Westwood Professional Services, Inc. found a ½" solid iron pipe ~1 foot west of the traveled centerline of CR 11 (north/south) and on the traveled centerline of 175th St. NE. No prior ties remain for this corner. It appears as if this position was used to establish the position for the N1/4 of Section 5 and fits substantially well with road intersections as indicated by County Engineer's Notebook No. 246. ½" solid iron pipe is accepted as marking the obliterated position for this corner.

County Coordinates Obtained by GPS
 NAD 83 (1996 Adjustment)
 N-196676.938
 E-515162.136