

Certified, Filed and or Recorded on
Aug. 24, 2009 AT 08:08AM


Signed: CK
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 14, Township 38, Range 29
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On _____ found a CAST IRON MONUMENT
- left monument as found lowered monument removed monument (explain)
- On 07/01/09 placed an 1/2" I.P. PLS #19552

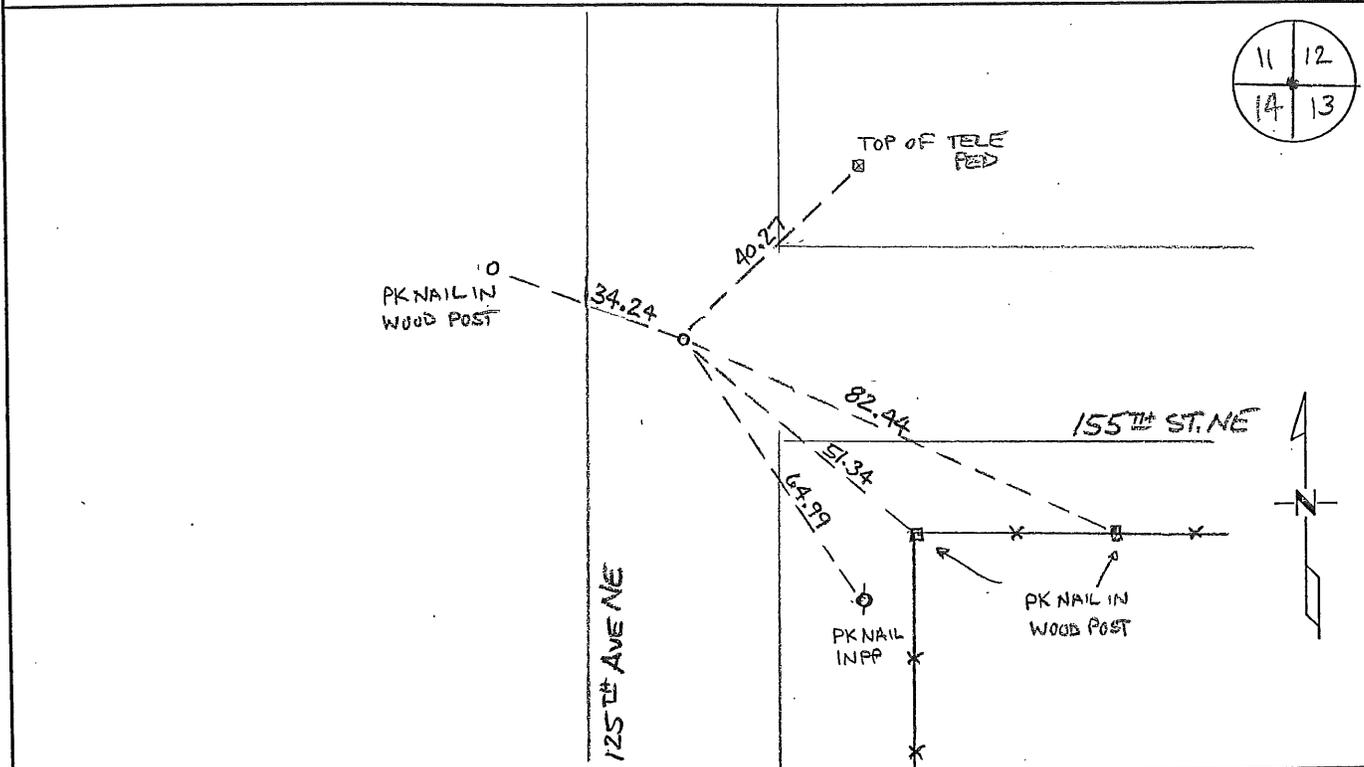

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wittatoch
Benton County Surveyor
License No. 19552

Date: 21 August 2009

Benton County Surveyor's Office
 Jerome C. Wittstock, County Surveyor
 Minnesota License No. 19552

Statement of Evidence:**B142**

Northeast Corner of Section 14, Township 38 North, Range 29 West, Alberta Township,
 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

10" Birch	N 62 E	28 links
8" Blk Ash	N 75 ½ W	13 links

1944 County Engineer's Notebook No. 157 contains road survey for CAR No. 43 running north to south along the section line. Corner is shown as a rock in center of road with town road east and fence west. Ties:

TP	SE	39.8'
FP	W	26.1'

1963 County Surveyor's Record Book 2, page 264, notes the following reference ties to an iron over a rock:

PP	NE	35.5'
TP	W	34.1'

(Also noted in Notebook No. 157 as found and placed iron over.)

1993 Sidney Williamson, LS, found a broken off fence post at the centerline of roads north/south/east and replaced it with a cast iron monument. He filed a Certificate of Location (#223493).

2009 Westwood Professional Services, Inc. found a CIM and excavated the corner location with a Benton County backhoe. A 6-foot by 8-foot by 3-foot deep hole was excavated and a stone was found under the CIM position. Believing this to be the best obliterated evidence the corner position was accepted and marked with a 1/2-inch by 15-inch iron pipe capped 19552 down 0.4 feet below the road surface.

Coordinates Obtained by GPS
 NAD 83 (1996 Adjustment)
 N-185682.075
 E-536951.359


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 14, Township 38, Range 29, _____ P.M.
 STATE OF MINNESOTA, County of BENTON

At the corner location shown on the sketch:

- On 4-27-93 found a BROKEN OFF FENCE POST
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 6-17-93 placed a STANDARD CAST
DATE

SKETCH OF REFERENCE TIES

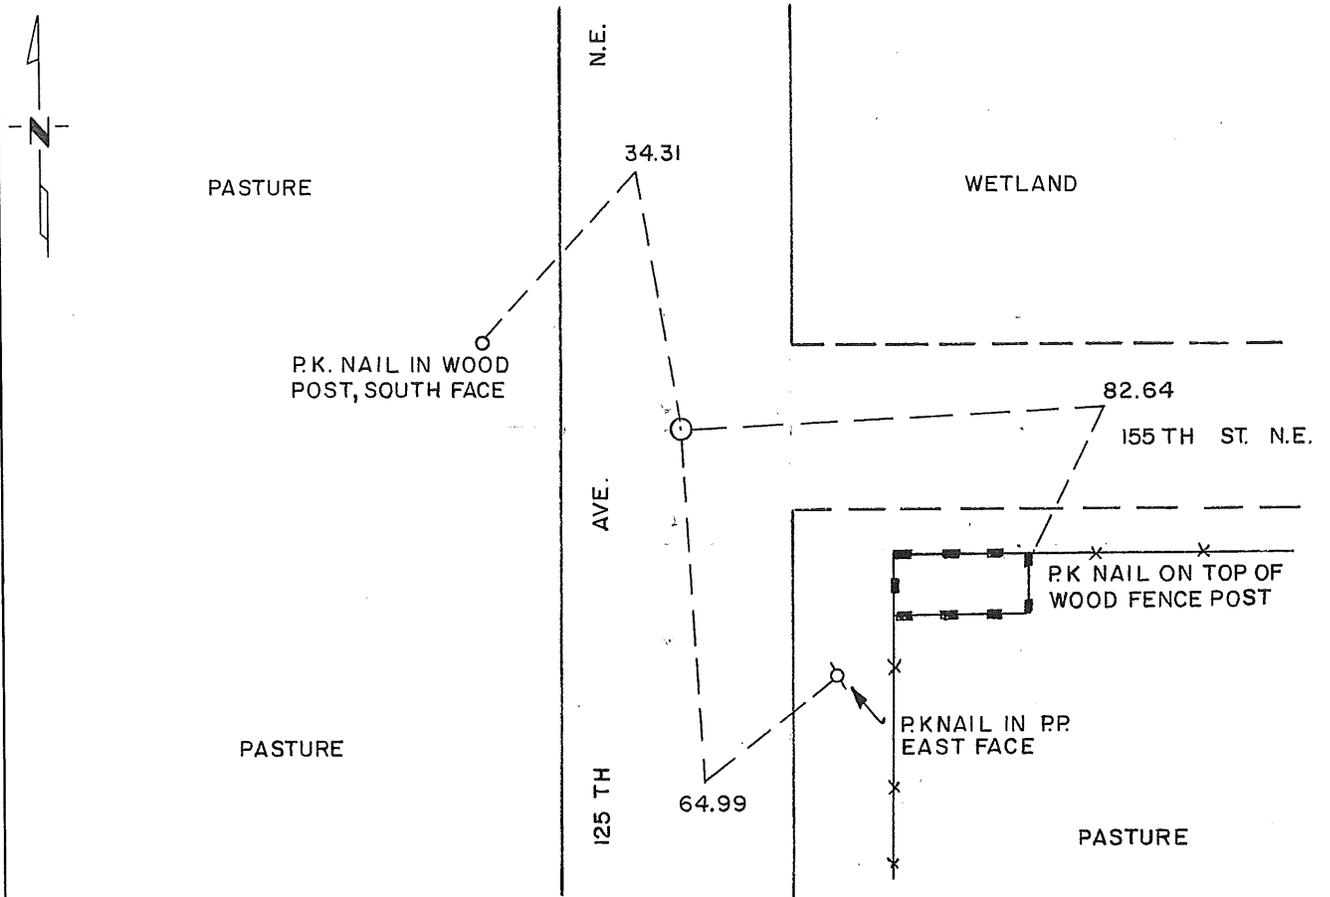

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Sidney P. Williamson 5/24/94
SIGNATURE DATE

Registration No. 10918

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 _____

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence:

1. In 1855, the Original Government Survey was performed.
2. The Benton County Survey Records indicate an iron over rock.
3. On June 22, 1993, Williamson-Kotsmith, Inc. excavated with jackhammer at the intersection of County Road 14 and 155th Street NE and found a broken off steel fence post.
4. On June 22, 1993, Williamson-Kotsmith, Inc. removed fence post and place a Standard Cast Iron Monument at this location.

223493

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

JUN 17 1 10 PM '94

ALICE G. HENNINGER
COUNTY RECORDER

BY  DEPUTY