

A 372587

Certified, Filed and or Recorded on  
Mar. 02, 2010 AT 03:35PM

Signed: BW  
MARILYN J NOVAK G V I  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTHEAST Corner of Section 27, Township 38, Range 29  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 11-11-08 found a 1/2" IRON PIPE # 9394

left monument as found  lowered monument  removed monument (explain)

On 7/1/2009 placed an 1/2" x 14" IRON PIPE CAPPED 1955Z

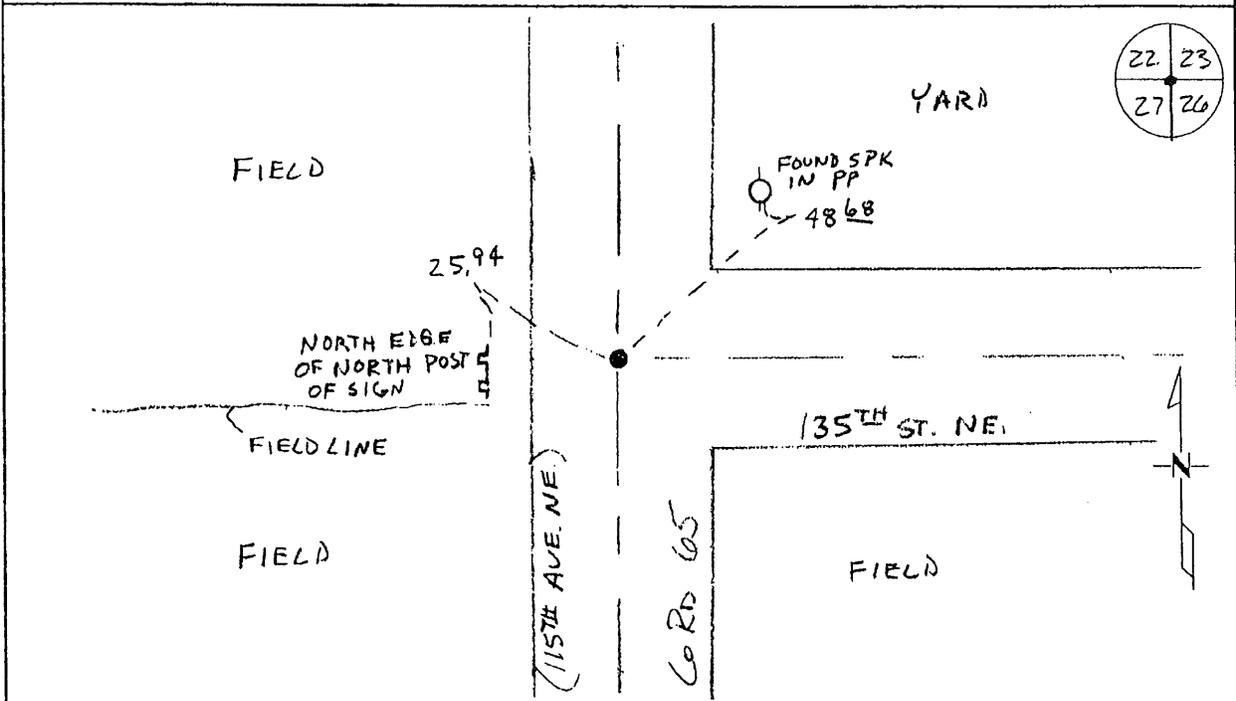

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Handwritten Signature]  
Deputy County Surveyor  
License No. 43932

Date: 11/20/09

Benton County Surveyor's Office  
 Chris Hoglund, Deputy County Surveyor  
 Minnesota License No. 43932

**Statement of Evidence:****B272**

Northeast Corner of Section 27, Township 38 North, Range 29 West, Alberta Township,  
 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

14" Sugar	N 47 ½ E	60 links
14" Sugar	N 15 W	50 links

Undated County Surveyor's Record Book 2, page 290, notes ties:

Cor FP	NE	27.5 feet
Cor FP	SE	31.0 feet

1907 County Road Book, pages 4-6, contains a road survey by Felix Parent, County Surveyor, for State Road. Survey shows corner found and "drove 1 ¼" x 16" gas pipe in place of old post". Stationing gives distance of 2653 feet to the E1/4 corner of Section 27.

1912 County Surveyor's Record Book 2, page 231, notes a post in the road 21 feet west of a fence line.

2009 Found 1/2" iron pipe with Lunser cap (LS #9354). We removed pipe and excavated two locations. First area was an 8 foot east-west by 14 foot north-south by 6 foot deep hole at a proportioned position based on 1907 Parent distances and found nothing. The second area excavated was an 8 foot east-west by 14 foot north-south by 6 foot deep hole centered on the found ½" pipe and nothing was found during the search. Lunser position fits existing occupation and has been used for surveys in the area. Position is accepted as marking the obliterated location for this corner. We set ½"x14" iron pipe capped 19552 in place of the removed pipe.

Coordinates Obtained by GPS  
 NAD 83 (1996 Adjustment)  
 N-175203.971  
 E-531770.697