

Certified, Filed and or Recorded on  
Oct. 31, 2008 AT 08:30AM

Signed: ML  
MARILYN J NOVAK G V  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

### CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 31, Township 38, Range 31  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 8-27-08 found a Broken C.I.M

left monument as found       lowered monument       removed monument (explain)

On \_\_\_\_\_ placed an \_\_\_\_\_

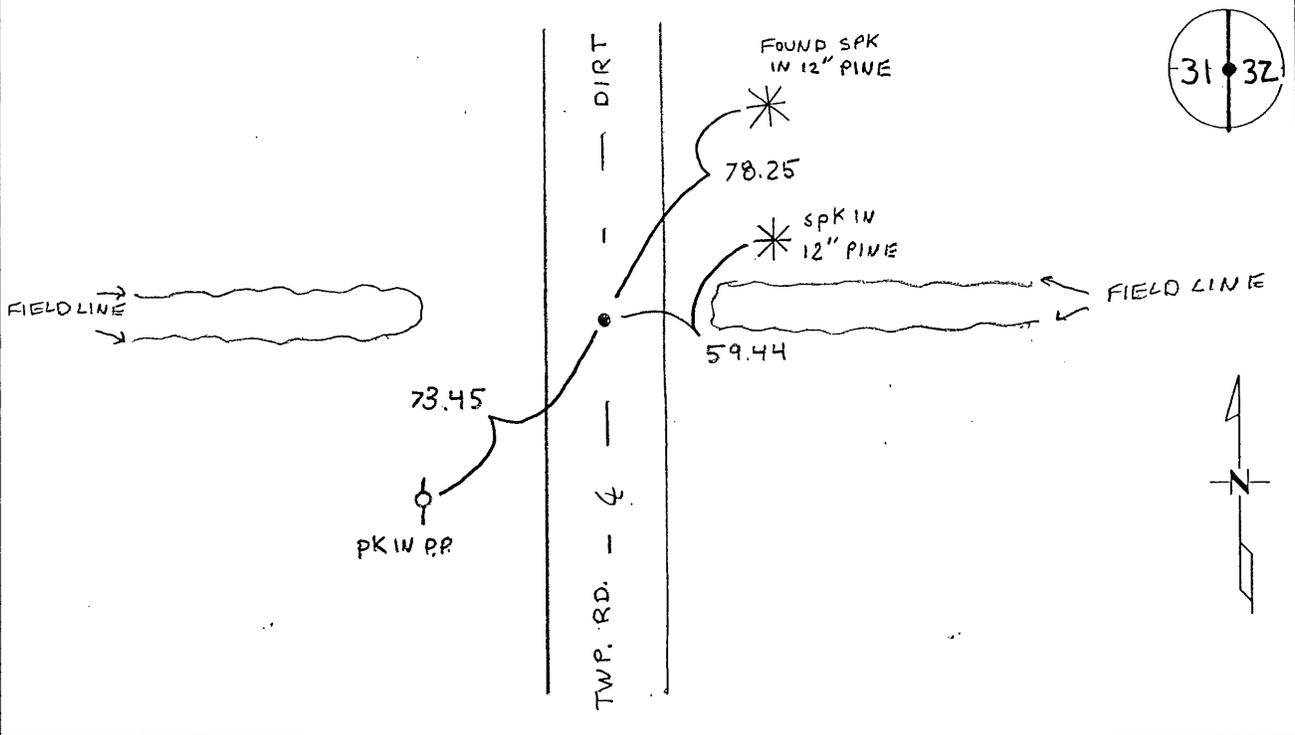

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Handwritten Signature]  
Deputy County Surveyor  
License No. 43932

Date: 10/14/08

Benton County Surveyor's Office  
Chris Hoglund, Deputy County Surveyor  
Minnesota License No. 43932

**Statement of Evidence:**

D313

East Quarter Corner of Section 31, Township 38 North, Range 31 West, East Langola Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

- 1852 Original US General Land Office survey set a wood post in a mound with pit 8 links east at the corner location.
- 1978 William Lunser, LS 9394, set a 3/4" pipe at the intersection of a road north/south and a fence line west.
- 1985 William Lunser set a cast iron monument at the location of the 3/4" pipe and filed a Certificate of Location (#191264). Certificate shows a distance of 2624.34 feet to the NE corner of Section 31.
- 2003 Survey & Engineering Professionals, Inc. obtained coordinates by conventional traverse to found CIM. Measured 2624.33 feet to the NE corner and 2670.13 feet to the SE corner.  
County Coordinates:  
NAD 83 (1996 Adjustment)  
N- 166909.248  
E- 452099.521
- 2004 MN/DOT  
County Coordinates obtained by GPS  
NAD 83 (1996 Adjustment)  
N-166909.205  
E-452099.349
- 2008 Westwood Professional Services, Inc. found a CIM (top broke) at the corner location. Measured 2624.38 feet to the NE corner and 2670.06 feet to the SE corner. CIM is accepted as marking the obliterated corner position. County Coordinates Obtained by GPS coincide with 2004 MN/DOT position.

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


East Quarter \_\_\_\_\_ Corner of Section 31, Township 38, Range 31, 4th.P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On \_\_\_\_\_ found a \_\_\_\_\_  
DATE
- left monument as found,  lowered monument,  removed monument (explain)
- On 9-19-1985 placed a Cast Iron Monument at the intersection  
DATE  
of a road North and South and a fence line to the West.

## SKETCH OF REFERENCE TIES

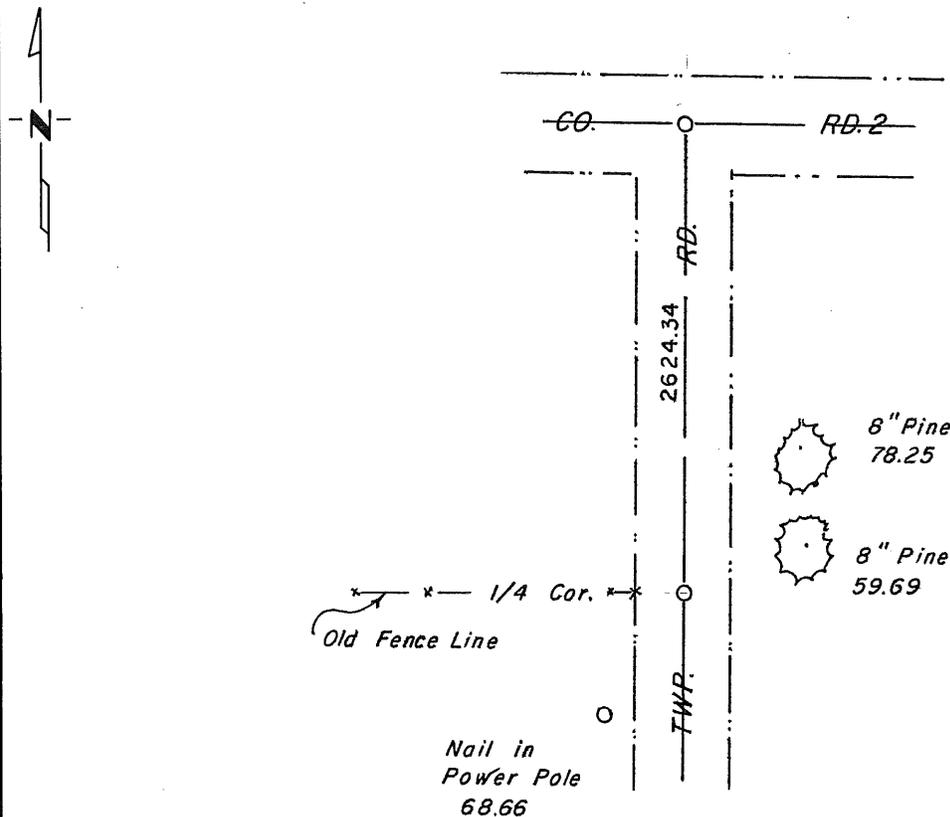

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

William J. Johnson 12/15/88  
SIGNATURE DATE

Registration No. 9394

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

OFFICE OF THE REGISTER OF DEEDS  
County of \_\_\_\_\_

I hereby certify that this document was filed in the Reg. of Deeds office at \_\_\_\_\_ .M. on the \_\_\_\_\_ day of \_\_\_\_\_ A.D., 19 \_\_\_\_\_

Register of Deeds \_\_\_\_\_

By \_\_\_\_\_, Deputy

DOCUMENT NO. \_\_\_\_\_

Statement of Evidence:

9-25-1978 Set 3/4" iron pipe at the intersection of a township road (north-south) and a fence line to the west.

9-19-1985 Found 3/4" iron pipe set in 1978 and replaced with a C.I.M.

191264

OFFICE OF  
BENTON COUNTY RECORDER  
BENTON COUNTY, MN  
CERTIFIED TO BE FILED  
AND/OR RECORDED ON

JAN 12 12 08 PM '89

ALICE C. ENGELMEYER  
COUNTY RECORDER

BY *[Signature]* DEPUTY