

MARILYN J. NOVAK
COUNTY RECORDER
BY CK DEPUTY

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

293727

2002 DEC 31 P 3:56

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


North Quarter Corner of Section 33, Township 38, Range 31
4TH Principal Meridian, State of Minnesota, County of BENTON

At the corner location shown on the sketch:

On 07/19/01 found a cast iron monument
DATE

left monument as found lowered monument removed monument (explain)

On 11/15/2002 placed a PK at the location of the cast iron monument
DATE

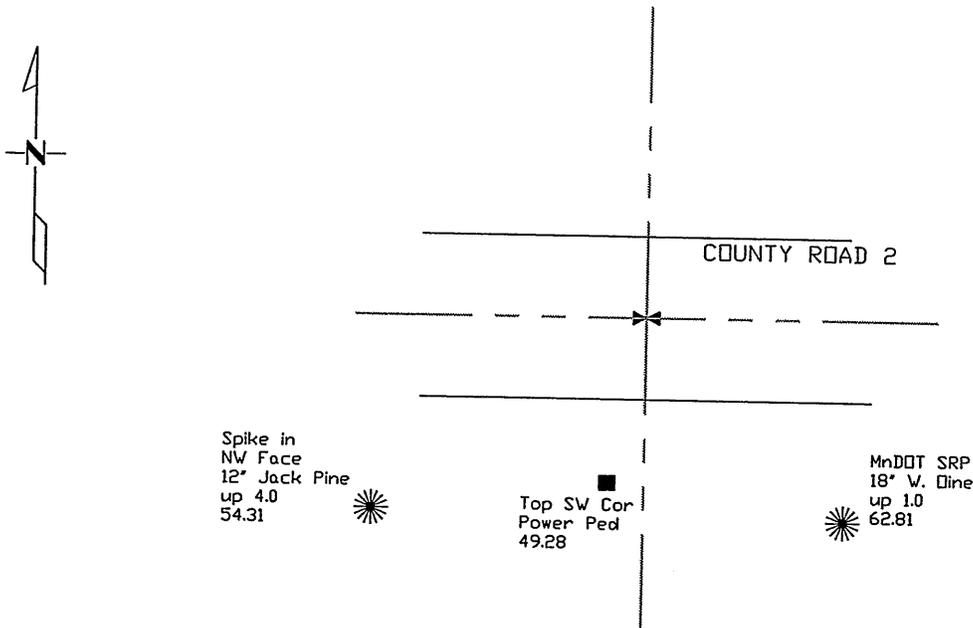

New tree and power pole ties are to the head of a nail with a brass disk marked "Corner Tie".

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Signature] Date 11/27/02 License No. 12684

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

D331

The North Quarter Corner of Section 33, Township 38 North, Range 31 West, East Langola Township, 4th Principal Meridian, Benton County, Minnesota.

In June 1852, Edwin James Jr. set a wood post in a mound at this location.

This corner is noted on the following recorded plats

<i>GEORGE ADDITION</i>	<i>1/20/1981</i>	<i>William Lunser</i>	
<i>FROMLET ADDITION</i>	<i>3/19/1990</i>	<i>David P. Regan</i>	
<i>BROCKA ADDITION</i>	<i>1/31/2000</i>	<i>David P. Regan</i>	<i>CIM</i>
<i>BROCKA FIRST ADDITION</i>	<i>1/31/2000</i>	<i>David P. Regan</i>	<i>CIM</i>

On August 25, 1972 William Lunser set a RR spike at the centerline of County Road 2 and at distances proportionate to the Benton County Highway stationing. A Certificate of Location (#133449) was filed. A distance of 2676.57 feet was measured to both the NW and NE Corners of Section 33.

On November 24, 2000 Sam Deleo found a RR spike at the corner location. He replaced the RR spike with a cast iron monument and he filed a Certificate of Location (#271526). A distance of 2676.88 feet to the NW Corner of Section 33 and a distance of 2676.52 to the NE Corner of Section 33 was recorded.

On July 19, 2001 Westwood Professional Services, Inc. found a cast iron monument at the corner location that fit with ties.

In April 2002 Westwood Professional Services, Inc. located monuments along County Road 2, prior to road construction, using GPS. Distances to quarter corners east and west checked well with Lunser's.

On November 15, 2002 Westwood Professional Services, Inc. set a PK at the location of the found cast iron monument after the road construction.

County Coordinates Obtained by GPS
NAD 83 (1996 Adjustment)
N-169620.413
E-460157.509

271526

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

JAN 30 4 04 PM '01

ALICE G. ENGELMEYER
COUNTY RECORDER

BY Mm DEPUTY xm

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 33, Township 38 N, Range 31 W
4th Principal Meridian, State of Minnesota, County of BENTON


At the corner location shown on the sketch:

On 11/10/2000 found a RAILROAD SPIKE, DOWN 0.1'
DATE

left monument as found lowered monument removed monument (explain)

On 11/24/2000 placed a STANDARD BENTON COUNTY CAST IRON MONUMENT, DOWN 0.3'
DATE

Note: Bearings to ties are approximate.

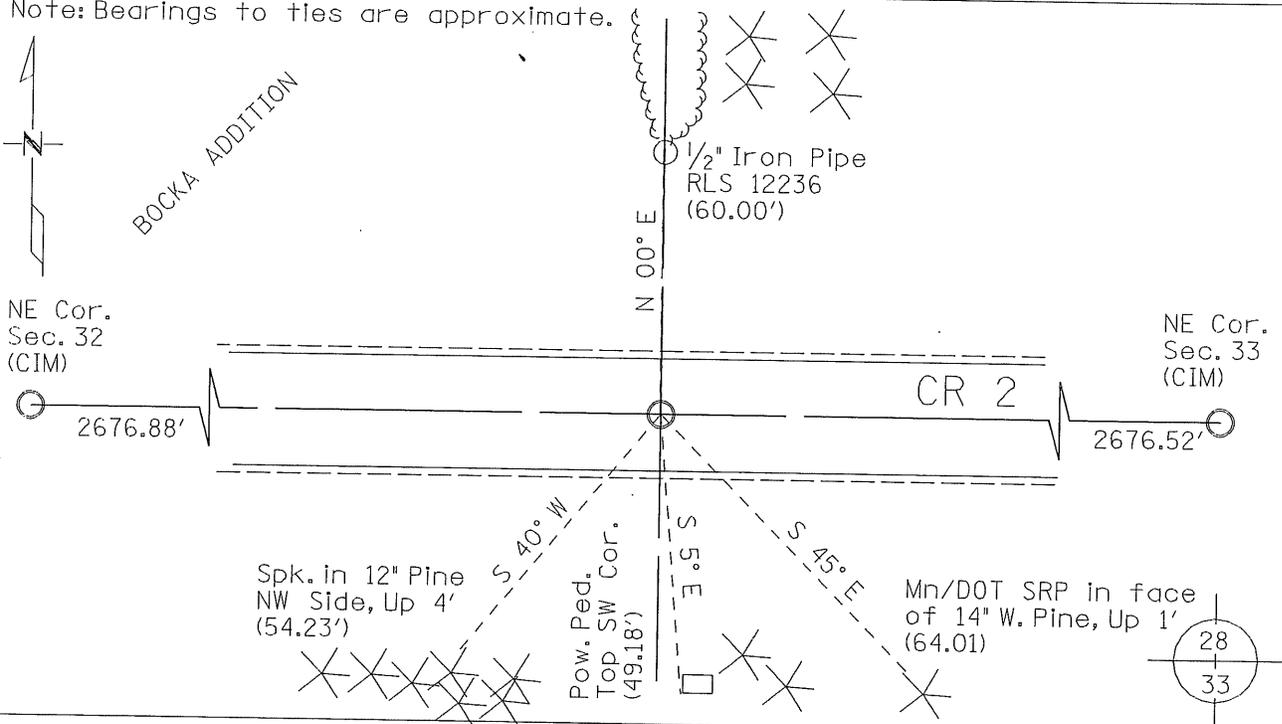

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision.

Signature Samuel J. Debo Date 1-15-2001 License No. 40341

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence

North Quarter Corner of Section 33, Twp. 38 N, Rng. 31 W
4th P.M., Benton County, Minnesota

Copies of notes from the original GLO survey, located in the office of the Benton County Highway Department, state that a wood post was set in a mound with a pit 8 links East to mark the corner, distant 40.49 chains West from the NE Cor. of Sec. 33.

August 1972; William Lunser, RLS #9394, perpetuated the location of the corner by the evidence of the centerline of Co. Rd. No.2 and distances to the east and west proportioned to Benton County highway stationing. A railroad spike was set to mark the corner. He recorded reference ties and filed a Certificate of Location of Government Corner. Refer to Document No. 133449 in the Office of the Benton County Recorder.


November 2000; Sam DeLeo, RLS #40341, found a railroad spike on centerline and in the bituminous surface of Co. Rd. #2. The railroad spike was removed and replaced with a Benton County cast iron monument. New ties were recorded and a new Certificate of Location of Government Corner was made.

Lang alk

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

I hereby certify that on the 25 day of August, 1972
I did restore the north quarter corner of Section 33,
Twp. 38, Rg. 31, Benton County, Minnesota, which
was evidenced by centerline Co. Rd. No. 2 and distances to east
and west proportioned to Benton county highway stationing.

I further certify that in order to perpetuate said corner I did
at the exact location thereof place a permanent marker consisting
of a railroad spike and that
I did establish witness or reference monuments as shown below:

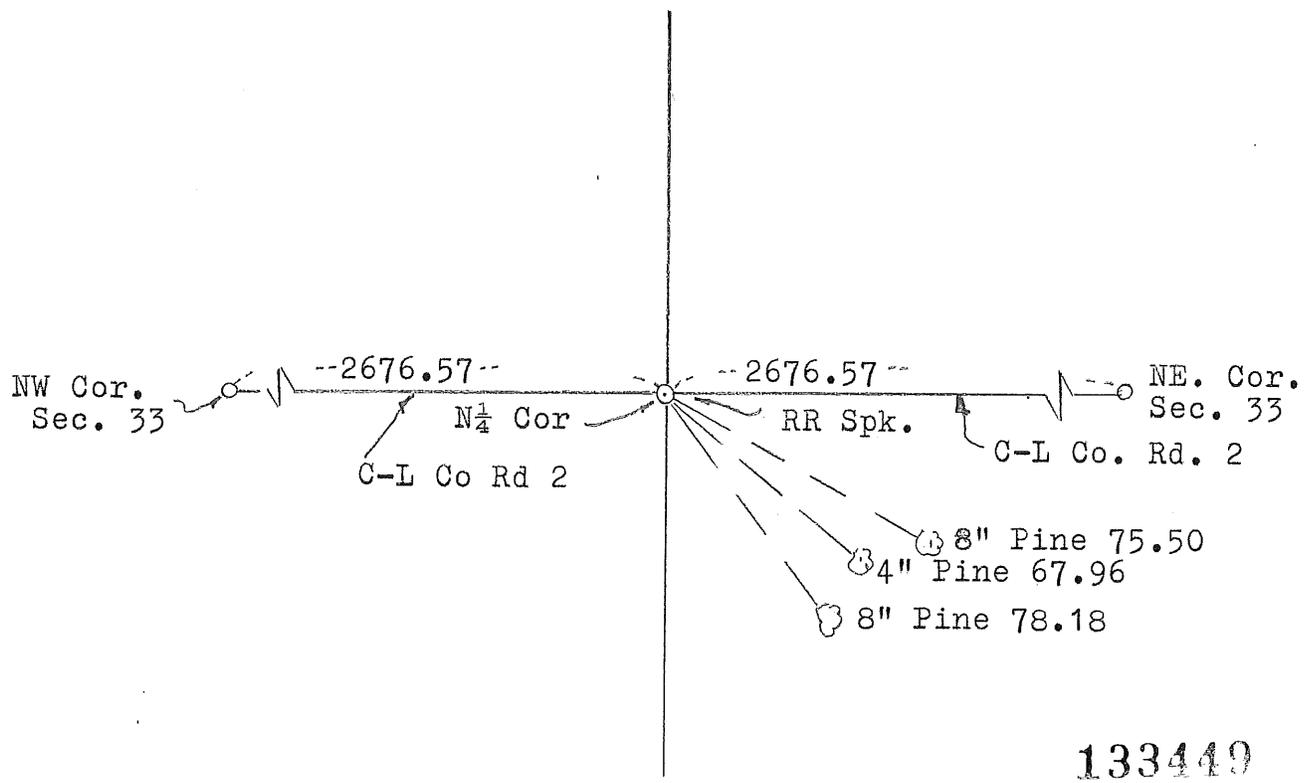

I hereby certify that the above is true and correct and that I am a registered Land Surveyor under the laws of the State of Minnesota.

William F. Jensen

Minn. Registration No. 9394

Office of the Register of Deeds,
Benton County, Minn.

I hereby certify that the within instrument was filed for record in this office on the 9th day of February, 1973.

J. A. Johnson
Register of Deeds

By *Marilyn Novak* Deputy.