

A 361592

Certified, Filed and or Recorded on
Nov. 06, 2008 AT 08:46AM

Signed: CK
MARILYN J NOVAK G V J
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 11, Township 37N, Range 29W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 23 OCT 2008 found a 1/2" IRON PIPE/CAP DESTROYED

left monument as found lowered monument removed monument (explain)
 On _____ placed an _____

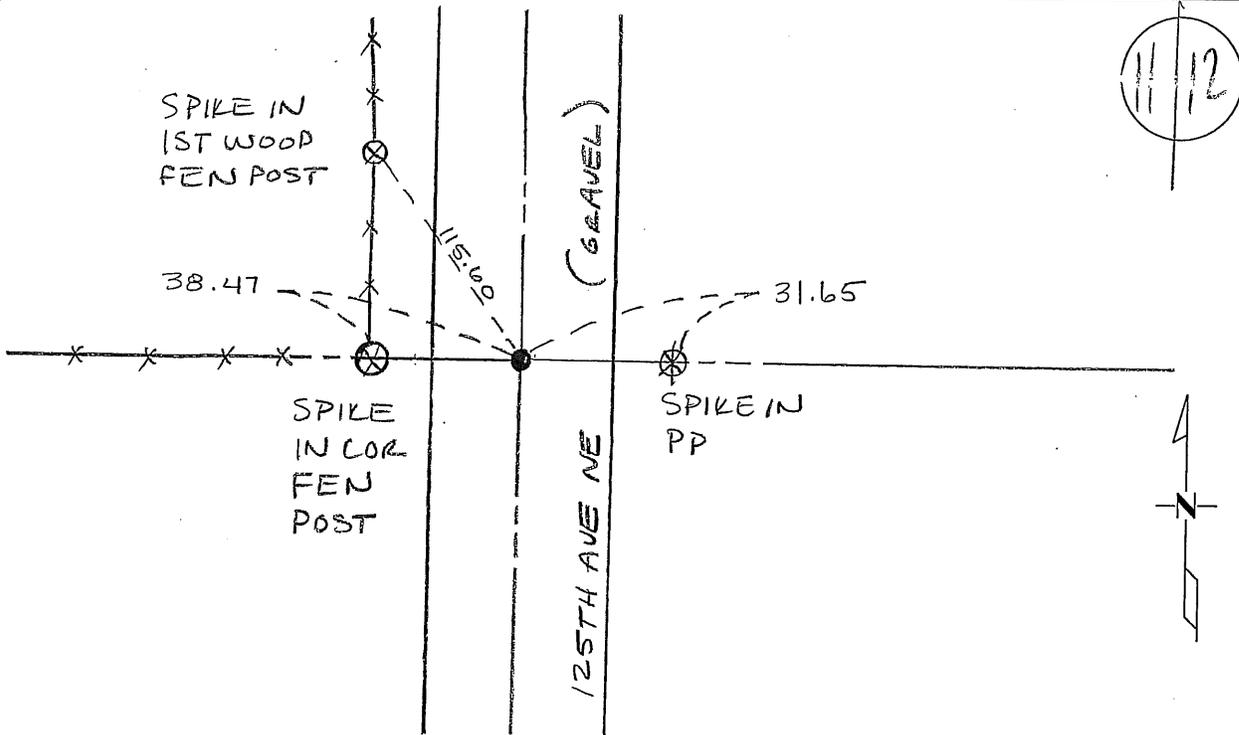

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jan W. Oke
Deputy Benton County Surveyor
License No. 45872

Date: 11/04/2008

Statement of Evidence:

H113

East Quarter Corner of Section 11, Township 37 North, Range 29 West, Gilmanton Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey established corner marked with a wood post with bearing trees noted as:

6" Tamarack	S 54 E	23 links
6" Tamarack	N 13 ½ W	11 links

2002 No resurvey information was found on this corner in the Benton County records.

2008 The County Surveyor's Office searched and found a ½" capped iron pipe at the centerline of a north-south gravel road (125th Avenue N.E.) and on line with a west fence line. Distances to the NE and SE Corners measure 2637.37 ft. and 2605.75 ft., respectively. Corner falls 5.81 ft. west of a straight line. The position fits occupation and is accepted as the best evidence. Ties were made.

County Coordinates Obtained by GPS
NAD 83 (1996 Adjustment)
N-156343.731
E-537285.822