

A 361671

Certified, Filed and or Recorded on
Nov. 07, 2008 AT 02:21PM


Signed: *MJ*
MARILYN J NOVAK *U J*
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 17, Township 37N, Range 29W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 10/29/08 found a BROKEN CAST IRON MONUMENT DOWN 0.6'
- left monument as found lowered monument removed monument (explain)
- On 10/29/08 placed an PK NAIL WITH BENTON COUNTY SURVEYOR DISK
FLUSH WITH ROAD SURFACE

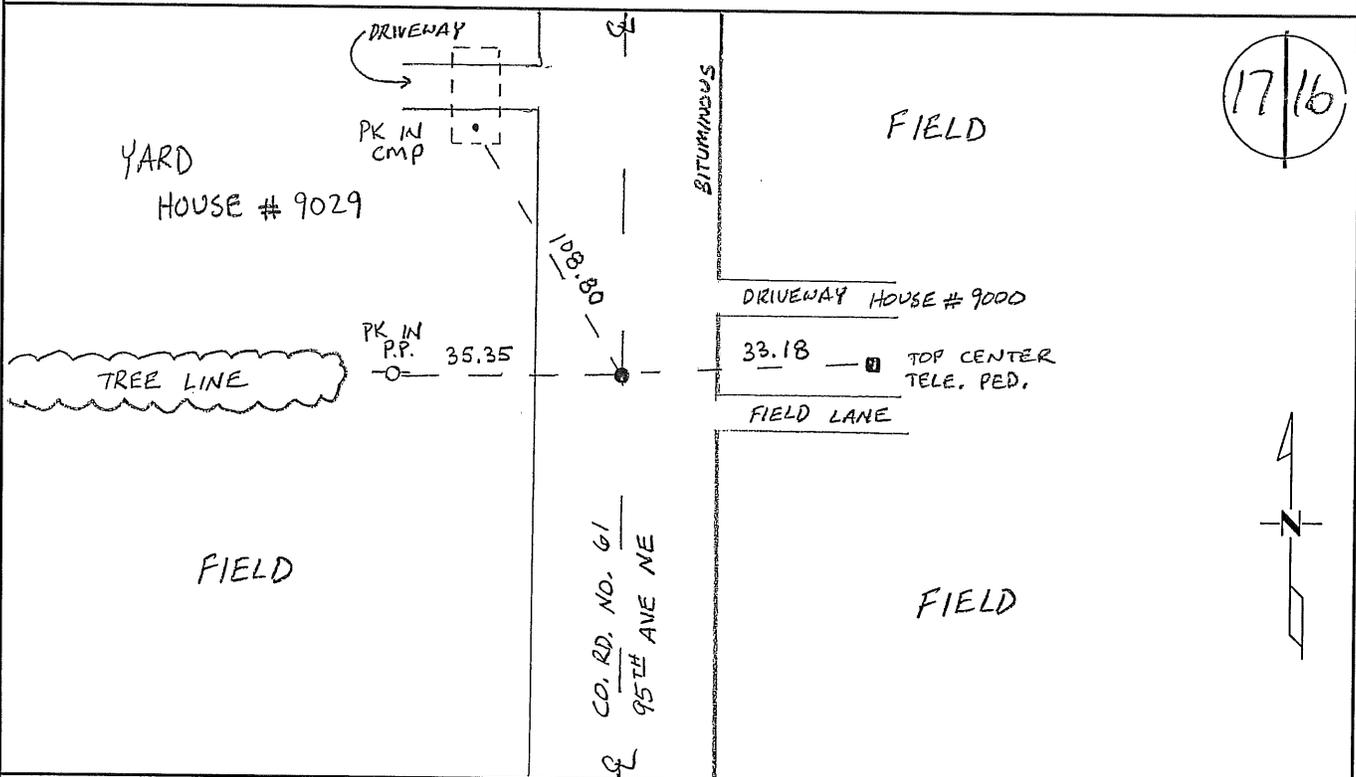

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature *Jan W. Oley*
Deputy Benton County Surveyor
License No. 45872

Date: 11/06/2008

PAGE 1 OF 2

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:**H173**

East Quarter Corner of Section 17, Township 37 North, Range 29 West, Gilmanton Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey established corner marked with a wood post with bearing trees noted as:

| | | |
|------------|----------|----------|
| 8" Blk Ash | N 38 ½ E | 14 links |
| 13" Sugar | S 58 W | 15 links |

1949 County Highway Engineer's Notebook No. 169 contains road survey for CAR 37 running from south to north on the section line. Corner is shown marked by a hub set in the center of road with fence line west. Ties are the same as listed below. Stationing gives distances of 2644.2 feet to the SE corner and 2624.9 feet to the NE corner with a delta angle of 0-31' right.

1949 County Surveyor's Record Book 1, page 493, show Elletson's ties to a hub:

| | | |
|------------|----|--------|
| 16" R. Oak | NW | 121.4' |
| 10" Maple | NW | 123.0' |

1987 Paul Wellen, LS 10461, found a ½ " iron pipe in centerline of road north-south and fence line west. He replaced the pipe with a cast iron monument and filed a Certificate of Location (Doc. No. 184286). His notes give measurements of 2624.11 feet to the NE corner and 2646.38 feet to the SE corner of Section 17.

2008 The County Surveyor's Office searched and found a Wellen's 1987 cast iron monument along the centerline of a north-south road (County Road 61). Position gives 2646.50 ft. to the SE Cor. and 2624.27 ft. to the NE Cor. and a deflection angle (south to north) of 0°25'51"-right, which agrees with 1949 County Highway measurements. The Surveyor accepts the position as marking the best evidence and updated ties.

County Coordinates Obtained by GPS

NAD 83 (1996 Adjustment)

N-150981.822

E-521420.618


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 17, Township 37, Range 29, 4th P.M.
STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On 4-14-87 found a 1/2 inch iron pipe in Center Line of County Road 61
DATE
opposite fence line to West
 left monument as found, lowered monument, removed monument (explain)
- On 6-8-87 placed a Cast Iron Monument
DATE

SKETCH OF REFERENCE TIES

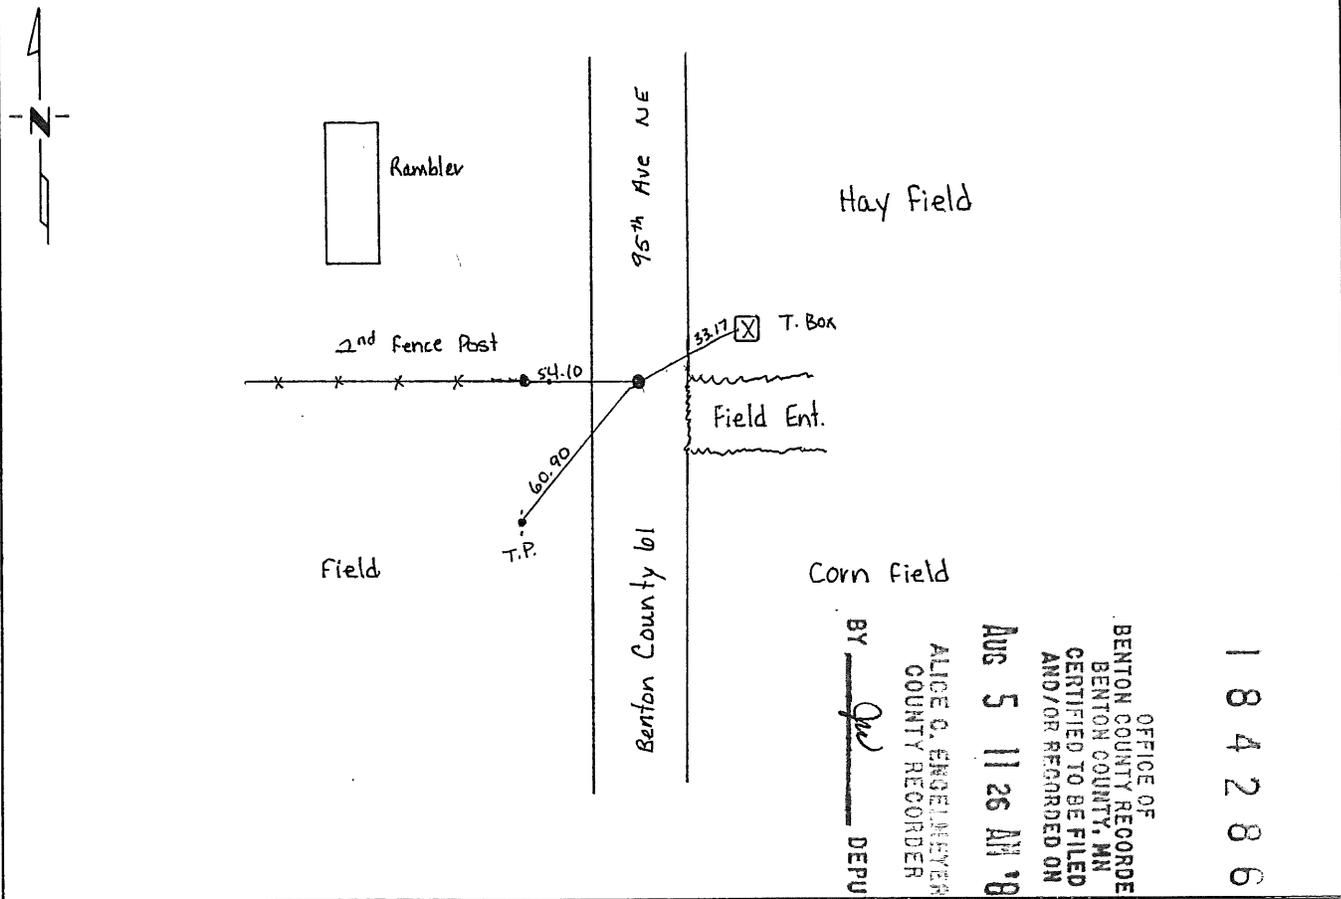

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

David J. Allen SIGNATURE 6-29-87 DATE

Registration No. 10461

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ M. on the _____ day of _____ A.D., 19 _____

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____