

Certified, Filed and or Recorded on
Nov. 06, 2008 AT 08:46AM

Signed: CK

MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 23, Township 37 N, Range 29 W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 23 OCT 2008 found a 1/2" PIPE CAPPED "RLS 12236"

left monument as found lowered monument removed monument (explain)

On _____ placed an _____

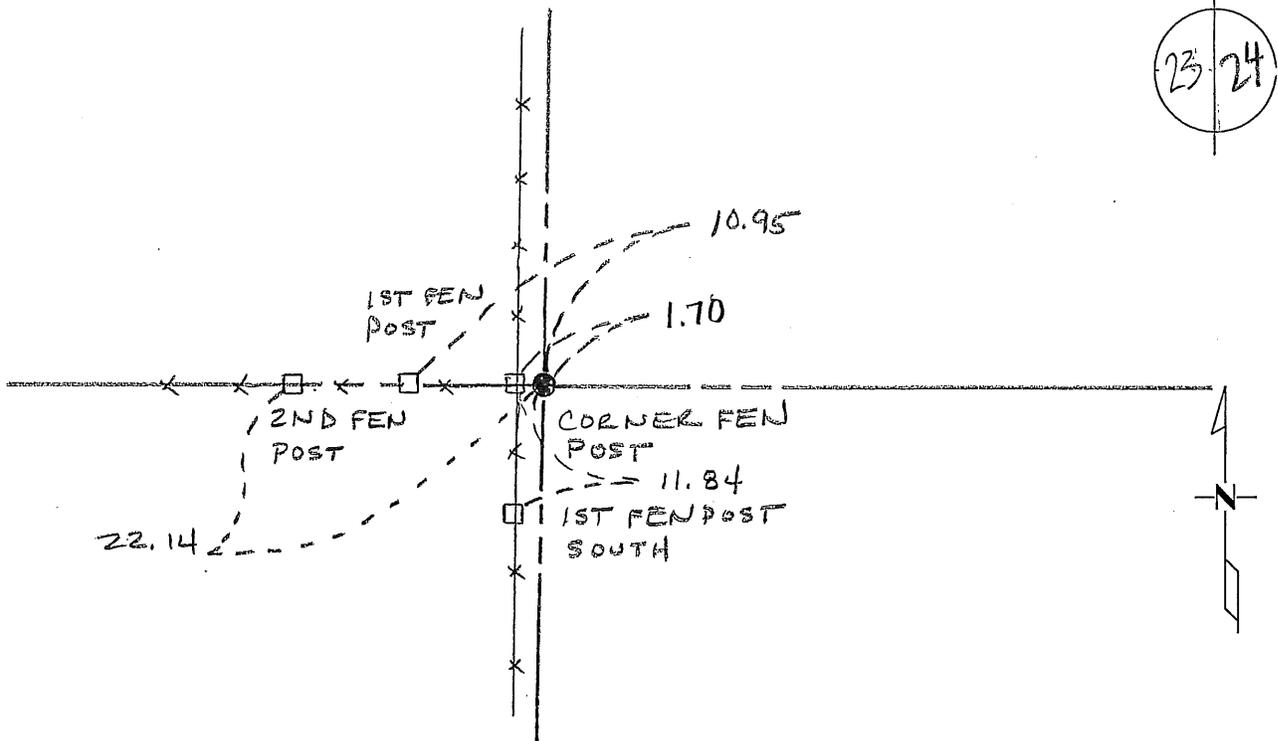

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature John W. Oly
Deputy Benton County Surveyor
License No. 45872

Date: 11/04/2008

Benton County Surveyor's Office
Jason W. Oberg, Deputy County Surveyor
Minnesota License No. 45872

Statement of Evidence:

H233

East Quarter Corner of Section 23, Township 37 North, Range 29 West, Gilmanton Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey established corner marked with a wood post with bearing trees noted as:

15" Blk Ash N 16 E 576 links

1972 County Highway: Kotsmith notes the following reference tie:

PP N 34.35

1993 David Regan, LS 12236, set a ½" I.M. at a fence line north/south and west. He filed a Certificate of Location (#231248).

2004 Westwood Professional Services, Inc. found ½ " iron pipe with cap No. 12236. Corner is 8 feet south and 7 feet west of the lost position. Accepted pipe as marking the obliterated corner position.

County Coordinates Obtained by GPS:

NAD 83 (1996 Adjustment)

N- 145660.017

E- 537232.727

2008 The County Surveyor's Office searched and found a ½" capped iron pipe (#12236) approximately 1.70± feet east of the intersection of a north-south fence line and in line with a fence line to the west. Surveyor accepts position as best evidence of the obliterated corner and updated ties. Coordinates to same obtained by GPS agree with those reported in 2004 by Westwood.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


East Quarter _____ Corner of Section 23, Township 37, Range 29, 4th P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 3/24/93 placed a 1/2" Iron monument at fence lines North-South and West.
DATE

SKETCH OF REFERENCE TIES

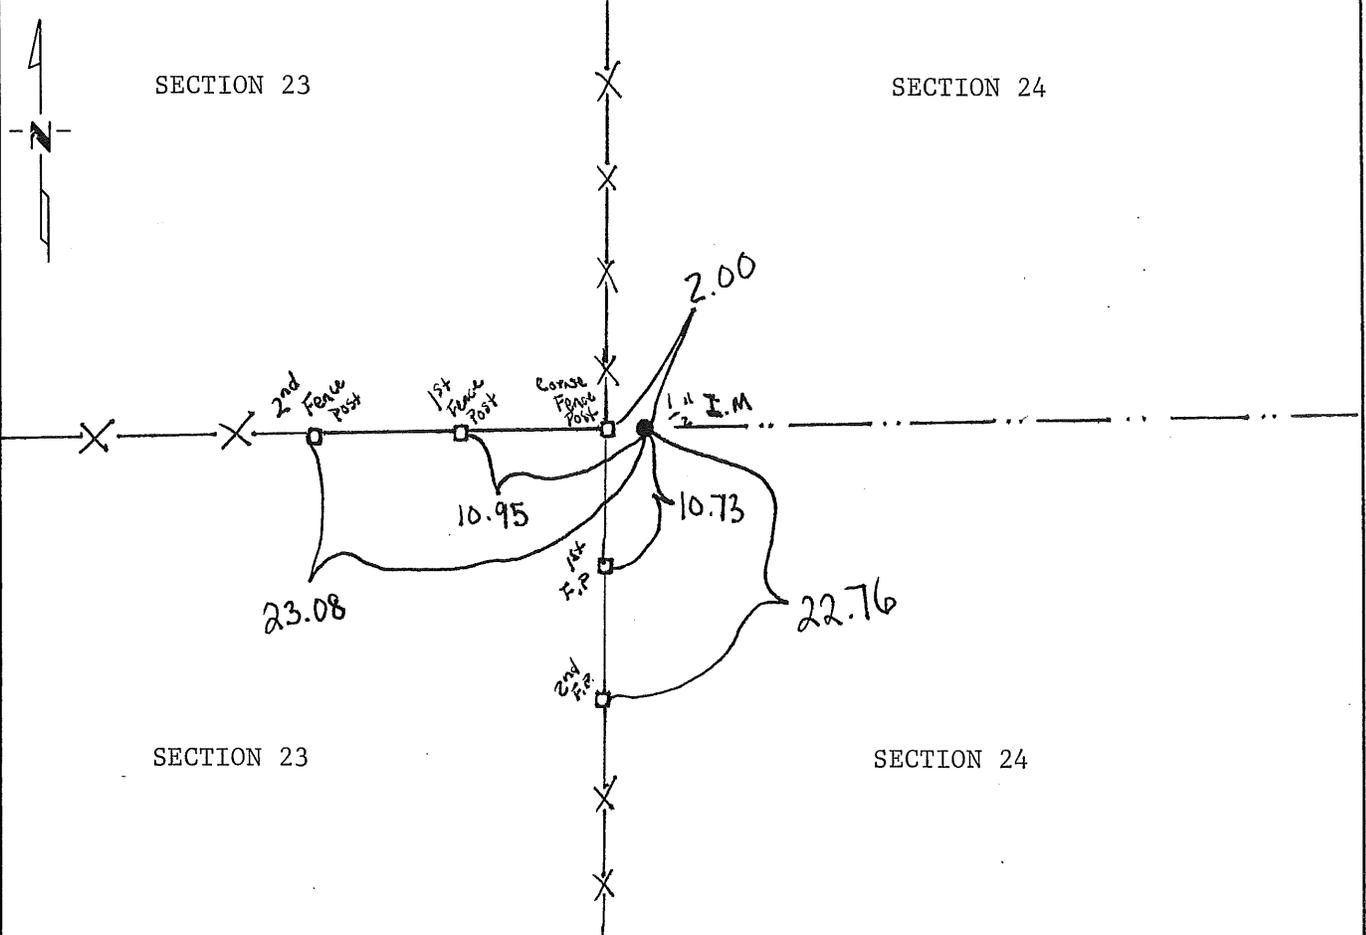

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

David C. Regan 3/27/95
SIGNATURE DATE

Registration No. 12236

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE REGISTER OF DEEDS

County of _____

I hereby certify that this document was filed in the Reg. of Deeds office at _____ .M. on the _____ day of _____ A.D., 19 _____

Register of Deeds _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence:

The G.L.O. survey was done in 1855 by Oscar Davis.

The County Surveyors records were searched with no reference to this corner.

On 3/93, Regan Land Surveyors, Inc. searched and dug the area. Then they placed a ½" iron monument on fence lines North-South and West and made ties.

231248

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND FOR RECORDED ON

OCT 20 3 02 PM '95

ALICE G. ENGELMEYER
COUNTY RECORDER

BY *Mar* DEPUTY *fm*