

Certified, Filed and or Recorded on
Nov. 07, 2008 AT 02:28PM

Signed: JU
MARILYN J NOVAK
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


NORTH QUARTER Corner of Section, 20, Township 37N, Range 29W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 10/29/08 found a CAST IRON MONUMENT FLUSH WITH ROAD SURFACE
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

F I E L D

17
20

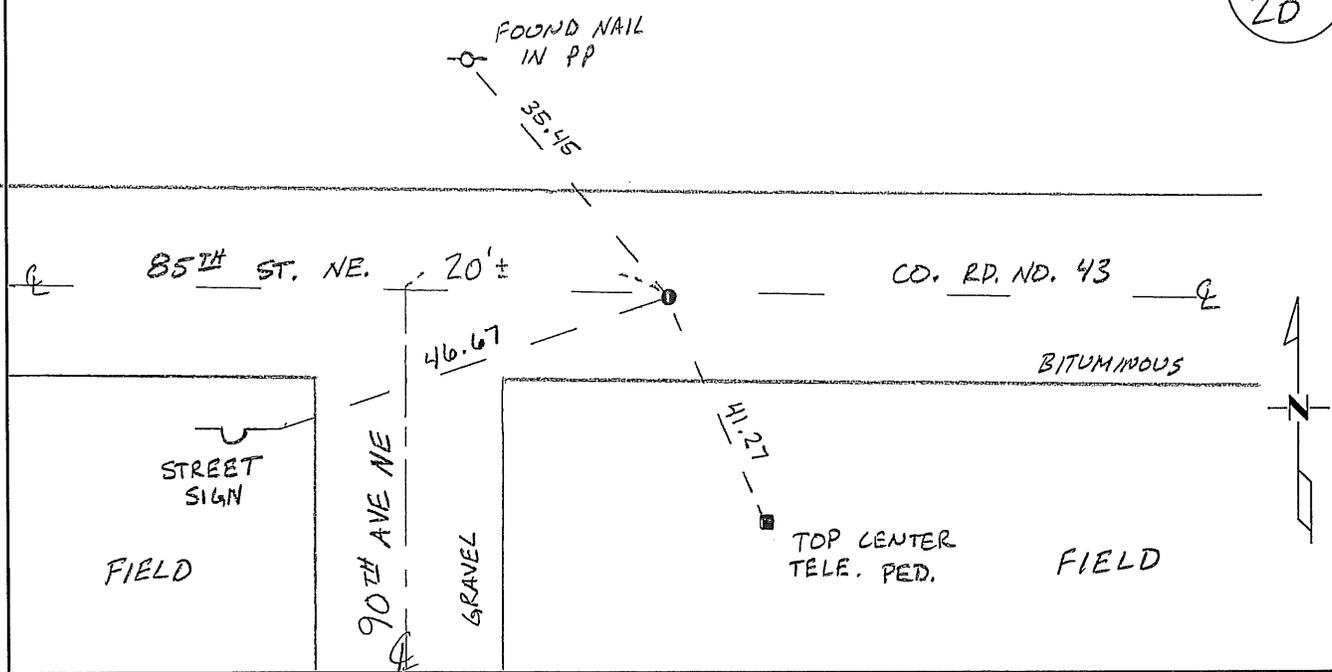

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jan W. Oly
Deputy Benton County Surveyor
License No. 45872

Date: 11/06/2008

PAGE 1 OF 2

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:

H201

North Quarter Corner of Section 20, Township 37 North, Range 29 West, Gilmanton Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey established corner marked with a wood post with bearing trees noted as:

9" Blk ?	S 21 ½ E	20 links
12" W Birch	N 27 ½ W	26 links'

A line tree was noted as a 28" Blk Oak West 8.80 chains.

1939 County Engineer's Notebook No. 158 contains road survey for CAR No. 20 running east to west along the section line. No corner is shown and stationing gives distance of 5295.2 feet for the north line of Section 20.

1987 Paul Wellen, LS 10461, found a ¾ " iron pipe in center of east-west road and in line with tree line south. He replaced the iron pipe with a cast iron monument and filed a Certificate of Location (Doc. No. 184290). His notes give distances of 2639.75 feet to the NW corner and 2652.99 feet to the NE corner.

2002 No resurvey information was found on this corner in the Benton County records.

2008 The County Surveyor's Office searched and found the cast iron monument as set by Wellen in 1987. Distances to the NW and NE Cors. measure 2639.53 ft. and 2653.00 ft. which gives an overall distance of the north line of Section 20 as 5292.53 ft, which agree with 1939 measurements and Wellens measurements. The traveled centerline of a north-south gravel road (90th Ave NE) lies 20± ft. west of the corner. The intersection of roads would yield a position that falls further from a lost position. Wellen's cast iron monument position is accepted as the best evidence and ties were updated.

County Coordinates Obtained by GPS
 NAD 83 (1996 Adjustment)
 N-148289.223
 E-518706.429

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


North Quarter Corner of Section 20, Township 37, Range 29, 4th P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On 4-14-87 found a 3/4 inch iron pipe in Center Line of County Road 43
DATE
opposite tree line to South
 - left monument as found, lowered monument, removed monument (explain)
- On 6-8-87 placed a Cast Iron Monument
DATE

SKETCH OF REFERENCE TIES

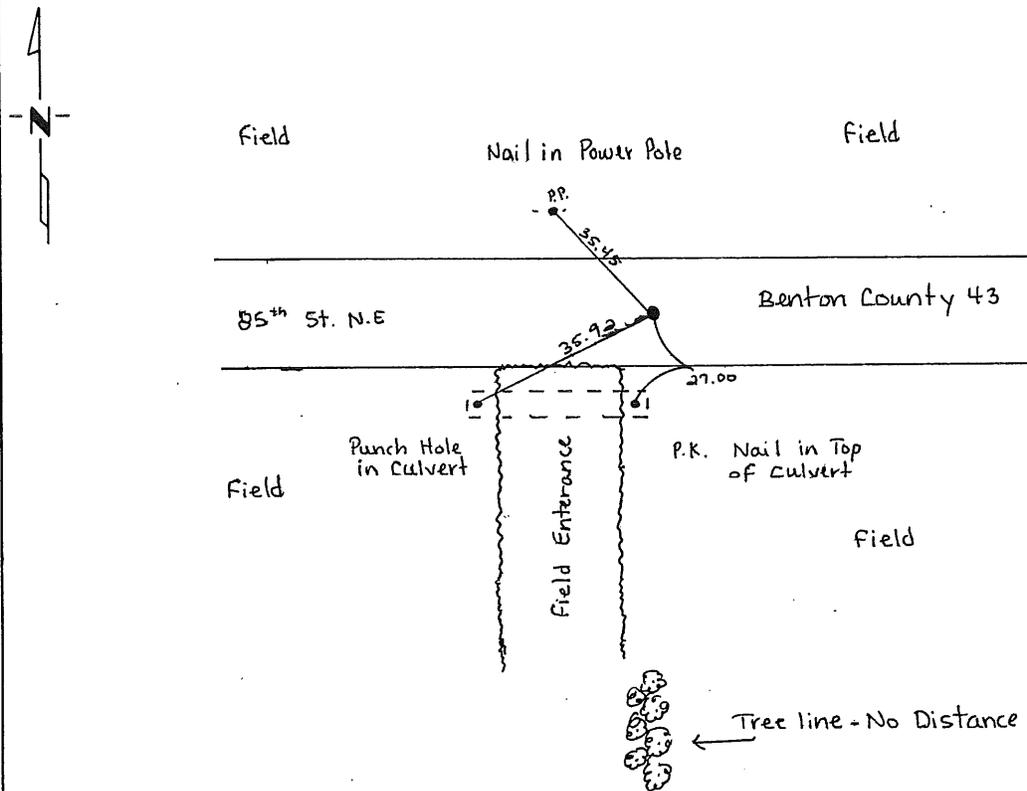

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision

Paul Miller
SIGNATURE 10461
DATE 6-29-87

- Registration No. 10461
- Land Surveyor, Professional Engineer
 - County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 _____

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence:

1 8 4 2 9 0

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

AUG 5 11 27 AM '87

ALICE G. ENGELMEYER
COUNTY RECORDER

BY *ju* DEPUTY