

Certified, Filed and or Recorded on
Oct. 07, 2008 AT 02:47PM


Signed: BW
MARILYN J NOVAK 6 V 1
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 12, Township 36N, Range 28W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 09/30/08 found a CAST IRON MONUMENT
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

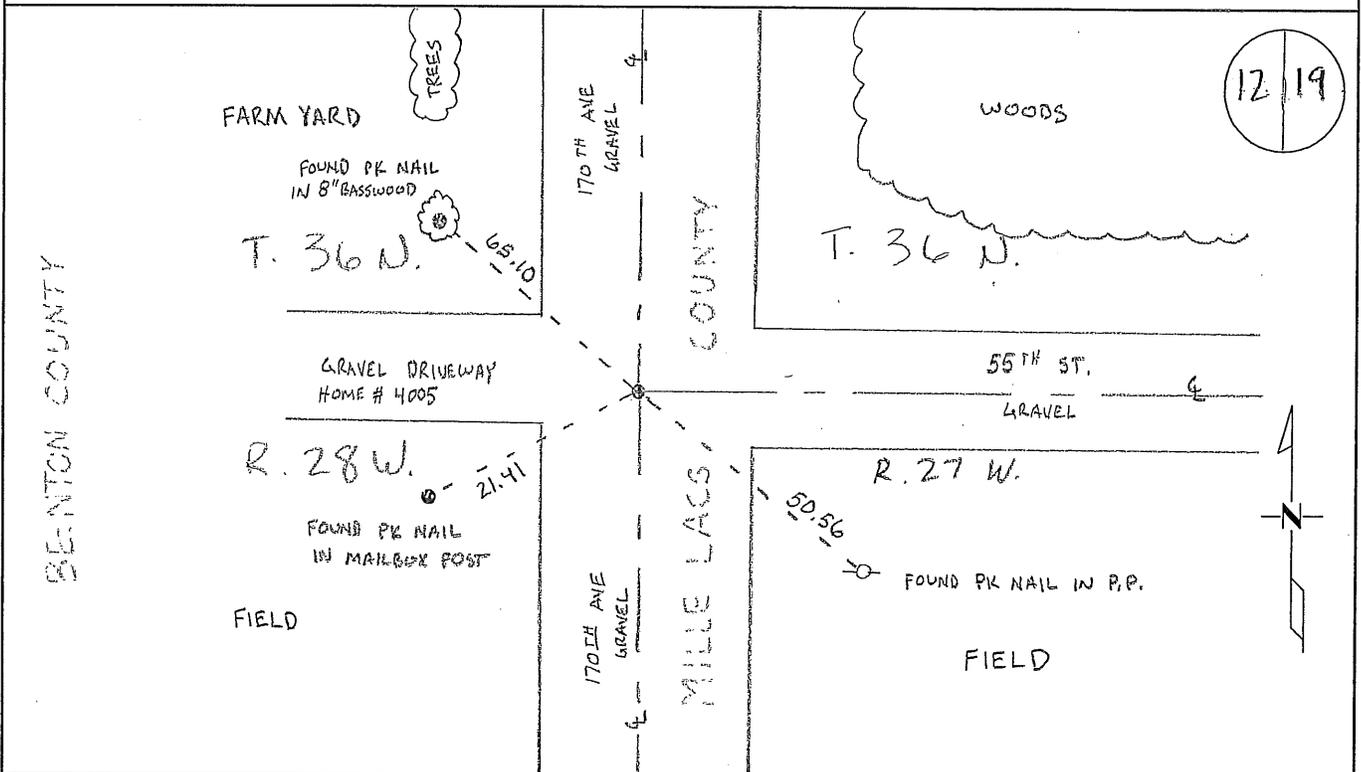

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jan W. Oley
Deputy Benton County Surveyor
License No. 45872

Date: 10/06/08

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:**J123**

East Quarter Corner of Section 12, Township 36 North, Range 28 West, Glendorado Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

12" Elm	S 47 1/2 E	25 links
8" Maple	N 16 W	19 links

A line tree was noted as a 6" Tamarack South 18.33 chains.

1996 County Coordinates from John Oliver & Associates by traverse:
 NAD 83 (1986 Adjustment)

N- 124576.677

E- 574130.801

Information shows corner assumed on a straight line between section corners and in line with road east with distances of 2698.74 feet to the SE corner and 2706.00 feet to the approximate NE corner.

2002 No resurvey information was found on this corner in the Benton County records.

2004 10/19/04 excavated corner area with Dennis Pederson, LS 16095, Mille Lacs County Surveyor, in center of north-south road and in line with road east and tree line west. Hole excavated with backhoe was approximately 12 feet east-west and 25 feet north-south. No evidence of a corner marker was found. Measured 2705 feet to the NE corner and 2685 feet to the SE corner from the center of road intersection.

2008 The County Surveyor's Office searched and found a cast iron monument at the centerline of north-south and east-west roads. Existing ties were found and used for tie sheet. In light of results from the 2004 excavation by the Mille Lacs County Surveyor, the cast iron monument is accepted as the best evidence.

Benton County Coordinates obtained by GPS

NAD 83 (1996 Adjustment)

N- 124562.893

E- 574134.082