

Certified, Filed and or Recorded on  
Nov. 06, 2008 AT 08:48AM


Signed: CK  
MARILYN J NOVAK G V T  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 35, Township 38N, Range 28W  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 10/16/08 found a 1/2" IRON PIPE OPEN FLUSH TO BIT
- left monument as found       lowered monument       removed monument (explain)
- On \_\_\_\_\_ placed an \_\_\_\_\_

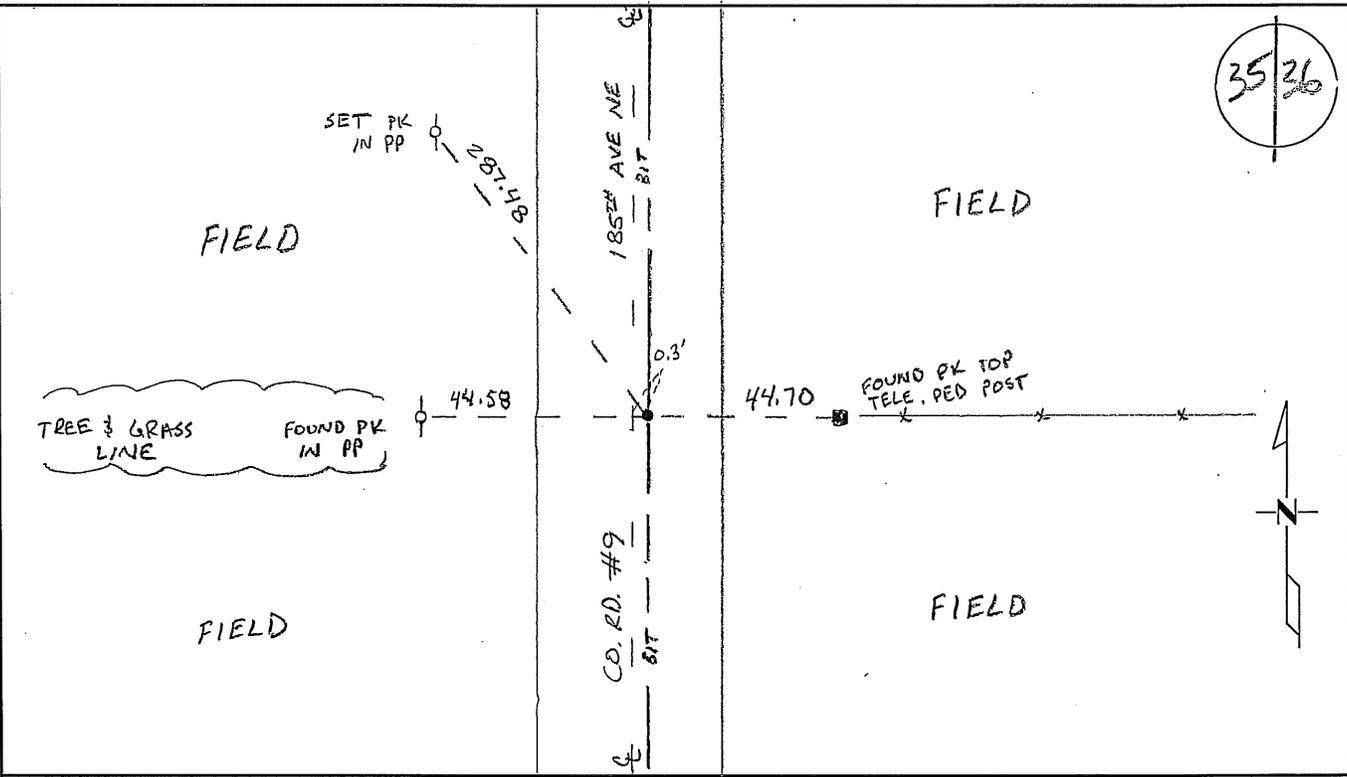

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jan W. Oly  
Deputy Benton County Surveyor  
License No. 45872

Date: 11/03/2008

Benton County Surveyor's Office  
 Jason W. Oberg, Deputy County Surveyor  
 Minnesota License No. 45872

**Statement of Evidence:****A353**

East Quarter Corner of Section 35, Township 38 North, Range 28 West, Granite Ledge Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

- 1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.
- |               |        |          |
|---------------|--------|----------|
| 10" W. Walnut | N 21 E | 9 links  |
| 10" Bur Oak   | N 63 W | 62 links |
- 1937 County Engineer's Notebook No. 82 contains a road survey for SAR No. 9 running south to north. Notes show no corner found, but notes east-west fence line at 2640 north of the SE corner.
- 1962 County Engineer's Notebook No. 269 contains a road survey for CSAH No. 9 running south to north. Notes show a spike set for POT in center of road with fence west. Ties:
- |    |    |        |
|----|----|--------|
| PP | W  | 34.7'  |
| TP | SE | 33.05' |
- Stationing gives distances of 2636.8 feet to the SE corner and 2641.5 feet to the NE corner.
- 2003 Located approximate corner position in center of north-south road and fence line east and field line west. This position is 2.5 feet south of the lost position measuring 5279.98 feet between section corners. Corner should be set lost.  
 County Coordinates to Lost Position  
 NAD 83 (1996 Adjustment)  
 N- 166993.037  
 E- 568222.153
- 2008 The County Surveyor's Office searched and found a 1/2" iron pipe flush with the bituminous north-south road (County Road 9), at a lost position. Position agrees with a fenceline to the east and a tree line to the west and is accepted as the best evidence. Coordinates obtained by GPS agree with those reported in 2003, above.