

Certified, Filed and or Recorded on  
JAN. 25, 2011 AT 01:22PM


Signed: BW  
MARILYN J NOVAK G V I  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 12, Township 37 N, Range 30 W  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 09/07/2010 found a CAST IRON MONUMENT DOWN 0<sup>ft</sup> BELOW GRAVEL SURFACE
- left monument as found       lowered monument       removed monument (explain)
- On \_\_\_\_\_ placed an \_\_\_\_\_

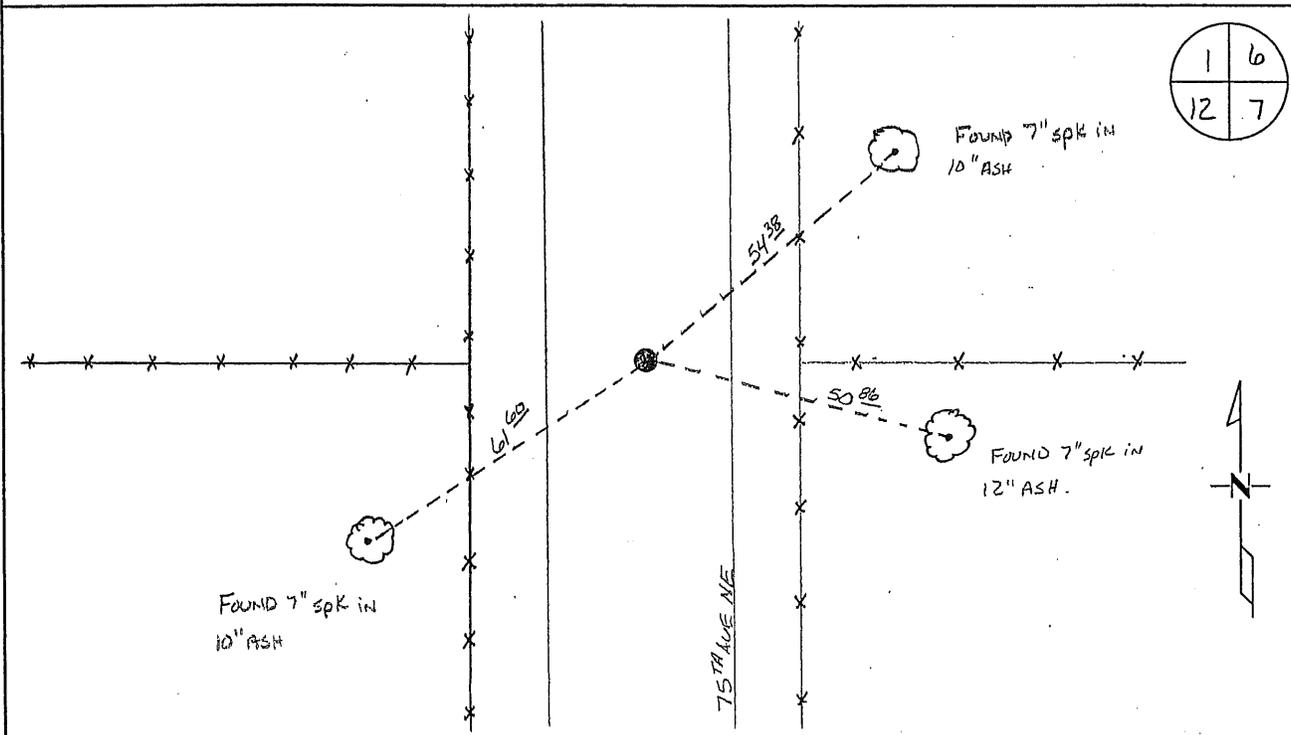

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wittstock  
Benton County Surveyor  
License No. 19552

Date: 1/20/2011

Benton County Surveyor's Office  
 Jerome C. Wittstock, County Surveyor  
 Minnesota License No. 19552

**Statement of Evidence:****G122**

Northeast Corner of Section 12, Township 37 North, Range 30 West, Mayhew Lake Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1849 Corner established by Original US General Land Office survey and marked by a wood post with bearing trees noted as.

8" Poplar	N 25 E	11 links
6" Blk Ash	N 29 W	22 links
8" Poplar	S 43 E	12 links
6" W Oak	S 53 W	46 links

Line trees were noted as a 8" Poplar, South, 19.00 chains and a 8" W Oak, North, 18.38 chains.

1978 Paul Wellen, LS 10461, found a 1/2" pipe on the centerline of road north/south and a fence line east. He filed a Certificate of Location (#151858).

1991 William Lunser, LS 9394, notes a distance of 2716.14 feet to the East ¼ corner Sec 1 per Doc. No. 234186 and a distance of 2646.47 feet to the North ¼ corner Sec 12 per Doc. No. 234190.

2002 No resurvey information was found on this corner in the Benton County records.

2007 The Benton County Surveyor's Office found a cast iron monument in the north-south centerline on fences east and west.

Coordinates Obtained by GPS  
 NAD 83 (1996 Adjustment)  
 N-158871.019  
 E-510963.279

2010 The Benton County Surveyor's Office found the cast iron monument (CIM) in the north-south centerline of 75th Avenue NE on fences east and west. The CIM measures 2716.03 feet north to a CIM at the east quarter of Section 1 and 2697.61 feet south to a 1/2-inch iron pipe at the east quarter of Section 12. The CIM is accepted as the best available evidence of the corner position. The 2007 coordinates were verified and references ties were established as shown.

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

N. E. \_\_\_\_\_ Corner of Section 12, Township 37, Range 30, \_\_\_\_\_ P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

On \_\_\_\_\_ found a \_\_\_\_\_  
DATE

left monument as found,  lowered monument,  removed monument (explain)

On \_\_\_\_\_ placed a \_\_\_\_\_  
DATE

## SKETCH OF REFERENCE TIES



Filed under N. W. Corner Section 7, T 37 R 29

Certificate # 151858

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

\_\_\_\_\_  
SIGNATURE DATE

Registration No. \_\_\_\_\_

- Land Surveyor,  Professional Engineer
- County Surveyor,  County Engineer

### OFFICE OF THE REGISTER OF DEEDS

County of \_\_\_\_\_

I hereby certify that this document was filed in the Reg. of Deeds office at \_\_\_\_\_ .M. on the \_\_\_\_\_ day of \_\_\_\_\_ A.D., 19 \_\_\_\_

Register of Deeds \_\_\_\_\_

By \_\_\_\_\_, Deputy

DOCUMENT NO. \_\_\_\_\_