

Certified, Filed and or Recorded on
Nov. 05, 2008 AT 08:40AM


Signed: M
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 13, Township 37N, Range 28N
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 21 OCT 2008 found a 3/4" OPEN IRON PIPE (DOWN 0.4')
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

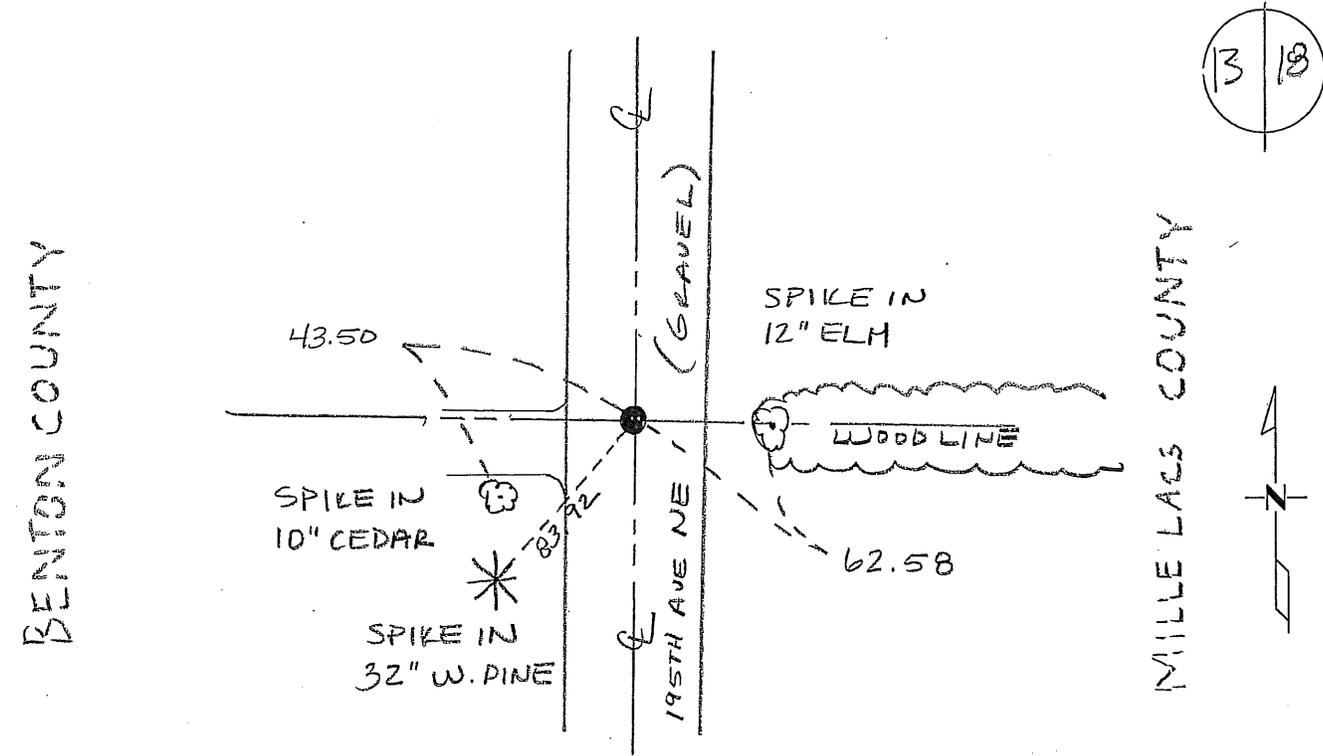

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jason W. O'Leary
Deputy Benton County Surveyor
License No. 45872

Date: 11/04/2008

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:

I133

East Quarter Corner of Section 13, Township 37 North, Range 28 West, Maywood Township, 4th Principal Meridian, Benton County, Minnesota.

1849 Original US General Land Office surveyor, Theodore Conkey, set a wood post at this location and bearing trees were recorded.

8" Maple	S 16 W	49 links
10" Basswood	N 38 E	39 links

Line trees were noted as a 10" Basswood South 19.51 chains and a 30" Pine North 23.15 chains.

1995 John Oliver, LS 8194, Mille Lacs County Surveyor, set corner lost and filed Certificate of Location (No. 244626). Corner falls in center of north-south road. (See cert for details.) Corner monument set was a ¾" iron pipe. Note: Distances from John Oliver & Associates give 2634.89 feet to the section corners.

County Coordinates from John Oliver & Associates traverse
 NAD 83 (1986 Adjustment)
 N- 151283.375
 E- 573688.281

2002 No resurvey information was found on this corner in the Benton County records.

2003 Survey & Engineering Professionals, Inc. (Linda Brown, LS 23682) found iron pipe and coordinates determined from their traverse information.

County Coordinates by Traverse (SEPI)
 NAD 83 (1996 Adjustment)
 N- 151283.445
 E- 573687.888

2008 The County Surveyor's Office searched and found a ¾" iron pipe approximately 0.4' below the surface of the centerline of the north-south gravel road (195th Avenue N.E.). Position distance to the SE Cor. gives 2634.52 feet which agrees well with 1995 distance of 2634.89 feet reported by Oliver. Surveyor accepts the position as the best evidence and updated ties.

County Coordinates by GPS to ¾" iron pipe
 NAD 83 (1996 Adjustment)
 N- 151283.286
 E- 573688.243

STATEMENT OF EVIDENCE

East Quarter Corner of Section 13, T. 37, R. 28, Benton Co., MN.

West Quarter Corner of Section 18, T. 37, R. 27, Mille Lacs Co., MN.

The line between Ranges 27 & 28, T. 37, was run by Dep. Surveyor Theo. Conkey in Oct. 1849. We were unable to find any remnants of his* monument or accessories for this corner.

*Please see the Certificate Of Location for the NE corner of Section 1, T. 37, R. 28, Benton County; also being the NW corner of Sec. 6, T. 37, R. 27, Mille Lacs County; for a "discussion" regarding general conditions (including GLO resurveys and "Judicial Roads") affecting the locations of the corners along this County line.

In 1994 we were hired by Benton Co. to restore certain corners along their east Co. line. Old survey notes, subsequent to the GLO notes, from both counties, if any, are as follows (in chronological order):

Benton: Requested from the Co. Hwy. Dept.. None provided other than GLO notes.

Mille Lacs: None along this line other than GLO.

We are aware of no other surveys by others other than: In 1994 Comstock & Davis, Inc., via their Little Falls office, was hired to provide Benton County with geodetic coordinates on selected corners within the County. They did this with a combination of GPS and traditional methods. The subject corner was not restored during said survey.

We did not excavate here. There are no notes indicating monumentation past GLO. Also, prior excavation along this stretch of road yielded nothing, so we feel that road construction effectively destroyed any evidence.

(Please reference the Cert's. Of Location for the NW corners of 18 and 19-37-27, Mille Lacs, and the NE corners of 13 and 24-37-28, Benton)

We restored this corner at SPM of the 2 miles between the NW 7-37-27 and the NW of 19 37-27. This falls on centerline and on wide tree lines east and west. Talked to the (90 yr. +/- old) resident who has lived just SW of here all his life who know of no old monuments but agreed with our position. There is a 30" White Pine in the SW quad. that he thought was a BT, but we have no record of that.

On 11/16/95 we placed a 3/4" by 14" iron pipe, down 0.2', and made ties as shown on the front hereof.

MLCLS: /WQ183727

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON
OCT 3 8 49 AM '97
ALICE O. ENGELMEYER
COUNTY RECORDER
BY *Alice Engelmeier* DEPUTY

244626