

Certified, Filed and or Recorded on
Dec. 16, 2008 AT 01:43PM


Signed: BW
MARILYN J NOVAK G V
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 18, Township 37N, Range 28W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 10/15/08 found a CAST IRON MONUMENT DOWN 0.3'
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

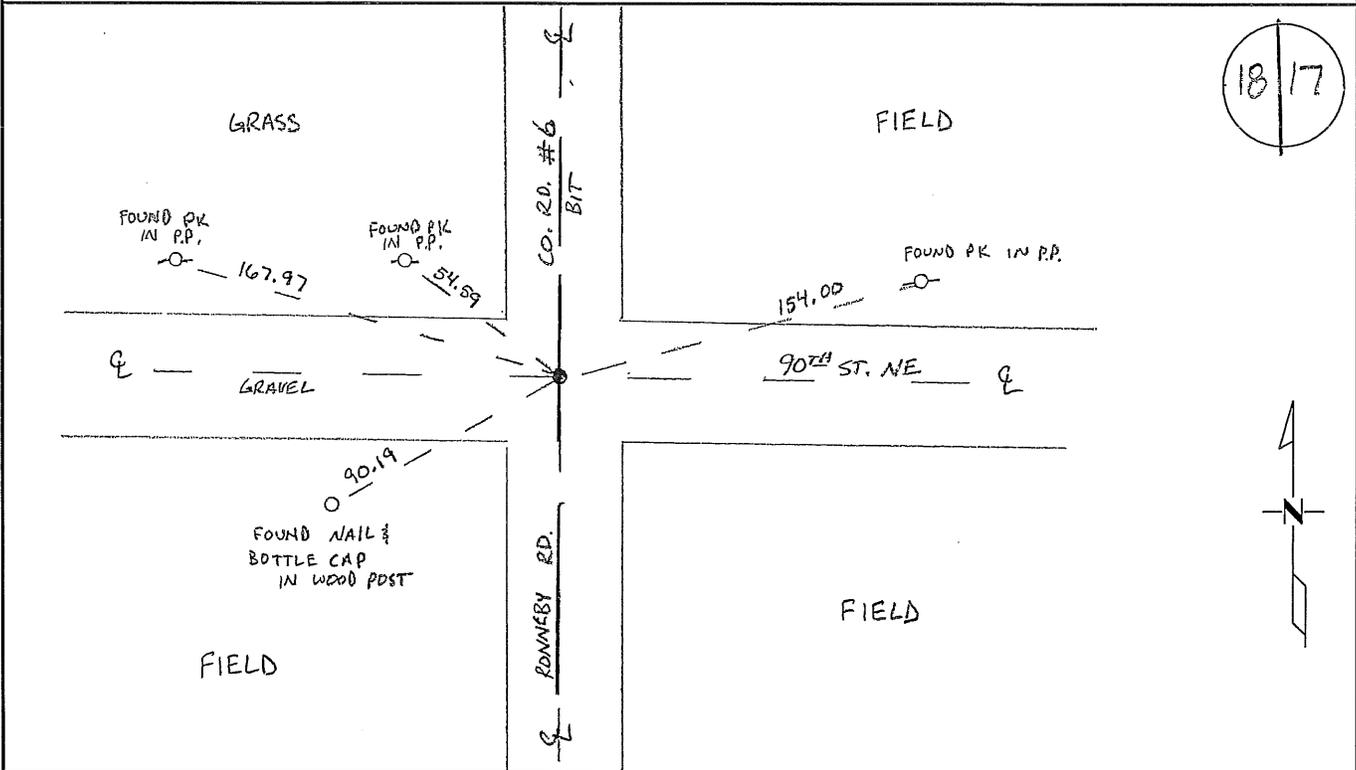

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jan W. O'Leary
Deputy Benton County Surveyor
License No. 45872

Date: 11/06/2008

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:

I183

East Quarter Corner of Section 18, Township 37 North, Range 28 West, Maywood Township, 4th Principal Meridian, Benton County, Minnesota.

- 1855 Original US General Land Office survey established this corner and set a wood post and bearing trees were recorded as follows:
- | | | |
|-------------|----------|---------|
| 22" Maple | S 68 ½ W | 6 links |
| 7" Ironwood | N 45 E | 4 links |
- 1915 County Surveyor's Record Book 2, pages 420 and 421, and Record Book A, Map No. 15, contain a survey by J. P. Soderstrum of Section 18. Notes state he found corner marked by an iron pipe set in the intersection of roads by Felix Parent. Made ties: Tele Pole NW 206 links and Tele Pole SE 60 links and Tele Pole NE 76 links. Survey shows corner 40.54 chains north of the southeast corner of Section 18.
- 1927 County Engineer's Notebook No. 80 for survey of SAR 6 running north to south. Notes show corner in road intersection. Stationing gives distances of 2657.9 feet to the NE corner. Ties:
- | | | |
|----|----|-------|
| TP | NE | 41.1' |
| TP | SE | 41.5' |
- 1944 County Engineer's Notebook No. 163 contains a road survey for SAR 6 running from south to north on section line. Corner is shown marked by an iron pipe in center of road with town road east and west. Same ties as 1927. Stationing gives distance of 2661.2 feet to the NE corner.
- 1953 County Engineer's Notebook No. 196 contains a road survey for SAR 6 running from south to north on section line. Corner is shown marked by an iron in center of road with town road east and west. Same ties as 1955 below. Stationing gives distance of 2661.2 feet to the NE corner.
- 1955 County Surveyor's Records in Book 2 on pages 420 gives ties to an iron:
- | | | |
|----|----|-------|
| TP | NE | 64.45 |
| PP | NW | 48.45 |
| TP | SW | 59.3 |
- 1979 William Lunser, LS 9394, found no monument and set ½" iron pipe from County ties in road intersection.
- 1988 William Lunser replaced iron pipe with cast iron monument and filed Certificate of Location (No. 419267). He gives distances of 2674.39 feet to SE corner of Section 18. (Compares well with Soderstrum's 40.54 chains = 2675.64 feet), 2662.72 feet to the NE corner, and 4940.07 feet to the West ¼ corner.
- 2008 The County Surveyor's Office searched and found a cast iron monument 0.3' under the intersections of east-west (90th St. NE) and north-south (County Road No. 6) roads. Old ties were not recovered. Distances to the NE Cor. and SE Cor. measured as 2662.68 ft (40.34 ch.) and 2674.47 ft. (40.52 ch.), respectively, which agree with Soderstrum's 1915 measurements, and measurements by the County Highway in 1944 and 1955. The Surveyor accepts the position as the best evidence, and updated ties.

County Coordinates obtained by GPS
 NAD 83 (1996 Adjustment)
 N-151144.714
 E-547353.700

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 18, Township 37, Range 28, 4th P.M.

STATE OF MINNESOTA, County of Benton


At the corner location shown on the sketch:

On _____ found a _____
DATE

left monument as found, lowered monument, removed monument (explain)

On 12-8-88 placed a Benton County Cast Iron Monument
DATE

SKETCH OF REFERENCE TIES

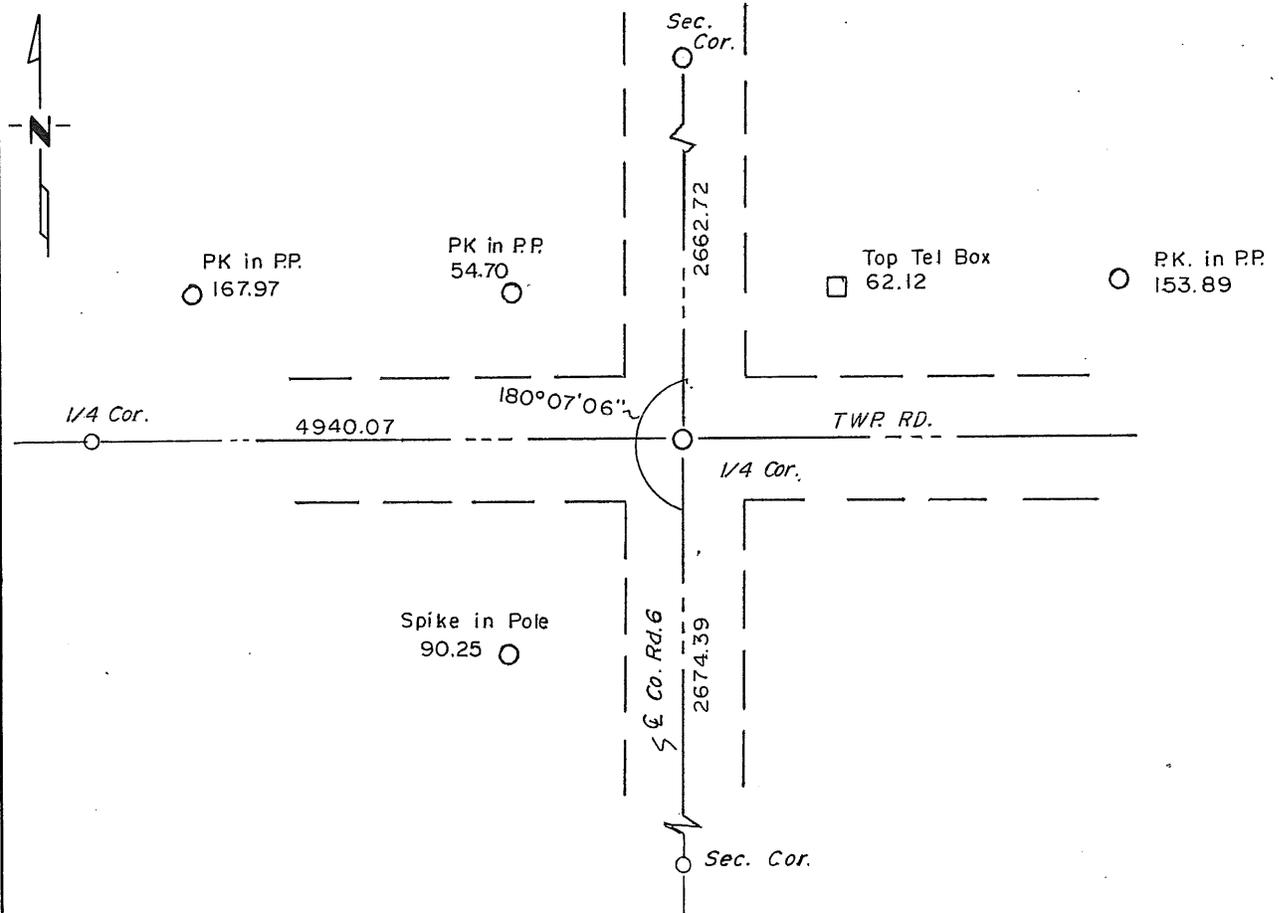

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

William J. Luman 12/15/88
SIGNATURE DATE

Registration No. 9394

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE REGISTER OF DEEDS

County of _____

I hereby certify that this document was filed in the Reg. of Deeds office at _____ .M. on the _____ day of _____ A.D., 19 _____

Register of Deeds _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence:

9-19-79 Benton County road plans showed this corner, an iron pin, to be at the intersection of two roads north-south and east-west. In searching this area, no pin was found, Reset corner per County ties. Measurements taken north, south and west verified location of the corner. Set 1/2" iron pipe. .

12-8-88 Located 1/2" iron pipe as set in 1979 and verified ties. Placed Benton County Cast Iron Monument at this location.

191267

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

JAN 12 12 09 PM '89

ALICE C. ENGELMEYER
COUNTY RECORDER

BY *Jed* DEPUTY