

Certified, Filed and or Recorded on  
Nov. 07, 2008 AT 02:19PM


Signed: JN  
MARILYN J NOVAK  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 36, Township 37N, Range 28W  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 10/30/08 found a PK NAIL DOWN 0.2'
- left monument as found       lowered monument       removed monument (explain)
- On \_\_\_\_\_ placed an \_\_\_\_\_

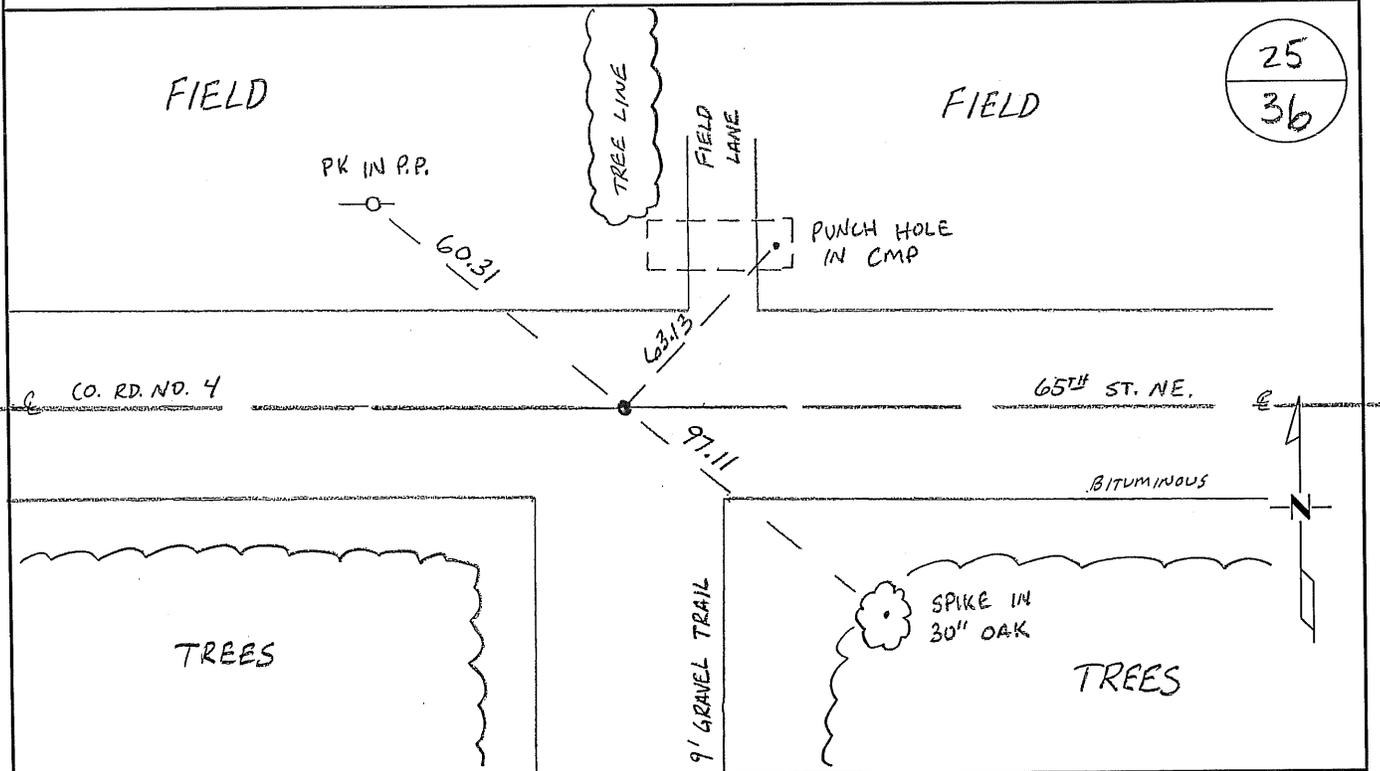

25  
36

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jan W. Oley  
Deputy Benton County Surveyor  
License No. 45872

Date: 11/06/2008  
PAGE 1 OF 2

Benton County Surveyor's Office  
 Jason W. Oberg, Deputy County Surveyor  
 Minnesota License No. 45872

**Statement of Evidence:**

I361

North Quarter Corner of Section 36, Township 37 North, Range 28 West, Maywood Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

- 1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.
- |            |          |          |
|------------|----------|----------|
| 10" W Oak  | S 30 E   | 24 links |
| 10" Linden | N 43 ½ E | 23 links |
- 1902 County Surveyor's Record Book A, Map No. 30 is a survey of Section 25 by John Whilt which shows a distance of 40.43 ½ chains (2668.71 feet) to the NE corner Sec 36 and a distance of 39.97 ½ chains (2638.35 feet) to the NW corner Sec 36.
- 1926 County Engineer's notebook No. 49 contains survey for CR 4 running west to east. Notes show corner marked by a found wooden plug in line with road south. Ties (Also listed in County Surveyor's Record Book 2, page 456):
- |        |    |      |
|--------|----|------|
| TP     | SE | 54.1 |
| Cor FP | SW | 29.0 |
- Stationing gives distances of 2652.7 feet to the NW corner and 2682.7 feet to the NE corner with a delta angle of 2-06' left.
- 1940's County Engineer's Notebook No. 160 contains road survey for SAR No. 4 running west to east along the section line. Corner is shown as a wood hub in center of road with fence north and town road south. Ties:
- |           |    |        |
|-----------|----|--------|
| 16" Maple | SE | 76.2'  |
| 12" Maple | SE | 112.5' |
- Stationing gives distances of 2652.7 feet to the NW corner and 2683.7 feet to the NE with a delta angle of 2-06' left. County Surveyor's Record Book 2, page 456, notes the same ties.
- 1993 Sidney Williamson, LS, found a ½" solid iron at the centerline of roads east/west/south. He replaced it with a cast iron monument and filed a Certificate of Location (#227418). He measured 2652.39 feet to the NW corner and 2684.37 feet to the NE corner of Section 36.
- Note: The iron found in 1993 fits within one foot of the proportion to the 1902 position and fits reasonably with the highway information.
- 2004 Found PK Nail at apparent corner and measured 2652.26 feet to the NW corner and 2684.28 feet to the NE corner with a deflection angle of 2-05'-24".  
 County Coordinates obtained by GPS to PK Nail:  
 NAD 83 (1996 Adjustment)  
 N- 137998.889  
 E- 571279.144
- 2008 The County Surveyor's Office searched and found the PK Nail as referenced in 2004, above. Position measures 2652.32 feet (40.19 ch.) to the NW corner and 2684.23 feet (40.67 ch.) to the NE corner with a deflection angle of 2-05'-41". Said measurements agree well with 1940's County Engineer's measurements. Position is accepted as the best evidence and ties were updated.

County Coordinates obtained by GPS to PK Nail:  
 NAD 83 (1996 Adjustment)  
 N- 137998.779  
 E- 571279.199

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHQUARTER Corner of Section 36, Township 37, Range 28, \_\_\_\_\_ P.M.

STATE OF MINNESOTA, County of BENTON


At the corner location shown on the sketch:

On 8-17-93 found a 1/2" SOLID IRON  
DATE

left monument as found,  lowered monument,  removed monument (explain)

On 10-1-93 placed a STANDARD CAST IRON MONUMENT  
DATE

### SKETCH OF REFERENCE TIES

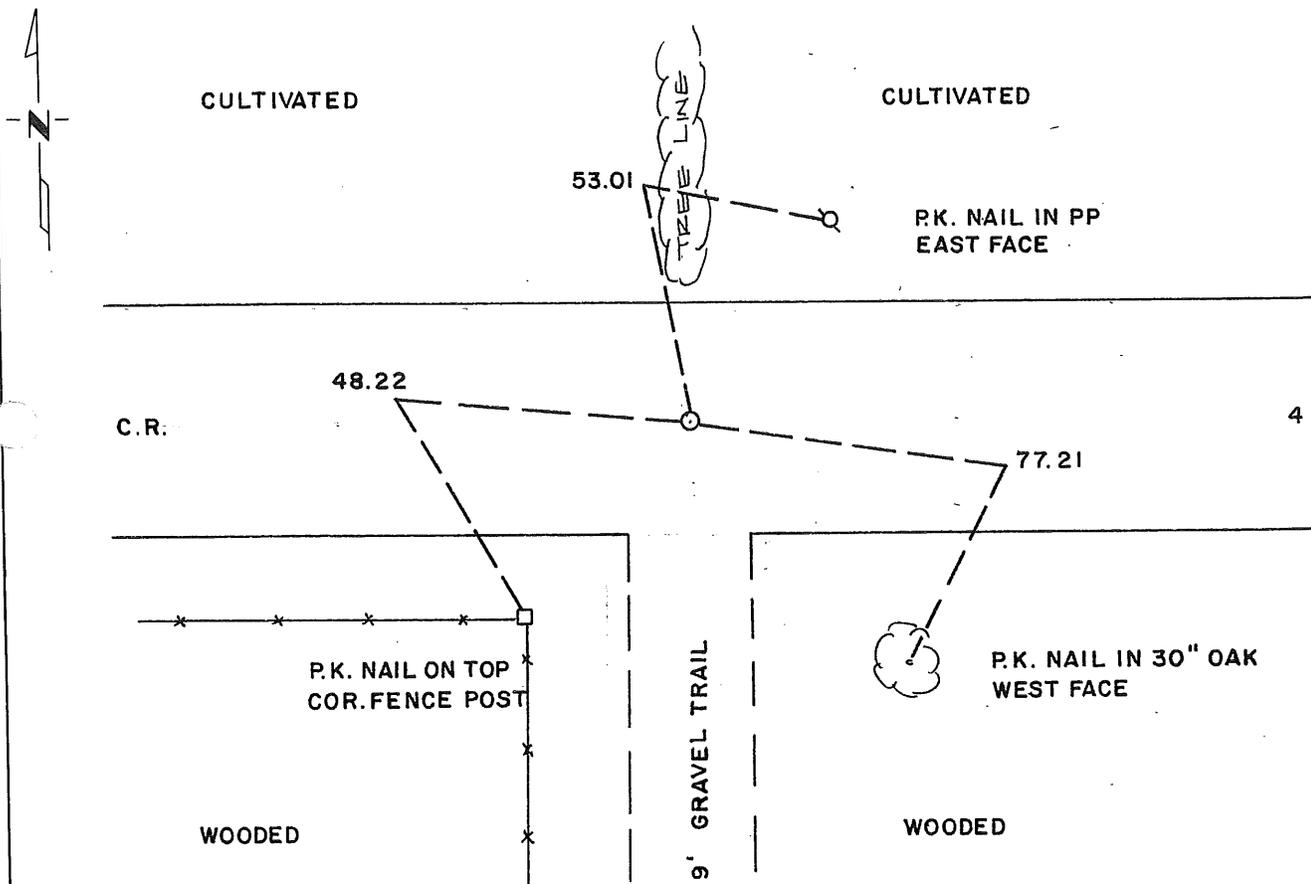

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Sidney P. Williamson 1/5/95  
SIGNATURE DATE

Registration No. 10918

Land Surveyor,  Professional Engineer  
 County Surveyor,  County Engineer

### OFFICE OF THE COUNTY RECORDER

County of \_\_\_\_\_

I hereby certify that this document was filed in the Co. Recorders office at \_\_\_\_\_ .M. on the \_\_\_\_\_ day of \_\_\_\_\_ A.D., 19 \_\_\_\_\_

County Recorder \_\_\_\_\_

By \_\_\_\_\_, Deputy

DOCUMENT NO. \_\_\_\_\_

Statement of Evidence:

1. In 1855, the original government survey was performed.
2. On August 17, 1993, Williamson-Kotsmith, Inc. found a 1/2 inch solid pin on the centerline of C.S.A.H Number 4 and the centerline of a gravel road to the south and a tree line to the north. It measures 2,652.39 feet to the northwest corner and 2,684.37 to the northeast corner.
3. On October 1, 1993, Williamson-Kotsmith, Inc. placed a Standard Cast Iron Monument at the same location.

227418

CLERK OF  
DENTON COUNTY RECORDER  
DENTON COUNTY, TX  
CERTIFIED TO BE FILED  
AND/OR RECORDED ON

MAR 3 8 42 AM '95

ALICE C. ECKHART  
COUNTY RECORDER

BY MN DEPUTY