

Certified, Filed and or Recorded on  
Nov. 06, 2008 AT 08:45AM


Signed: CL  
MARILYN J NOVAK G V  
BENTON COUNTY MINNESOTA  
MARILYN J NOVAK  
COUNTY RECORDER

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH EAST Corner of Section 25, Township 31N, Range 28W  
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 21 OCT 2008 found a 3/4" OPEN IRON PIPE DOWN 0.3'
- left monument as found       lowered monument       removed monument (explain)
- On \_\_\_\_\_ placed on \_\_\_\_\_

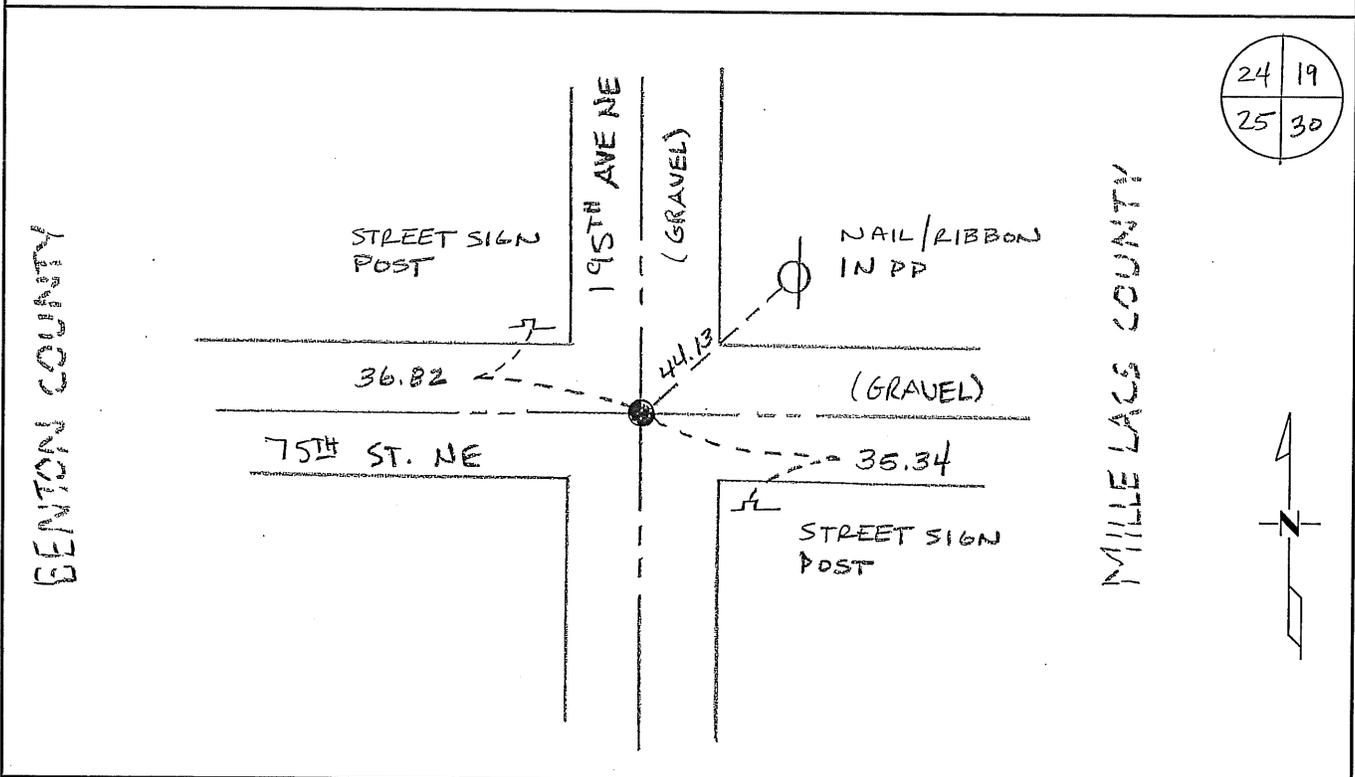

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Handwritten Signature]  
Deputy Benton County Surveyor  
License No. 45872

Date: 11/04/2008

Benton County Surveyor's Office  
 Jason W. Oberg, Deputy County Surveyor  
 Minnesota License No. 45872

Statement of Evidence:

I252

Northeast Corner of Section 25, Township 37 North, Range 28 West, Maywood Township, 4<sup>th</sup> Principal Meridian, Benton County, Minnesota.

1849 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.

10" Blk Ash	S 76 W	82 links
12" Blk Ash	N 75 W	80 links
12" Blk Ash	N 82 E	58 links
12" Blk Ash	N 72 E	50 links

1902 County Surveyor's Record Book 2, pages 432 and 434, and Record Book A, Map No. 30, shows a survey of Section 25 by John Whilt. Ties:

10" Elm	N 66 $\frac{3}{4}$ E	199 links
10 W. Elm	N 60 $\frac{3}{4}$ E	197 links

1929 County Engineer's Notebook No. 58 shows a road survey by H. G. Elletson running west to east. Corner is shown as hub set in center of road with ties:

FP	NE	27.7
FP	SE	36.3

1996 John Oliver, LS 8194, Mille Lacs County Surveyor, set  $\frac{3}{4}$ " iron pipe in intersection of north-south road east-west road and filed Certificate of Location (No. 244629).

2004 County Coordinates obtained by GPS to  $\frac{3}{4}$ " iron pipe  
 NAD 83 (1996 Adjustment)  
 N- 143380.592  
 E- 573854.880

Note: Coordinates check with information from John Oliver & Associates.

2008 The County Surveyor's Office searched and found a  $\frac{3}{4}$ " iron pipe approximately 0.3' below the surface at the intersection of an east-west gravel road (75<sup>th</sup> Street N.E.) and north-south gravel road (195<sup>th</sup> Avenue N.E.). Position gives a distance to the E  $\frac{1}{4}$  Cor. as 2640.48 feet which agrees with the same distance reported by Oliver in 1996. Surveyor accepts the position as the best evidence and updated ties. Coordinates from 2004 were verified.



# STATEMENT OF EVIDENCE

## STATEMENT OF EVIDENCE:

Northeast Corner of Section 25, T. 37, R. 28, Benton Co., MN.

Northwest Corner of Section 30, T. 37, R. 27, Mille Lacs Co., MN.

The line between Ranges 27 & 28, T. 37, was run by Dep. Surveyor Theo. Conkey in Oct. 1849. We were unable to find any remnants of his\* monument or accessories for this corner.

\*Please see the Certificate Of Location for the NE corner of Section 1, T. 37, R. 28, Benton County; also being the NW corner of Sec. 6, T. 37, R. 27, Mille Lacs County; for a "discussion" regarding general conditions (including GLO resurveys and "Judicial Roads") affecting the locations of the corners along this County line.

In 1994 we were hired by Benton Co. to restore certain corners along their east Co. line. Old survey notes, subsequent to the GLO notes, from both counties, if any, are as follows (in chronological order):

Benton: Requested from the Co. Hwy. Dept.. None provided other than GLO notes.

Mille Lacs: None along this line other than GLO.

We are aware of no other surveys by others other than: In 1994 Comstock & Davis, Inc., via their Little Falls office, was hired to provide Benton County with geodetic coordinates on selected corners within the County. They did this with a combination of GPS and traditional methods. The subject corner was not restored during said survey.

After thorough and careful analysis we held the centerline - centerline intersection of roads as this position best fit dependant lines of occupation along the section lines for a mile in each direction. Because there was no record of subsequent monuments we did not excavate in this intersection.

On 7/23/96 we placed a 3/4" iron pipe as shown on the front hereof.

MLCLS: /NW303727

BY *Alice O. Engelbrecher* DEPUTY  
Xm

ALICE O. ENGBRECHER  
COUNTY RECORDER

OCT 3 8 49 AM '97

OFFICE OF  
BENTON COUNTY RECORDER  
BENTON COUNTY, MN  
CERTIFIED TO BE FILED  
AND/OR RECORDED ON

244629