

Certified, Filed and or Recorded on
Nov. 07, 2008 AT 02:22PM


Signed: *Ju*
MARILYN J NOVAK
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 28, Township 37N, Range 28W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 12/30/08 found a 1/2" IRON PIPE OPEN DOWN 0.3'
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

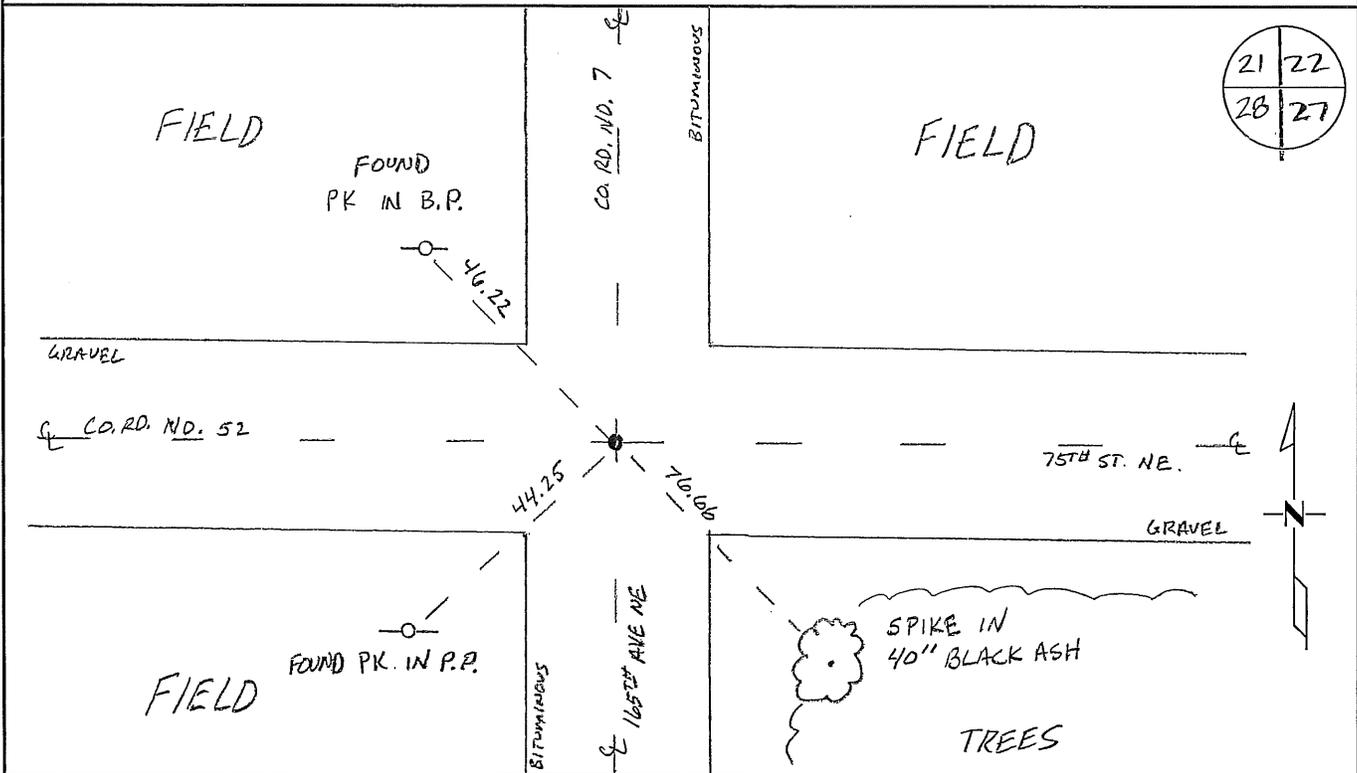

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature *Jan W. Oly*
Deputy Benton County Surveyor
License No. 45872

Date: 11/06/2008

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:

I282

Northeast Corner of Section 28, Township 37 North, Range 28 West, Maywood Township, 4th Principal Meridian, Benton County, Minnesota.

- 1855 Original US General Land Office survey set a wood post at this location and bearing trees were recorded.
- | | | |
|-----------|----------|----------|
| 13" Maple | S 20 ½ W | 36 links |
| 9" W Ash | N 14 W | 50 links |
- 1902 County Surveyor's Record Book A, Map No. 38, shows a survey of Section 27 by John Whilt. Corner is shown marked by a stone.
- 1925 County Engineer's notebook 45 shows corner in center of town road east-west with line run north. Noted as a stone.
- 1929 County Engineer's notebook No. 58 shows road survey by H. G. Elletson running west to east. Corner is shown as a stake in line with road north and south and with ties:
- | | | |
|-------------|----|-------|
| 4" Oak stp. | NW | 38.7' |
| Cor. F.P. | NW | 43.6' |
| Willow stp | SE | 38.0' |
- County Surveyor's Record Book 2, page 440, list same ties as above to stake with newer ties:
- | | | |
|-----------------|----|------|
| PP | SW | 45.0 |
| Anchor P | NW | 43.6 |
| 14 " Cottonwood | SE | 81.3 |
- 2005 On 4/20/05 excavated corner area with Benton County Highway Dept. backhoe. Down 4.2 feet in original clay ground, found a very old wood (oak) post point, 3" round and 1.5 feet long with small rock (10" round) and old rusted spike alongside. Accepted post and stone as being the obliterated corner position. Ties:
- | | | |
|----|----|-------|
| PP | SW | 44.24 |
| BP | NW | 46.19 |
- County Coordinates obtained by GPS
 NAD 83 (1996 Adjustment)
 N- 143027.151
 E- 558037.715
- 2008 The County Surveyor's Office searched and found the ½" iron pipe set over the post and stone recovered in 2005 excavation. Ties were updated and coordinates obtained by GPS agree with those reported above in 2005.