

Certified, Filed and or Recorded on
Aug. 24, 2009 AT 08:13AM


Signed: CK
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 19, Township 36, Range 30
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 10 APRIL 2008 found a 1/2" OPEN IRON PIPE
DATE
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____
DATE

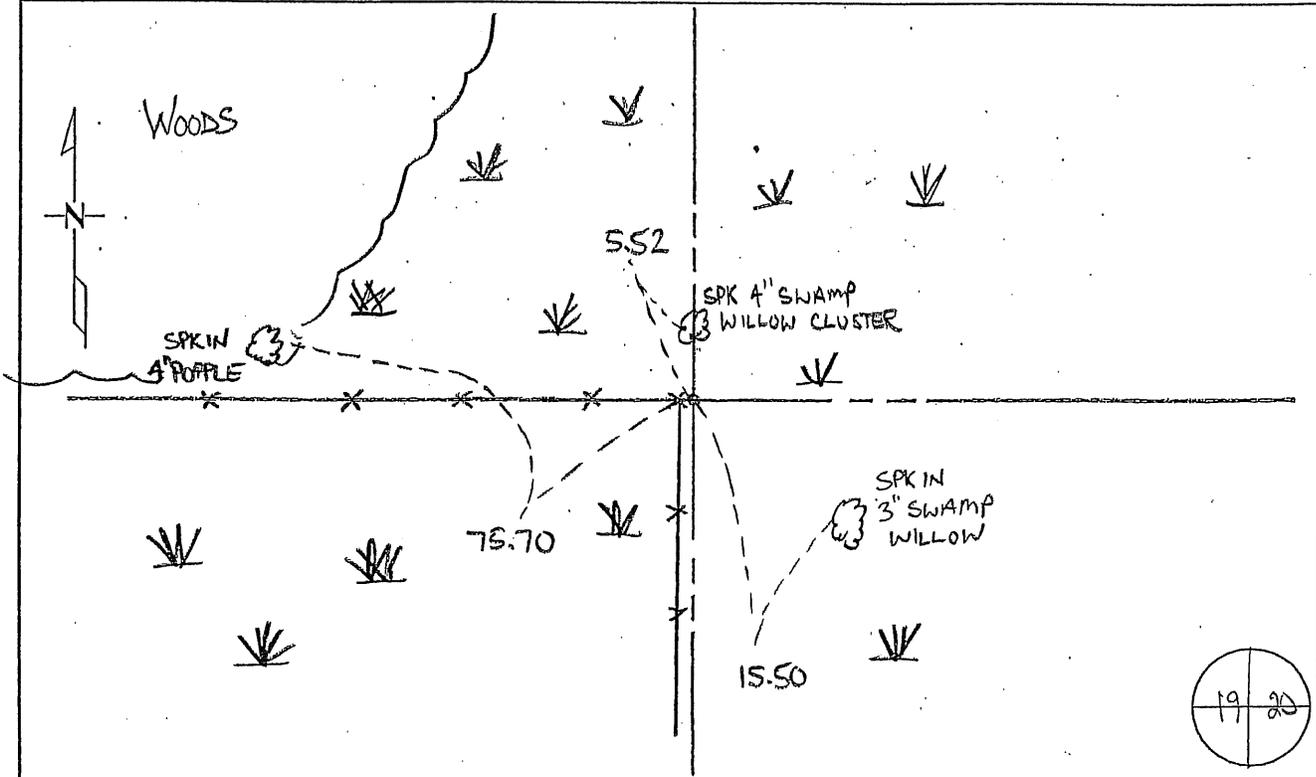

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature: Jerome C. Wittstock Date: 20 August 2009 License No. 19552
 Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

L193

The East Quarter Corner of Section 19, Township 36 North, Range 30 West, Minden Township, 4th Principal Meridian, Benton County, Minnesota.

- 1852 Original U.S. General Land Office survey established this corner and a wood post was set for the corner and bearing trees were recorded.
 6" Blk Oak N 1/2 W 1090 links
- 1917 County Surveyor's Record Book 1, page 199, and Record Book A, Map No. 44 shows survey of Section 20 done by N. Drolson. He notes he set a post in a swamp along a fence line from the SE corner of Section 19 and at a distance of 40.01 chains from the NE and SE Corners Sec 19. he notes a ditch runs east.
- 1931 County Surveyor's Record Book 1, page 197, shows a post under a rock, 1 foot west of the fence corner and notes a distance of 2640 feet to the SE Corner Sec. 19.
- 1995 Kevin Festler, LS 22702, found a 1/2" iron pipe on east side of fence corner with fence lines running west, north, and south. He filed a Certificate of Location (#230323).
- 2003 County Coordinates obtained by GPS to 1/2 " Iron Pipe.
 NAD 83 (1996 Adjustment)
 N- 113420.723
 E- 484172.346
 Found pipe to be 2643.67 feet north of the SE corner of Section 19.
- 2008 Westwood Professional Services, Inc. found a 1/2" open iron pipe at a fence line to the west. Distances fit 1917 and 1931 distances within 3 feet. Established reference ties to the corner and verified the 2003 coordinates.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

East Quarter Corner of Section 19, Township 36, Range 30, 4th P.M.

STATE OF MINNESOTA, County of Benton


At the corner location shown on the sketch:

On Feb. 16, 1995 found a 1/2 inch iron pipe monument
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

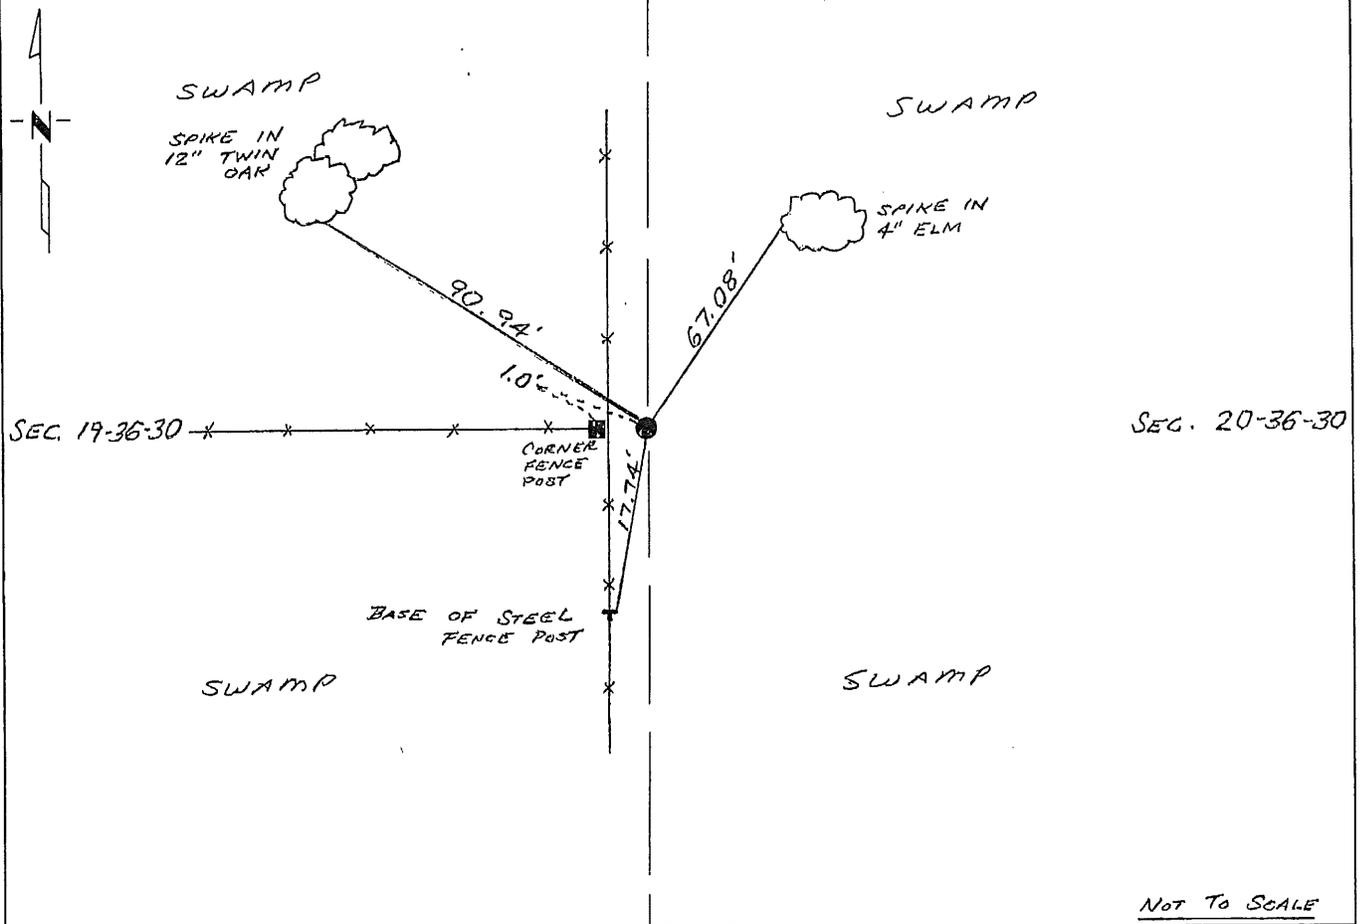

NOT TO SCALE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[Signature] 8/17/1995
SIGNATURE DATE

Registration No. 22702
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER
 County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 _____

County Recorder _____
 By _____, Deputy
 DOCUMENT NO. _____

Statement of Evidence:

The east quarter corner of Section 19, Township 36, Range 30, 4th Principal Meridian, Benton County, Minnesota, was set under the Public Land Survey as a post with bearing trees. No trace of post or trees now exists.

A search by Benton Co. Highway personnel of available county survey records revealed no additional information on this corner.

In 1995, Comstock & Davis, Inc. while remonumenting section corners for the purpose of G.P.S. work for Benton County found a 1/2 inch iron pipe monument at the east quarter corner position of Section 19, Twp. 36, Rng. 30, Comstock & Davis, Inc. compared the position of the 1/2 inch iron pipe to the original U.S. Government survey and found the position to be within reason of the Public Land Survey records. Comstock & Davis, Inc. accepted the position of the 1/2 inch iron pipe as the position for the east quarter corner of Section 19. Refer to Job. No. 945017.

2 3 0 3 2 3

STATE OF
BENTON COUNTY RECORDER
LENTON OGDEN, MN
CERTIFIED TO BE FILED
AND RECORDED ON

AUG 31 12 53 PM '95

ALICE A. OGDEN
COUNTY CLERK

BY mn JYXm