

Statement of Evidence: East Quarter Corner of Section 22, Township 36 North, Range 30 West, Minden Township, 4th Principal Meridian, Benton County, Minnesota.

1852 Original General Land Office survey established this Corner set a wood post at this location and bearing trees were recorded.

6" Blk Oak	N 30 1/2 E	41 links
6" Blk Oak	N 32 1/2 W	38 links

1940's MN/DOT Highway plans, File No. 30-39 and S.P. 0503, show the Corner was assumed at intersection of fence east-west and north with a distance of 1874.54 feet south to the centerline of TH 23.

1990 David Regan, LS 12236, set a 1/2" iron pipe at old fence corner occupation when subdividing Section 23. Iron pipe was found to be 18.8 feet south and 12.2 feet east of the lost position.

1992 James Nielsen, LS 11865, found an iron pipe capped #12236, which had been set by David Regan at the intersection of fence lines from the north and east and is in agreement with the 1947 right of way map. He filed a Certificate of Location (#216757).

County Coordinates from MN/DOT to RR spike:
NAD 83 (1986 Adjustment) N-113324.157, E-500189.303

2003-2005 On 10/14/2003, The Minnesota Department of Transportation, in cooperation with Gary Stevenson, Benton County Surveyor, found a 1/2" iron pipe with a RLS #12236 cap. The existing reference ties made on Certificate of Location document number 216757 were found to be correct.

County Coordinates obtained by GPS: (for reference only)
NAD 83 (1996 Adjustment) N-113324.74, E-500188.83

2004 Danny Kron, LS 42621, found iron pipe. He measured 2649.11 feet to NE Corner and 2607.43 feet to the SE Corner.

County Coordinates obtained by traverse by Surveying & Engineering Professionals, Inc.
NAD 83 (1996 Adjustment) N- 113324.657, E- 500188.859

2010 On 1/20/2010 The Minnesota Department of Transportation again found a 1/2 inch iron pipe. New reference ties were made. The Minnesota Department of Transportation accepts the 1/2 inch pipe as the correct location of the East Quarter Corner of Section 22, Township 36 North, Range 30 West, 4th Principal Meridian, Benton County, Minnesota.

For details and survey analysis, contact The Minnesota Department of Transportation District Surveys Office in Baxter, Minnesota

Certified, Filed and or Recorded on
Aug. 24, 2009 AT 08:14AM

Signed: CK
MARILYN J NOVAK G V I
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


EAST QUARTER Corner of Section 22, Township 36, Range 30
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

On 10 APR 2008 found a 1/2" I.P. WITH CAP "RLS 12236"
DATE

left monument as found lowered monument removed monument (explain)

On _____ placed an _____
DATE

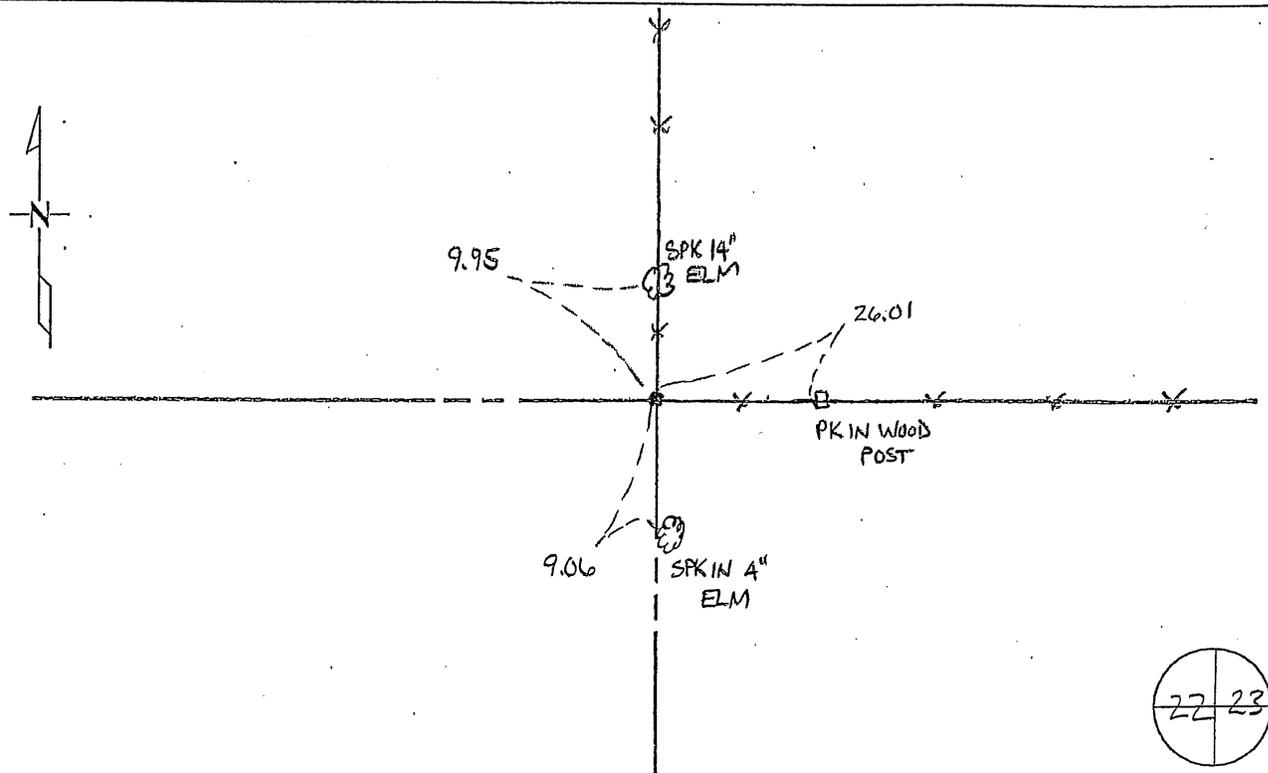

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature Jerome C. Wettsch Date 20 August 2009 License No. 19552

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Benton County Surveyor's Office
 Jerome C. Wittstock, County Surveyor
 Minnesota License No. 19552

Statement of Evidence:

L223

East Quarter Corner of Section 22, Township 36 North, Range 30 West, Minden Township, 4th Principal Meridian, Benton County, Minnesota.

- 1852 Original General Land Office survey established this corner set a wood post at this location and bearing trees were recorded.
- | | | |
|------------|------------|----------|
| 6" Blk Oak | N 30 1/2 E | 41 links |
| 6" Blk Oak | N 32 1/2 W | 38 links |
- 1940's MN/DOT Highway plans, File No. 30-39 and S.P. 0503, show the corner was assumed at intersection of fence east-west and north with a distance of 1874.54 feet south to the centerline of TH 23.
- 1990 David Regan, LS 12236, set a 1/2 " iron pipe at old fence corner occupation when subdividing Section 23. Pipe was found to be 18.8 feet south and 12.2 feet east of the lost position.
- 1992 James Nielsen, LS 11865, found an iron pipe capped #12236, which had been set by David Regan at the intersection of fence lines from the north and east and is in agreement with the 1947 right of way map. He filed a Certificate of Location (#216757).
 County Coordinates from MN/DOT to RR spike:
 NAD 83 (1986 Adjustment)
 N-113324.157
 E-500189.303
- 2004 Danny Kron, LS 42621, found iron pipe. He measured 2649.11 feet to NE corner and 2607.43 feet to the SE corner.
 County Coordinates obtained by traverse by Surveying & Engineering Professionals, Inc.
 NAD 83 (1996 Adjustment)
 N- 113324.657
 E- 500188.859
- 2004 County Coordinates from MN/DOT by GPS:
 NAD 83 (1996 Adjustment)
 N-113324.744
 E-500188.834
- 2008 Westwood Professional Services, Inc. found a 1/2-inch iron pipe capped "RLS 12236". Established reference ties and verified MnDOT's 2004 coordinates.

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

EAST QUARTER Corner of Section 22, Township 36N, Range 30W, 4th P.M.

STATE OF MINNESOTA, County of Benton


At the corner location shown on the sketch:

On 04/26/92 found a 1/2 inch pipe with cap #12236.
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

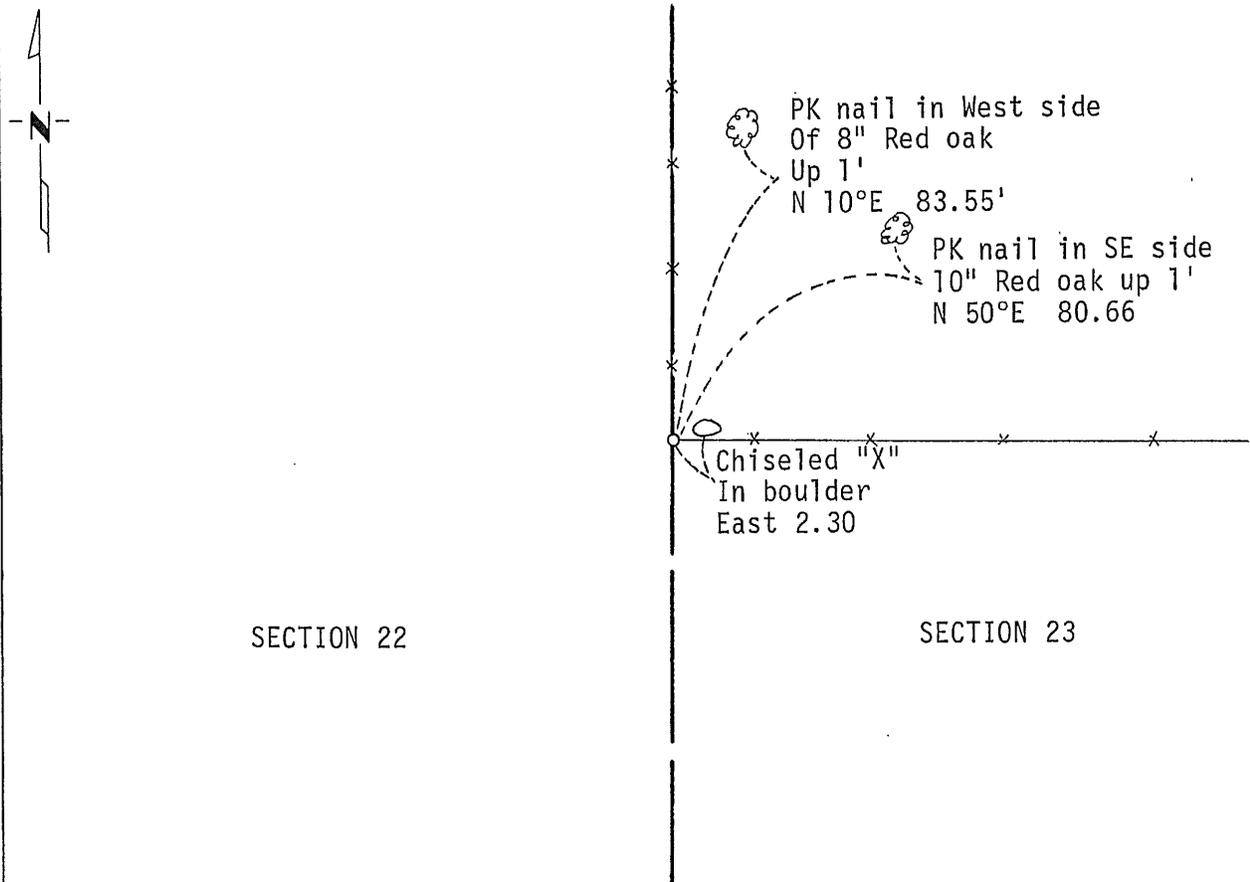

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

James W. Nielsen 1/7/1993
SIGNATURE DATE

Registration No. 11865

- Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 ____

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence:

EAST QUARTER CORNER SECTION 22; TOWNSHIP 36 NORTH,
RANGE 30 WEST

In 1852 the Original Public Land Survey was run and a wood post was set to mark the corner.

The 1947 Highway Department right of way map calls for the corner 1874.5 feet north of TH 23 station 274+46.2 at the intersection of fences east-west and north.

In 1990 David Reagan, Registered Land Surveyor, set a 1/2 inch capped pipe at the old fence corner occupation while subdividing Section 23. This pipe is 18.8 feet south and 12.2 feet east of a lost location.

In 1992 Mn/DOT recovered Mr. Reagan's capped pipe. The found pipe is in agreement with the occupation lines and with the location shown on the 1947 R/W map and is accepted by Mn/DOT as the correct location for the corner.

For details and survey analysis contact the Minnesota Department of Transportation Surveys Office in Baxter, MN.

216757

OFFICE OF
BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND/OR RECORDED ON

AUG 3 4 07 PM '93

ALICE D. ENGELMEYER
COUNTY RECORDER

BY *[Signature]* DEPUTY