

Certified, Filed and or Recorded on
May 06, 2008 AT 01:20PM


Signed: JN
MARILYN J NOVAK G V J
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTHEAST Corner of Section 5, Township 36, Range 30
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 02 APRIL 08 found a 1/2" IRON PIPE WORN CAP
DATE
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____
DATE

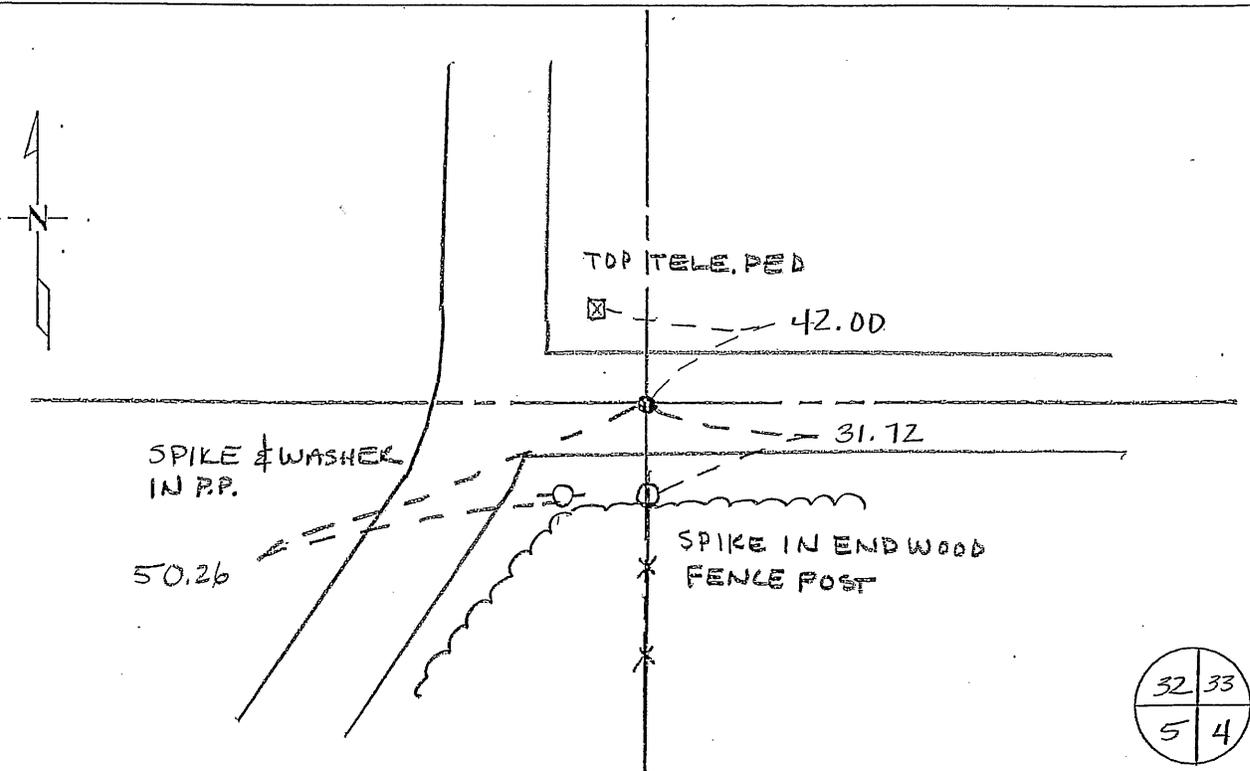

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature: Jerome C Wittstock Date: 06 May 2006 License No. 19552
Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Benton County Surveyor's Office
 Jerome C. Wittstock, County Surveyor
 Minnesota License No. 19552

Statement of Evidence:**L052**

The Northeast Corner of Section 5, Township 36 North, Range 30 West, Minden Township, 4th Principal Meridian, Benton County, Minnesota.

1849 Original US General Land Office survey established this corner and notes a wood post was set with bearing trees marked:

6" Blk Oak	N 40 E	26 links
4" Blk Oak	N 64 W	24 links

1933 County Engineer's Notebook No. 71 contains survey of Township road running south to north and terminating at or near this corner. Notes show possible corner marked by a hub in center of road east. Ties:

R. Oak	E	26.7'
Twin Maple	S	33.8'

1957 M.W.Carley notes the following reference ties to an iron monument. (Also noted in the County Surveyor's Record Book 1, page 169.)

12" Oak	SE	111.1
12" Oak	SW	108.5
12" W Oak	SE	97.6
PP	SW	50.7

1961-1968 MW Carley notes the following reference ties.

Trans. Pole		50.3
Tele. Pole	NW	38.64
16" Oak	SE	97.55

1995 Kevin Festler, LS, set a 1/2" pipe, capped #16097, at the intersection of the centerline of an east/west road, fence line south and 2 ties from 1961. He filed a Certificate of Location (#230316).

Comstock and Davis performed GPS work under contract with Benton County. County Coordinates Obtained by GPS: NAD 83 (1986 Adjustment) to an iron pipe:

N- 132202.112
 E- 489275.291

2008 Westwood Professional Services, Inc. found a 1/2" iron pipe (cap destroyed) at the centerline of east/west road, and fence line south.

County Coordinates obtained by GPS
 NAD 83 (1996 Adjustment)

N-132202.267
 E-489274.712

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER


Northeast Corner of Section 5, Township 36, Range 30, 4th P.M.

STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On 2-8-95 found a centerline east-west and a fence line
DATE south and two 1961 ties
- left monument as found, lowered monument, removed monument (explain)
- On 2-15-95 placed a 1/2 inch iron pipe monument capped RLS 16097
DATE

SKETCH OF REFERENCE TIES

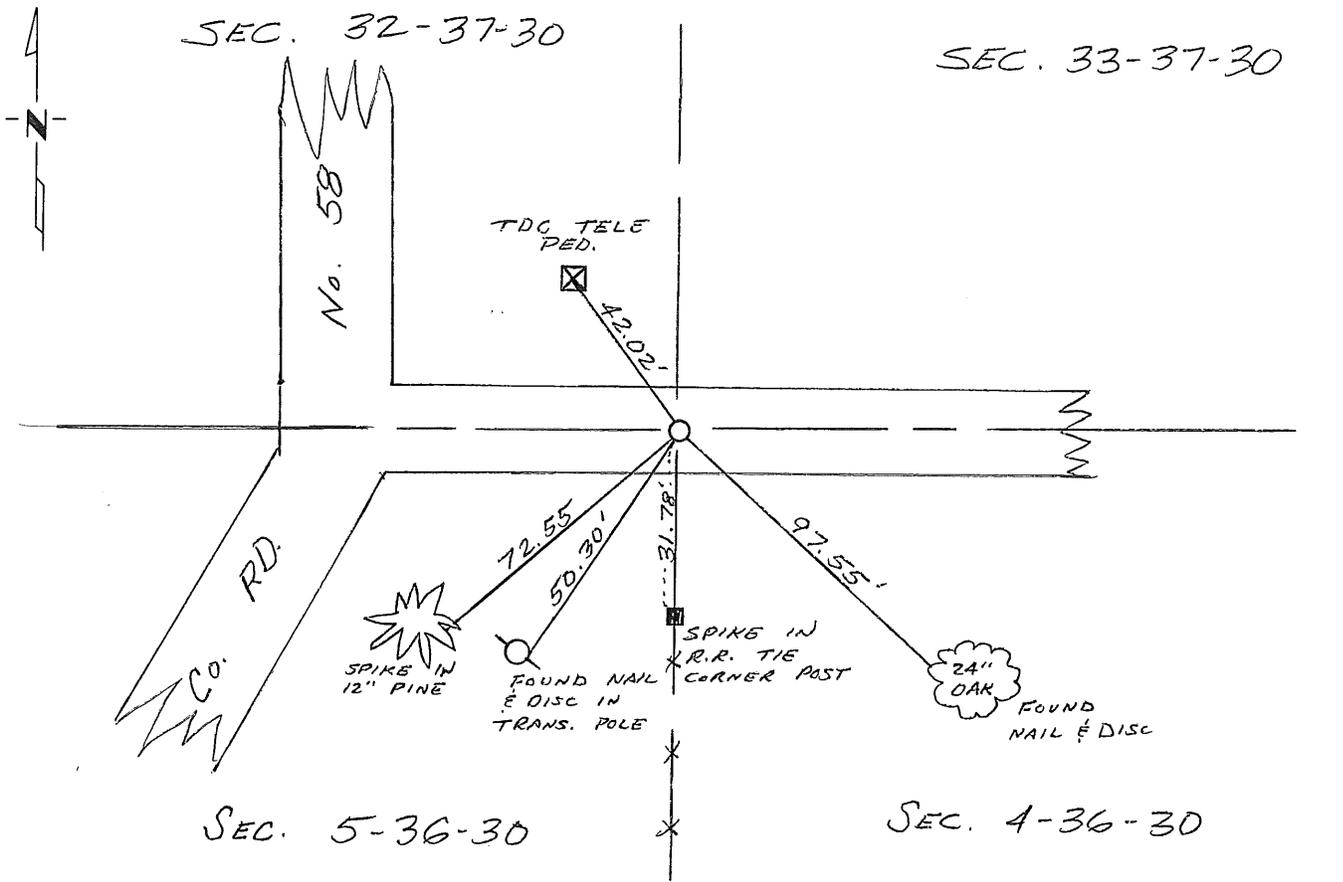

NOT TO SCALE

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

[Signature] 8/17/1995
SIGNATURE DATE

Registration No. 22702

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 _____

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence:

The northeast corner of Section 5, Township 36, Range 30, 4th Principal Meridian, Benton County, Minnesota, was set under the Public Land Survey as a post with bearing trees. No trace of post or trees now exists.

A search by Benton Co. Highway personnel of available county survey records revealed no additional information on this corner.

In 1995, Comstock & Davis, Inc. while remonumenting section corners for the purpose of G.P.S. work for Benton County found evidence of the position of the northeast corner of Section 5, Twp. 36, Rng. 30 by a centerline east-west and a fence line south. Further evidence was located by researching other Land Surveyors records which turned up old ties from 1961 of which two were found. The position from the two remaining ties was then reset. Comstock & Davis, Inc. then compared this position with the Public Land Survey records and found it to be within reason. Comstock & Davis, Inc. accepted the position established from the 1961 ties as the position of the northeast corner of Section 5 and set a 1/2 inch iron pipe monument capped RLS No. 16097. Refer to Job No. 945017.

230316

BENTON COUNTY RECORDER
BENTON COUNTY, MN
CERTIFIED TO BE FILED
AND TO BE RECORDED ON

AUG 31 12 52 PM '95

ALICE J. JOHNSON
COUNTY CLERK

BY Mm COUNTY CLERK