

286405

Office of the County Recorder, BENTON County, Minnesota
I hereby certify that the within instrument was filed for record in this office on the
3rd day of June, 2002. 12:06 PM


MARILYN J. NOVAK
COUNTY RECORDER
By BW Deputy

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter Corner of Section 14, Township 36, Range 29
4TH Principal Meridian, State of Minnesota, County of BENTON

At the corner location shown on the sketch:

- On 5/13/2002 found a nothing
DATE
- left monument as found lowered monument removed monument (explain)
- On 5/20/2002 placed a PK at the corner location using old MnDOT alignment
DATE
maps for MNTH 25

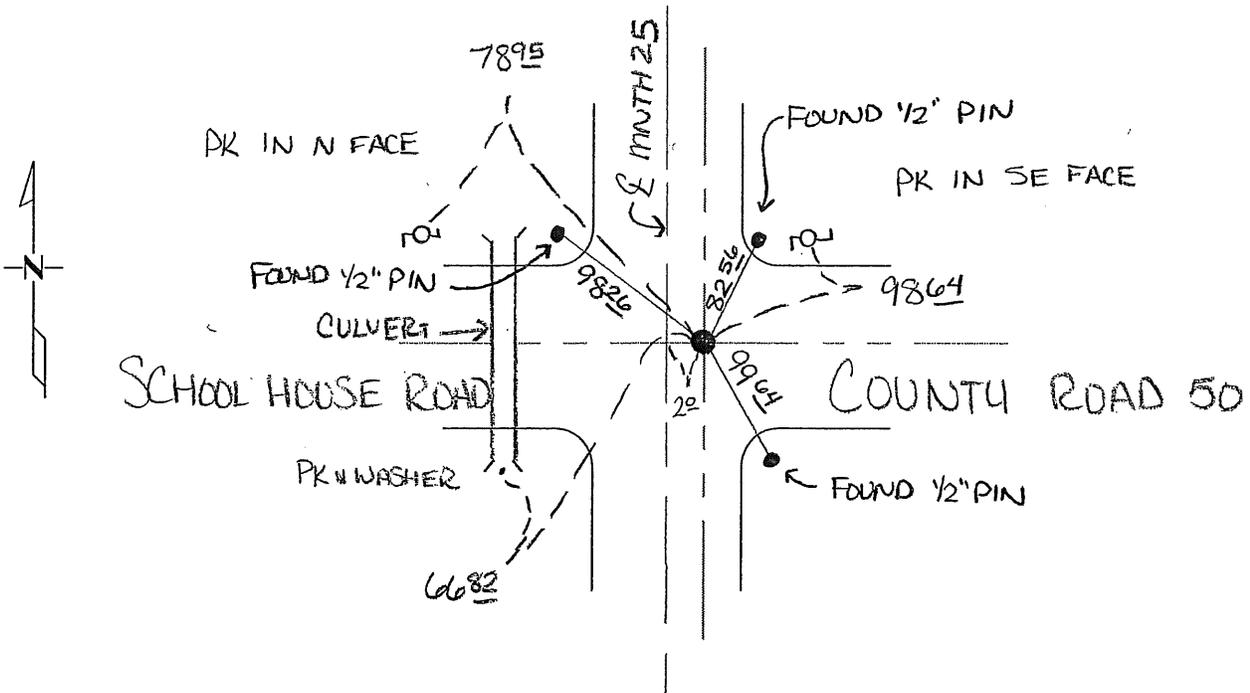

Ref. Job #20025051

Ties that are found and in good condition are noted as 'existing'.
New ties are to the head of a nail with a disk marked 'Corner Tie'.

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Signature] Date 6/3/02 License No. 12684

Title: Land Surveyor Professional Engineer County Surveyor County Engineer

Statement of Evidence:

K141

The North Quarter Corner of Section 14, Township 36 North, Range 29 West, St. George Township, 4th Principal Meridian, Benton County, Minnesota.

In 1855, Oscar F. Davis set a wood post at this location and bearing trees were recorded.

7" W. Oak	S 15 E	22 links
11" Aspen	N 32 1/2 E	25 links
16" Aspen	West	19.16 1/2 chains

This corner is 40.23 1/2 chains from the NW and the NE Cor's.

On August 24, 1950 Lynn Carlson found a 2" X 2" wood hub and replaced it with a pre-cast concrete monument with an aluminum cap and established reference ties.

Concrete monument	NW	98.0
Concrete monument	SW	98.3
Concrete monument	SE	97.0

On May 13, 2002 Westwood Professional Services, Inc. recreated the MnDOT alignment, dated 1950's, of MNTH 25 (running north and south). We found no evidence of the corner position, as all of the concrete monuments have been destroyed. We established the corner location using the MnDOT alignment. While searching for evidence of the corner we found three 1/2 inch iron pins near the area of the intersection of Minnesota Trunk Highway 25 (running north and south) and County Road 50 (running east and west). It is obvious that these pins were set as reference ties to the corner. They are the typical type of pins used by MnDOT survey crews. We checked with the MnDOT offices at Brainerd and St. Cloud, but they could find no record of the ties to these pins. We could not use these to tie into the road alignment but the locations and distances from the established corner are:

1/2 inch iron pin	NW	98.26 feet
1/2 inch iron pin	NE	82.56 feet
1/2 inch iron pin	SE	99.64 feet

On May 20, 2002 Westwood Professional Services, Inc. set a PK at the corner location as established from the alignment coordinates furnished by MnDOT. The MnDOT office in St. Cloud furnished coordinates for centerline PI's and some R/W monuments based on NAD 83 (1986 Adjustment).

Reference Job #20025051

Coordinates Obtained by GPS
NAD 83 (1996 Adjustment)
N-122022.375
E-534832.321