

Certified, Filed and or Recorded on
Dec. 16, 2008 AT 01:45PM

Signed: BW
MARILYN J NOVAK G V
BENTON COUNTY MINNESOTA
MARILYN J NOVAK
COUNTY RECORDER


CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 15, Township 36N, Range 29W
4TH Principal Meridian, State of Minnesota, County of Benton

At the corner location shown on the sketch:

- On 10/13/08 found a 1/2" IRON PIPE
- left monument as found lowered monument removed monument (explain)
- On _____ placed an _____

10
15

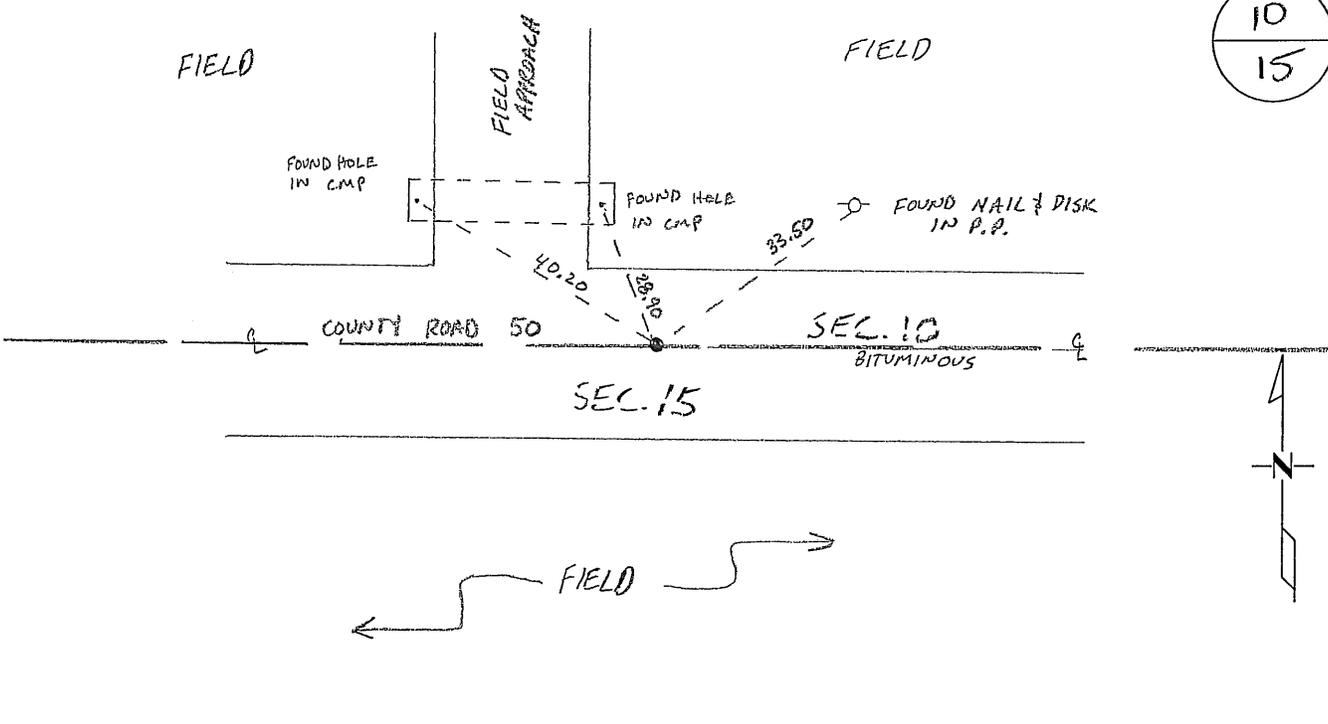

Statement of evidence for this corner location is on back of this page.

I hereby certify that this document was researched and prepared by me or under my direct supervision and that I am a licensed Land Surveyor under the laws of the State of Minnesota.

Signature [Handwritten Signature]
Deputy Benton County Surveyor
License No. 45872

Date: 11/06/2008

Benton County Surveyor's Office
 Jason W. Oberg, Deputy County Surveyor
 Minnesota License No. 45872

Statement of Evidence:**K151**

North Quarter Corner of Section 15, Township 36 North, Range 29 West, St. George Township, 4th Principal Meridian, Benton County, Minnesota.

1855 Original US General Land Office survey established corner marked by a wood post with bearing trees:

5" Blk Ash	N 2 W	36 links
7" Aspen	S 46 ½ E	23 links

1933 County Engineer's Notebook No. 67 shows road survey by H. G. Elletson running east-west. Corner is shown as a spike set in center of road with fence north and ties:

Stake North 28.0'

Stationing gives distances of 2662.6 feet to the NE corner and 2646.6 feet to the NW corner with no delta angle. (Also noted in County Surveyor's Record Book 1, page 113.)

1962 Entry in same notebook shows found spike with ties:

PP	N	34.95'
TP	SE	88.65'

1984 Dave Regan, LS 12236, set a ½" pipe in the centerline of roads east/west and a field division line north/south. He filed a Certificate of Location (#173412) and notes a distance of 2661.07 feet to the NE corner Sec 15.

2004 Found ½ " iron pipe in east-west road. Measured 2661.07 feet to the NE corner and 2651.20 feet to the NW corner. Pipe is 0.3 feet south of a straight line between section corners.

2008 The County Surveyor's Office searched and found a ½" iron pipe on the centerline of bituminous road (County Road No. 50). Position agrees with 1962 tie to power pole, and 1933 distance to NE corner (2661.1 ft. vs. 2662.6 ft.). Surveyor accepts the position as marking the obliterated corner. Ties were updated.

County Coordinates Obtained by GPS
 NAD 83 (1996 Adjustment)
 N- 121847.479
 E- 529518.618

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

North Quarter _____ Corner of Section 15, Township 36, Range 29, 4th P.M.


STATE OF MINNESOTA, County of Benton

At the corner location shown on the sketch:

- On _____ found a _____
DATE
- left monument as found, lowered monument, removed monument (explain)
- On 8/13/84 placed a $\frac{1}{2}$ inch iron pipe in center line east-west road and on field division north-south
DATE

*18.60
Ac 13
10.36.24
1.8.104
1.8.104
1.8.104*

SKETCH OF REFERENCE TIES

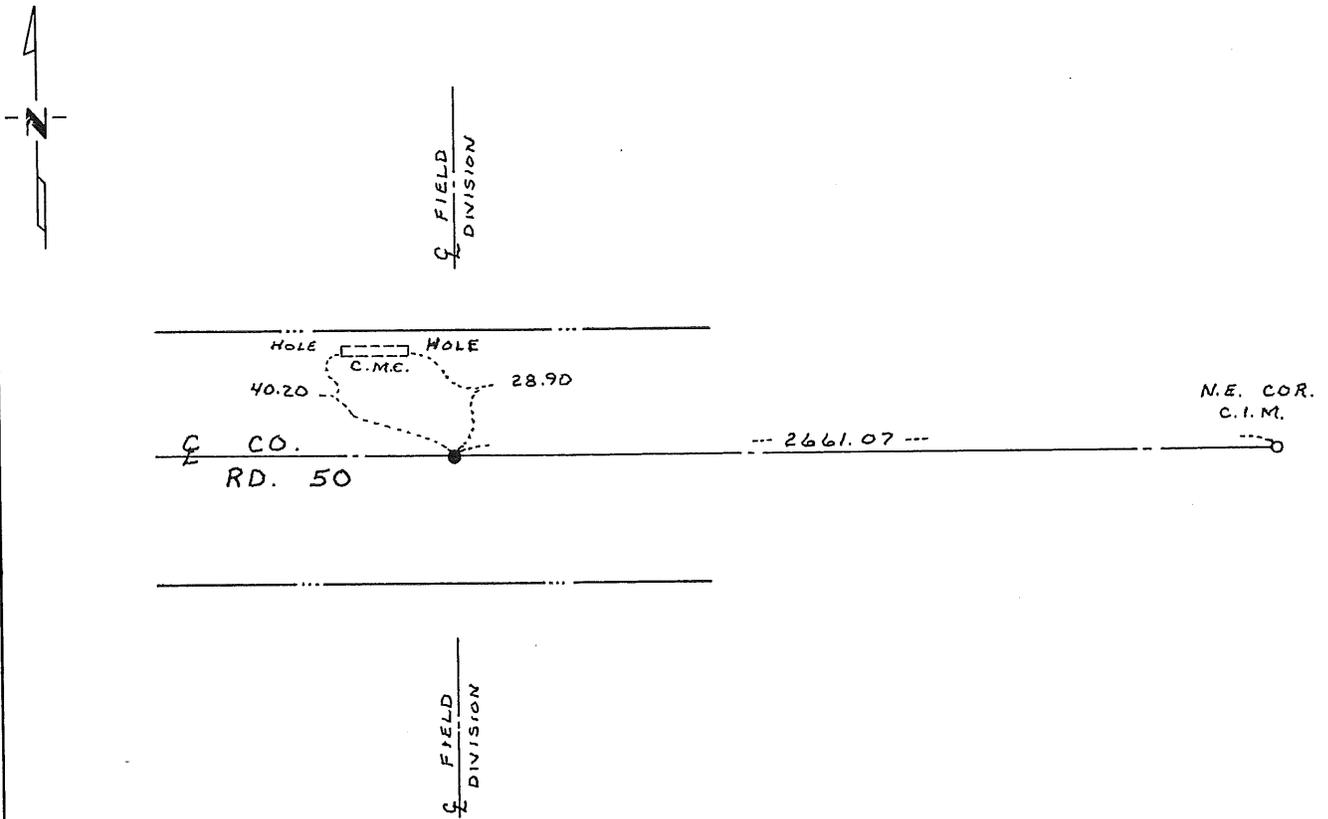

173412

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

David P. Regan
SIGNATURE DATE 1/8/85

Registration No. 12236
 Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

County Recorder
OFFICE OF ~~THE~~ REGISTER OF DEEDS
County of Benton

I hereby certify that this document was filed in the Reg. of Deeds office at 11 A.M. on the 16th day of May A.D., 1985
County Recorder
Register of Deeds Alise C. Engelmeier

By _____, Deputy

DOCUMENT NO. _____